


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Woodstock Public School (3499)  
**Region :** Western NSW  
**State Electorate :** Cootamundra  
**Local Government Area :** Cowra

**Initial Survey :** Noel Arnold & Associates : 30 - May - 2008  
**Reviewed By :** Grencap-NAA : 08 - Dec - 2016

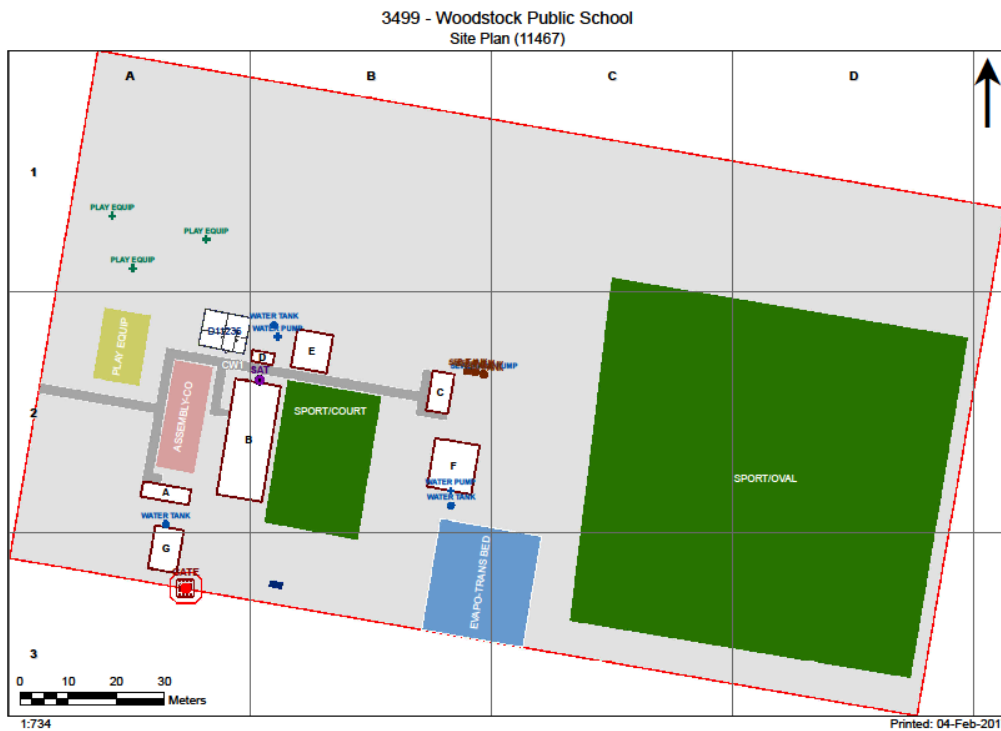

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Building Services/Pupil Facilities - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3499/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00A - R0001 - Garden Store**

Wall Linings Internal	Flat AC Sheeting 3499/B00A/R0003/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3499/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected

**B00A - R0002 - Sports Store**

Wall Linings Internal	Flat AC Sheeting 3499/B00A/R0003/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3499/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected

**B00A - R0003 - Personal Effects Storage**

Wall Linings Internal	Flat AC Sheeting 3499/B00A/R0003/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3499/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library/General Learning - 1933 - Timber (Timber)**

**Exterior**

Pitched Roof - Flat  
Ceiling - Void

Non Accessible Area

- Height restricted approx 4m high. Manhole centre of room.

Underfloor Voids -  
Packing to Floor Joists

No Asbestos Found

**Interior**

**B00B - R0002 - Reading Area**

No Asbestos

**B00B - R0003 - Home Base**

No Asbestos

**B00B - R0004 - Home Base**

No Asbestos

**B00B - R0005 - Principal**

No Asbestos

**B00B - R0006 - Movement**

No Asbestos

**B00B - R0008 - Practical Activities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1932 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof Non Accessible Area  
- No manhole ceiling height 2.5m

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior**

**B00C - R0005 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3499/B00C/R0007/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3499/B00C/R0007/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
3499/B00C/R0006/Wall Linings Internal/S6						

**B00C - R0007 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
3499/B00C/R0007/Wall Linings Internal/S3						

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3499/B00C/R0007/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1933 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids - Flat Roof      No Asbestos Found

**Interior**

**B00D - R0001 - Drinking Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Music - 2008 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00E - R0001 - Movement**

No Asbestos

**B00E - R0002 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00F - R0001 - Reading Area**

No Asbestos

**B00F - R0002 - K.L.A. Store**

No Asbestos

**B00F - R0003 - Practical Activities**

No Asbestos

**B00F - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 2012 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00G - R0001 - Garden Store**

No Asbestos

**B00G - R0002 - Practical Activities**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - External Walkway**

**Exterior**

Ceiling Voids - Flat Roof    No Asbestos Found

**Interior**

**B00H - R0001 - Movement from gate to Assembly**

No Asbestos

**B00H - R0002 - Movement A-C**

Expansion Joint	Bituman					
	3499/B00H/R0003/Expansion Joint/S5					<b>No Asbestos Detected</b>

**B00H - R0003 - Movement B**

Expansion Joint	Bituman					
	3499/B00H/R0003/Expansion Joint/S5					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 505 - D11236 - Admin Staff/Principal/Secure Store : Placement Date - 10/03/2003**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - Principal**

No Asbestos Found.

**R3 - Staff Room**

No Asbestos Found.

**R4 - Security Store**

No Asbestos Found.

**R5 - Clerical Office**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017