


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woolbrook Public School (3501)
Region : New England
State Electorate : Tamworth
Local Government Area : Walcha

Initial Survey : Noel Arnold & Associates : 23 - Apr - 2008
Register Issue Date : 23 - Mar - 2017

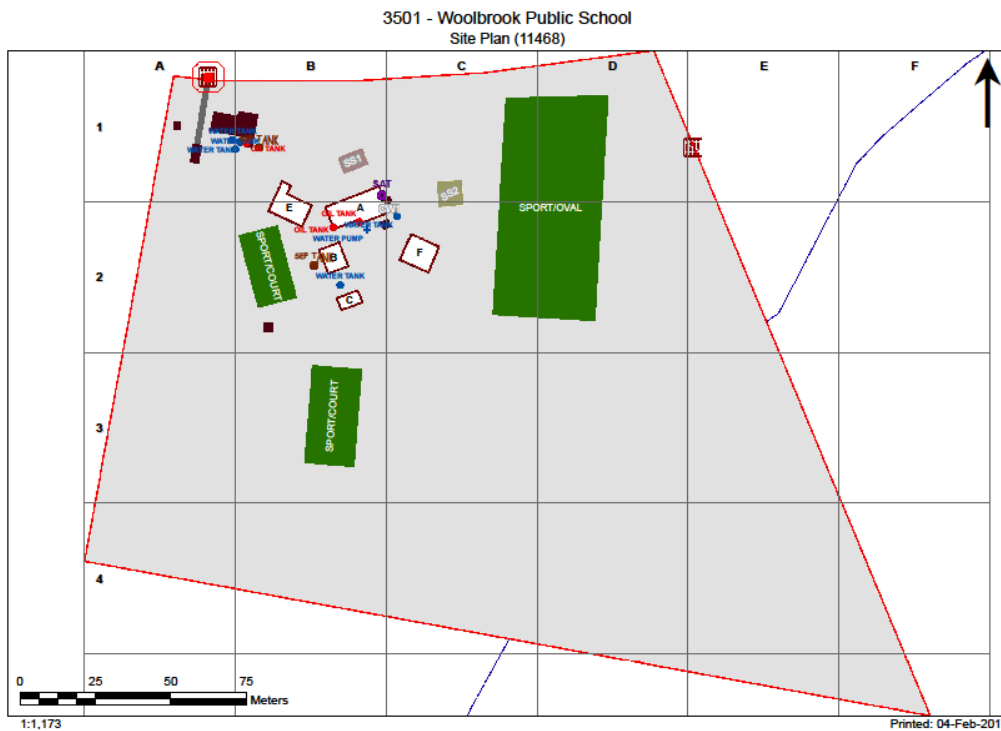

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1880 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0001 - Staff Room

No Asbestos

B00A - R0002 - Principal

No Asbestos

B00A - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	3501/B00A/R0003/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	3501/B00A/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0007 - Home Base

No Asbestos

B00A - R0010 - Home Base Store

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1990 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Requires Inspection					

Interior**B00B - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/R0003/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0004 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3501/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Special Purpose - 1940 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 2009 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00E - R0001 - Practical Activities

No Asbestos

B00E - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - Reading Area

No Asbestos

B00F - R0002 - K.L.A. Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017