


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woolomin Public School (3506)
Region : New England
State Electorate : Tamworth
Local Government Area : Tamworth

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Grencap-NAA : 14 - Apr - 2016

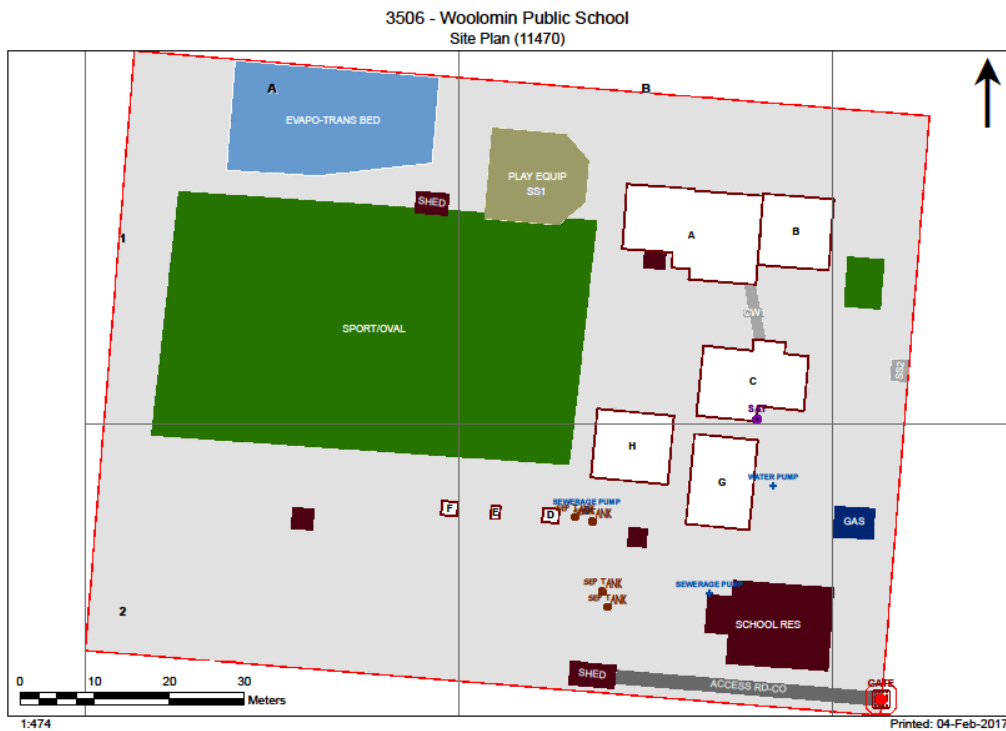

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1925 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3506/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height restricted. Manhole approx 5m above floor.					

Interior

B00A - R0001 - Staff Room

Floor Coverings Res/Textile	Vinyl Sheet					
	3506/B00A/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	3506/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Sheet					
	3506/B00A/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	3506/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0003 - Principal

No Asbestos

B00A - R0004 - Clerical Office

Floor Coverings Res/Textile	Vinyl Sheet					
	3506/B00A/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	3506/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0005 - Drinking Facilities

No Asbestos

B00A - R0007 - Covered Outdoor Learning Area

Window beading	Caulking					
	3506/B00A/R0007/Window beading/S6					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1907 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3506/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	Compressed AC Sheet					
	3506/B00B/Underfloor Voids - Packing to Floor Joists/S7					No Asbestos Detected
Ceiling Void - Flat ceiling, pitched roof	Non Accessible Area					
	- No manhole and height restricted. Ceiling height approx 5m					

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Movement

Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Cannot sample. Assumed live.
Floor Coverings Res/Textile	Vinyl Sheet					
	3506/B00A/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	3506/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00B - R0003 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting					
	3506/B00B/R0003/Wall Linings Internal/S2					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/Library - 1994 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 3506/B00C/Eaves Linings/S3					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Void - Flat ceiling, pitched roof	Non Accessible Area - No manhole, ceiling height aprox 2.5m					

Interior

B00C - R0001 - Reading Area

No Asbestos

B00C - R0002 - Entry Vestibule

No Asbestos

B00C - R0003 - Clerical Office/Workroom

No Asbestos

B00C - R0004 - Staff Kitchen

No Asbestos

B00C - R0005 - Movement

No Asbestos

B00C - R0006 - Disabled Toilet

No Asbestos

B00C - R0007 - Principal

No Asbestos

B00C - R0008 - General Storeroom

No Asbestos

B00C - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1947 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00D - R0001 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Staff Facilities - 1947 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1947 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Toilets - Boys

No Asbestos

B00F - R0002 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00G - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00H - R0001 - Reading Area

No Asbestos

B00H - R0002 - K.L.A. Store

No Asbestos

B00H - R0003 - Practical Activities

No Asbestos

B00H - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017