


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woonona Public School (3510)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 06 - May - 2008
Reviewed By : Grencap-NAA : 26 - Aug - 2014

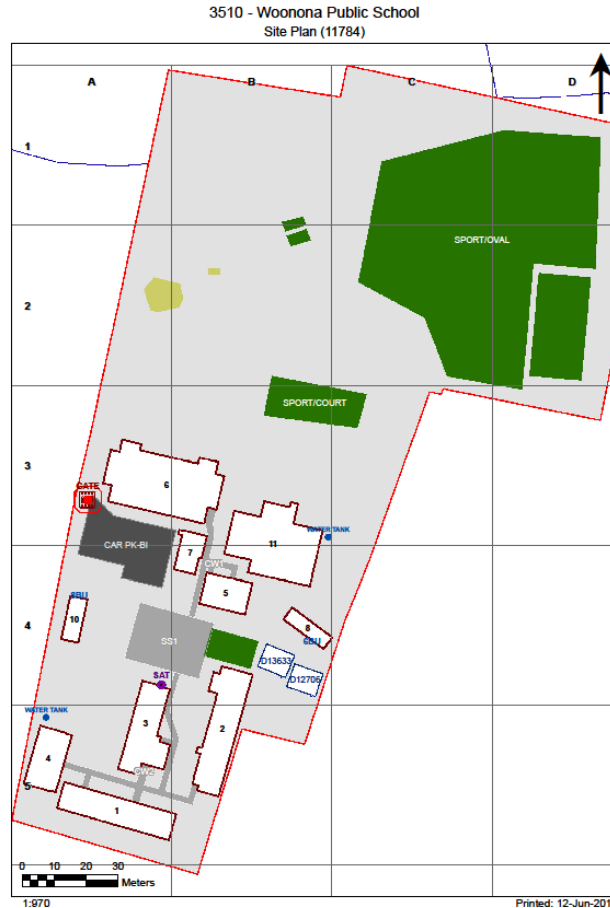

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - Administration/General Learning - 1964 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/Gable Verge Lining/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/In-fill-panel/S1				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	150m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/Eaves Linings/S23				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior**B001 - R0001 - Staff Toilet (2.11 m2)**

Wall Linings Internal	Flat AC Sheeting	5m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0001/Wall Linings Internal/S22				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	

B001 - R0002 - General Storeroom (3.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0003 - Deputy Principal (15.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0004 - Personal Effects Storage (2.73 m2)

No Asbestos

B001 - R0005 - Movement (3.76 m2)

No Asbestos

B001 - R0006 - Home Base (57.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles	57.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0007 - Home Base Store (4.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0008 - Movement (6.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0009 - Sick Bay (12.93 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0010 - Staff Room (57.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B001 - R0011 - Uniform Shop (4.48 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B001 - R0012 - Clerical Office (19.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	19.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B001 - R0013 - Clerical Office/Workroom (28.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	South east corner	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B001 - R0014 - Entry Vestibule (6.75 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B001 - R0015 - Movement (12.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B001 - R0016 - Staff Toilet (4.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - one sealed unit						
B001 - R0017 - Staff Toilet (4.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B001 - R0018 - Cleaning Distributed Store (1.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B001 - R0019 - Principal (20.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	20.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B001 - R0020 - Main Switch Board (2.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0020/Wall Linings Internal/S24					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning - 1882 - Brick/Block (Brick/Block)**Exterior**

Wall lining, adjacent tap Western wall lower panel, Adjacent R9004 entrance	Flat AC Sheeting					
	3510/B002/Wall lining, adjacent tap Western wall lower panel, Adjacent R9004 entrance/S27					No Asbestos Detected
Eaves Linings	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/Eaves Linings/S28					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B002 - R0001 - General Storeroom (15.01 m2)**

No Asbestos

B002 - R0004 - Movement (4.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B002 - R0005 - Home Base (44.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles	44.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B002 - R0006 - Home Base (51.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles	51.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B002 - R0007 - Home Base (52.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles	52.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B002 - R0010 - Movement (8.92 m2)

No Asbestos

B002 - R0011 - External Movement (3.7 m2)

No Asbestos

B002 - R0012 - External Movement (2.67 m2)

No Asbestos

B002 - R0013 - Stairs (11.26 m2)

No Asbestos

B002 - R0014 - Movement (55.42 m2)

No Asbestos

B002 - R0015 - Home Base Store (11.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B002 - R0016 - Home Base Store (9.77 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B002 - R0017 - Home Base (57.4 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	57.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B002/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	

- B002 - R9001 - General Storeroom (50.72 m2)**
No Asbestos
- B002 - R9002 - General Assistant/Bulk Store (15.53 m2)**
No Asbestos
- B002 - R9004 - Movement (8.53 m2)**
No Asbestos
- B002 - R9005 - Cleaning Distributed Store (3.71 m2)**
No Asbestos
- B002 - R9006 - General Storeroom (14.92 m2)**
No Asbestos
- B002 - R9007 - Sports Store (28.69 m2)**
No Asbestos
- B002 - R9008 - Home Base (50.77 m2)**
No Asbestos
- B002 - R9009 - Home Base Store (10.05 m2)**
No Asbestos
- B002 - R9010 - External Movement (1.83 m2)**
No Asbestos
- B002 - R9011 - Stairs (3.23 m2)**
No Asbestos
- B002 - R9012 - Movement (9.09 m2)**
No Asbestos
- B002 - R9013 - General Assistant/Bulk Store (13.82 m2)**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Library/General Learning - 1882 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/Eaves Linings/S23					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B003 - R0001 - K.L.A. Store (9.24 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0002 - Reading Area (13.83 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0003 - Library Office/Workroom (6.84 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0004 - Movement (16.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0005 - K.L.A. Store (8.64 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3510/B003/R0005/Floor Coverings Res/Textile/S14					No Asbestos Detected

B003 - R0006 - Library Office/Workroom (24.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	24.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0007 - Reading Area (43.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	43.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0008 - Library Office/Workroom (4.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0009 - Reading Area (79.17 m2)

Floor Coverings Res/Textile	Vinyl Tiles	79.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0010 - Communications Room (41.09 m2)

Floor Coverings Res/Textile	Vinyl Tiles	41.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B003 - R0011 - External Movement (2.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	3510/B003/R0011/Ceiling Structures/Linings/S15					No Asbestos Detected

B003 - R9001 - Cleaning Supplies (8.65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B003 - R9002 - Drinking Facilities (24.37 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - General Learning - 1967 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/Eaves Linings/S23					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/R0001/In-fill-panel/S21					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Norh & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/Gable Verge Lining/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B004 - R0001 - External Movement (34.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/R0001/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	8m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/R0001/In-fill-panel/S21					Chrysotile (white asbestos)

B004 - R0002 - Home Base (56.73 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	56.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B004 - R0003 - Home Base Store (4.1 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/R0004/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B004 - R0004 - Movement (6.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B004 - R0005 - Personal Effects Storage (12.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/R0004/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B004 - R0006 - Distribution Board (0.8 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B004/R0004/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0020/Wall Linings Internal/S24					Chrysotile (white asbestos)

B004 - R0007 - Home Base (56.81 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3510/B001/R0019/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	56.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B001/R0008/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B004 - R0008 - Home Base Store (3.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B004/R0004/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B005 - General Learning - 1940 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B010/Eaves Linings/S29				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Packing	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**B005 - R0001 - Home Base Store (5.92 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B005 - R0002 - Practical Activities - 1hb (6.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	6.24m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B005 - R0003 - Home Base (52.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Wall Linings Internal/S10				Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles	52.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B005 - R0004 - Home Base (52.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Wall Linings Internal/S10				Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles	52.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B001/R0008/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	

B005 - R0005 - Movement (21.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B005/R0005/Wall Linings Internal/S10				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - General Learning - 1927 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior**B006 - R0001 - Movement (3.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B006 - R0002 - Cleaning Distributed Store (5.78 m2)

No Asbestos

B006 - R0003 - Withdrawal Space - 1hb (3.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B006 - R0004 - Movement (13.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B006 - R0005 - Movement (3.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B006 - R0006 - Personal Effects Storage (12.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B006 - R0007 - Movement (13.21 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B006 - R0008 - Home Base (47.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles	47.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B006 - R0009 - Home Base (48.21 m2)

Floor Coverings Res/Textile	Vinyl Tiles	48.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B006 - R0010 - Home Base (48.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles	48.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B006 - R0011 - Home Base (46.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	46.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B006 - R0012 - Movement (44.66 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	12m	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0012/In-fill-panel/S5				Chrysotile (white asbestos)		
B006 - R0013 - Movement (12.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B006 - R0014 - Movement (17.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R0015 - Movement (3.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R0016 - Home Base Store (7.35 m2)						
No Asbestos						
B006 - R0017 - Personal Effects Storage (12.52 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B006 - R0018 - Deputy Principal (16.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B006 - R0021 - General Storeroom (17.54 m2)						
No Asbestos						
B006 - R0022 - Movement (3.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R0023 - Stairs (6.06 m2)						
No Asbestos						
B006 - R0024 - Stairs (6.66 m2)						
No Asbestos						
B006 - R0025 - Practical Activities (70.09 m2)						
No Asbestos						
B006 - R0026 - Withdrawal Space - 1hb (26.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	26.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B006 - R0027 - Special Programs Room (36.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	36.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B006 - R1001 - Withdrawal Space - 1hb (18.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B006 - R1002 - Movement (8.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B006 - R1003 - Personal Effects Storage (10.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B006 - R1004 - Practical Activities - 1hb (9.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B006 - R1005 - Home Base (47.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	47.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B006 - R1006 - Movement (59.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B006 - R1007 - Home Base (51.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	51.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B006 - R1008 - Home Base (48.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	4m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0012/In-fill-panel/S5					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	48.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B006 - R1009 - Home Base (48.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	4m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0012/In-fill-panel/S5					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	48.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B006 - R1010 - Staff Toilet (3.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3510/B006/R0014/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R1011 - Personal Effects Storage (6.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R1012 - Movement (8.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R1013 - Staff Room (18.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	18.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0014/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B006 - R1014 - Stairs (11.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R1015 - Stairs (11.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3510/B006/R0004/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		
B006 - R9001 - Garden Store (17.39 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Pupil Facilities - 1940 - Timber (Timber)

Exterior

Pillar Packing	Flat AC Sheeting 3510/B007/Pillar Packing/S6	10	Variable positions	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Height Restriction					
Eaves Linings	Flat AC Sheeting 3510/B010/Eaves Linings/S29	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B007 - R0005 - Movement (1.3 m2)

No Asbestos

B007 - R0009 - Canteen Covered Area (36.38 m2)

No Asbestos

B007 - R0010 - Canteen (33.58 m2)

No Asbestos

B007 - R0011 - Canteen Office/Store (11.52 m2)

No Asbestos

B007 - R0012 - Staff Toilet (2.69 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Pupil Facilities - 1931 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 3510/B010/Eaves Linings/S29	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior

B008 - R0002 - Staff Toilet (1.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B008/R0001/Ceiling Structures/Linings/S11	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B008 - R0004 - General Storeroom (12.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	12.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B008 - R0005 - General Storeroom (9.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B008/R0001/Ceiling Structures/Linings/S11	9.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B008 - R0006 - Handwashing Facilities (8.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	8.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B008 - R0007 - Toilets - Boys (25.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B008/R0001/Ceiling Structures/Linings/S11	25.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - Pupil Facilities - 1940 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3510/B010/Eaves Linings/S29	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B010 - R0003 - Staff Toilet (2.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B010 - R0004 - Staff Toilet (1.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B010 - R0005 - Toilets - Girls (17.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	17.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B010 - R0006 - Handwashing Facilities (10.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	10.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B010 - R0007 - Handwashing Facilities (4.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	4.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B010 - R0008 - Toilets - Girls (12.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	12.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B010 - R0009 - General Storeroom (11.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3510/B010/R0001/Ceiling Structures/Linings/S12	11.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B011 - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B011 - R0001 - Communal Space (238.53 m2)

No Asbestos

B011 - R0002 - Communal/Performance Store (10.82 m2)

No Asbestos

B011 - R0003 - Chair Storeroom (11 m2)

No Asbestos

B011 - R0004 - Movement (6.35 m2)

No Asbestos

B011 - R0005 - P.E. Store (16.74 m2)

No Asbestos

B011 - R0006 - Toilet - Lobby (1.91 m2)

No Asbestos

B011 - R0007 - Toilets - Boys (11.39 m2)

No Asbestos

B011 - R0008 - Sound Cupboard (2.69 m2)

No Asbestos

B011 - R0009 - Toilet - Lobby (3.49 m2)

No Asbestos

B011 - R0010 - Toilets - Girls (10.92 m2)

No Asbestos

B011 - R0011 - Cleaning Distributed Store (4.95 m2)

No Asbestos

B011 - R0012 - Access Shower/Toilet/Change (7.35 m2)

No Asbestos

B011 - R0013 - Main Switch Board (2.84 m2)

No Asbestos

B011 - R0014 - External Movement (47.15 m2)


No Asbestos

B011 - R0015 - Covered Outdoor Learning Area (116.72 m2)

No Asbestos

B011 - R0016 - External Movement (5.84 m2)

No Asbestos

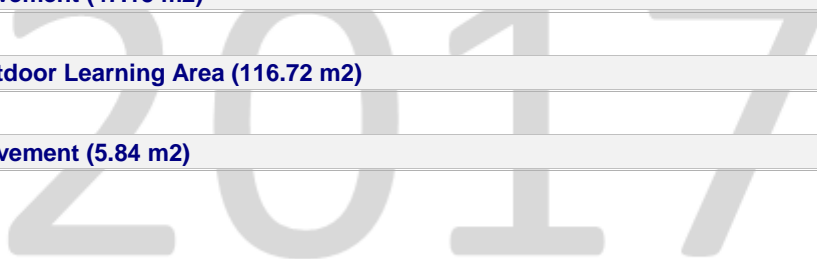

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Covered walkway

Exterior

No Asbestos

Interior

Build+1 - Room+1 - R0001

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

3510/Build+1/Room+1/Ceiling Structures/Linings/S16

Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D12706 - Learning Unit - Standard With P.A.A. : Placement Date - 7/01/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13633 - Learning Unit - Standard With P.A.A. : Placement Date - 4/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017