


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : West Wyalong Public School (3519)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Bland

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : AECOM : 27 - Nov - 2014

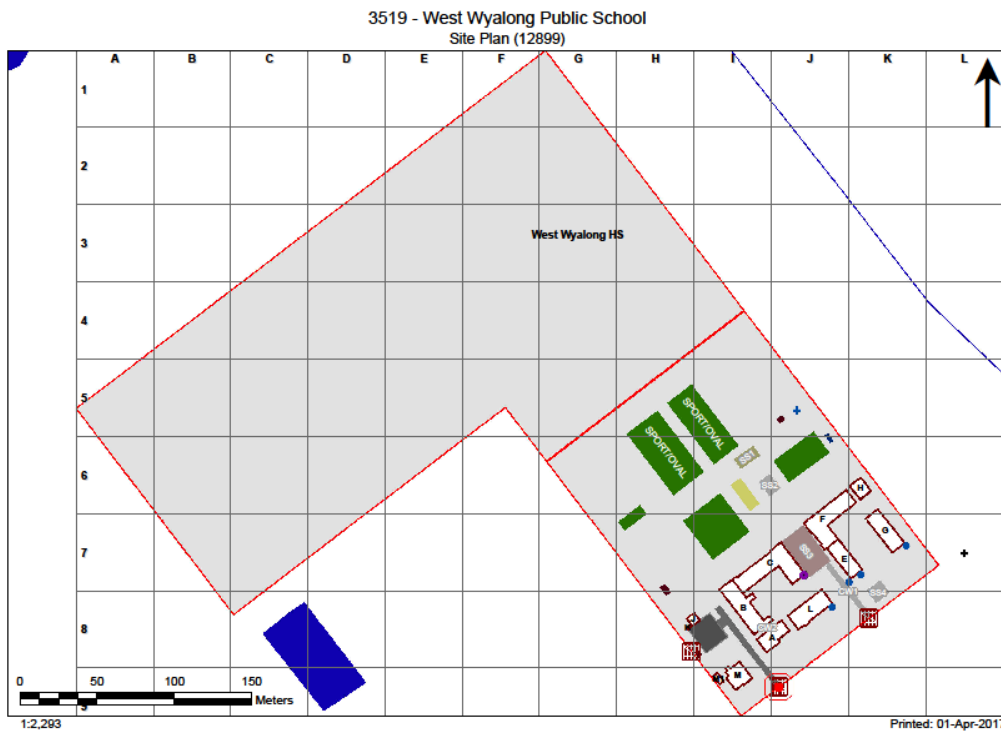

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1972 - Brick/Block (Brick/Block)

Exterior

Window In-fill-panel	Flat AC Sheeting	6m2	Southeast and northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground and/or no designated access point identified.					

Interior

B00A - R0001 - Security Store (10.67 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00A/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00A - R0002 - Deputy Principal (19.96 m2)

No Asbestos

B00A - R0003 - Principal (20.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00A/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00A - R0004 - General Storeroom (0.43 m2)

No Asbestos

B00A - R0005 - General Storeroom (0.43 m2)

No Asbestos

B00A - R0006 - General Storeroom (0.43 m2)

Electrical Mounting Board	Resinous Board	1Unit	Toward base of cupboard	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard - labelled 'LEBAH'					

B00A - R0007 - Movement (23.39 m2)

Window In-fill-panel	Flat AC Sheeting	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)

B00A - R0008 - Entry Vestibule (12.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00A/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00A - R0009 - Clerical Office (14.65 m2)

No Asbestos

B00A - R0010 - Duplicating Workroom (14.7 m2)

No Asbestos

B00A - R0011 - General Storeroom (3.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00A/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00A - R0012 - Sick Bay (6.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00A/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00A - R0013 - Staff Toilet (3.5 m2)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible - access requires					

B00A - R0014 - General Storeroom (6.35 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Mounting Board	Resinous Board	1Unit	North facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard - labelled 'LEBAH'

B00A - R0015 - Movement (22.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3519/B00A/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00A - R0016 - Movement (1.8 m2)						
No Asbestos						

B00A - R0017 - Cleaning Distributed Store (3.25 m2)						
No Asbestos						

B00A - R0018 - Staff Toilet (3.52 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting	36m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Slab on ground and/or no designated access point identified.					
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement (87.68 m2)**

Window In-fill-panel	Flat AC Sheeting	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)

B00B - R0002 - Canteen Office/Store (2.97 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Staff Toilet (4.91 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0004 - Canteen (32.77 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0005 - Sports Store (7.83 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0006 - Personal Effects Storage (6.74 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0007 - Home Base Store (6.73 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0008 - Home Base (57.43 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

In-fill-panel	Flat AC Sheeting					
	3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected

B00B - R0009 - Home Base (57.27 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

In-fill-panel	Flat AC Sheeting					
	3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected

B00B - R0010 - Home Base Store (6.59 m2)

Ceiling Structures/Linings	Vermiculite					
	3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0011 - Personal Effects Storage (13.34 m2)						
Ceiling Structures/Linings	Vermiculite 3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0012 - Distribution Board (0.49 m2)						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard - labelled 'LEBAH'
Door Lining	Flat AC Sheeting 3519/B00B/R0012/Door Lining/S14	3m2	East facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
B00B - R0013 - Home Base Store (6.82 m2)						
Ceiling Structures/Linings	Vermiculite 3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0014 - Home Base (56.39 m2)						
Ceiling Structures/Linings	Vermiculite 3519/B00B/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Flat AC Sheeting 3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R0017 - External Stairs (4.74 m2)						
No Asbestos						
B00B - R0018 - External Movement (4.8 m2)						
No Asbestos						
B00B - R0019 - General Storeroom (5.22 m2)						
No Asbestos						
B00B - R0020 - External Stairs (4.72 m2)						
No Asbestos						
B00B - R0021 - External Movement (4.82 m2)						
No Asbestos						
B00B - R0022 - General Storeroom (4.68 m2)						
No Asbestos						
B00B - R1001 - Craft Store (5.89 m2)						
No Asbestos						
B00B - R1003 - Movement (63.56 m2)						
Window In-fill-panel	Flat AC Sheeting 3519/B00B/R0001/Window In-fill-panel/S9	11m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1004 - Distribution Board (0.59 m2)						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting 3519/B00B/R1004/Wall Linings Internal/S4					No Asbestos Detected
B00B - R1006 - Home Base (56.03 m2)						
In-fill-panel	Flat AC Sheeting 3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R1007 - Withdrawal Space - 1hb (14.98 m2)						
In-fill-panel	Flat AC Sheeting 3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R1008 - Practical Activities - 1hb (3.54 m2)						
No Asbestos						
B00B - R1009 - Home Base Store (3.54 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1011 - Home Base Store (3.54 m2)						
No Asbestos						
B00B - R1012 - Home Base (56.42 m2)						
In-fill-panel	Flat AC Sheeting					
	3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R1013 - Home Base (55.72 m2)						
In-fill-panel	Flat AC Sheeting					
	3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R1014 - Withdrawal Space - 1hb (14.95 m2)						
In-fill-panel	Flat AC Sheeting					
	3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R1015 - Practical Activities - 1hb (3.54 m2)						
No Asbestos						
B00B - R1016 - Home Base Store (3.54 m2)						
No Asbestos						
B00B - R1018 - Home Base Store (3.54 m2)						
No Asbestos						
B00B - R1019 - Home Base (56.58 m2)						
In-fill-panel	Flat AC Sheeting					
	3519/B00B/R1019/Infill panel to air vent/S5					No Asbestos Detected
B00B - R1020 - External Stairs (16.38 m2)						
No Asbestos						
B00B - R1021 - External Stairs (16.39 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Pupil Facilities/Multi Purpose Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9				Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground and/or no designated access point identified.					
Ceiling Voids	Non Accessible Area - Area inaccessible - limited access via CR0001 and CR0017. Crawl space only due roof structure and AC plant.					

Interior**B00C - R0001 - Staff Toilet (6.09 m2)**

No Asbestos

B00C - R0002 - Staff Toilet (6.06 m2)

No Asbestos

B00C - R0003 - Staff Room (57.53 m2)

No Asbestos

B00C - R0008 - Distribution Board (0.69 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00C/R0008/Electrical Mounting Board/S8				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	Interior wall(s)	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3519/B00C/R0008/Wall Linings Internal/S17				Chrysotile (white asbestos)	

B00C - R0010 - Staff Room Annexe (31.1 m2)

No Asbestos

B00C - R0011 - Toilets - Boys (35.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00C/R0011/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0014 - Toilets - Girls (35.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00C/R0011/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Incinerator	Encapsulated Insulation material within unit	2Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible - access requires					

B00C - R0015 - Movement (102.51 m2)

No Asbestos

B00C - R0016 - Movement (119.25 m2)

Window In-fill-panel	Flat AC Sheeting	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9				Chrysotile (white asbestos)	

B00C - R0017 - Disabled Toilet (10.21 m2)

No Asbestos

B00C - R0018 - Movement (1.9 m2)

No Asbestos

B00C - R0019 - Special Programs Room - Type 1 (21.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00C/R0021/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Adhesive below vinyl tiles	Adhesive 3519/B00C/R0021/Adhesive below vinyl tiles/S22					No Asbestos Detected
Window frames	Putty 3519/B00C/R0022/Window frames/S18					No Asbestos Detected
B00C - R0020 - Special Programs Room - Type 1 (21.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3519/B00C/R0021/Floor Coverings Res/Textile/S21	21.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Adhesive below vinyl tiles	Adhesive 3519/B00C/R0021/Adhesive below vinyl tiles/S22					No Asbestos Detected
Window frames	Putty 3519/B00C/R0022/Window frames/S18					No Asbestos Detected
B00C - R0021 - Special Programs Room - Type 1 (51.92 m2)						
Window frames	Putty 3519/B00C/R0022/Window frames/S18					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3519/B00C/R0021/Wall Linings Internal/S20					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3519/B00C/R0021/Floor Coverings Res/Textile/S21	51.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Adhesive below vinyl tiles	Adhesive 3519/B00C/R0021/Adhesive below vinyl tiles/S22					No Asbestos Detected
B00C - R0022 - Movement (15.03 m2)						
Window frames	Putty 3519/B00C/R0022/Window frames/S18					No Asbestos Detected
Bituminous adhesive	Adhesive 3519/B00C/R0022/Bituminous adhesive/S19					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Support Unit - 1972 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - No designated access point identified. Ceilings generally 4m high.
Underfloor Voids	Non Accessible Area - Crawl space only, maximum clearance ~0.5 m.

Interior

B00E - R0001 - Movement (62.45 m2)

No Asbestos

B00E - R0002 - Home Base (48.48 m2)

No Asbestos

B00E - R0003 - Movement (18.73 m2)

No Asbestos

B00E - R0004 - Staff Room Annexe (14.53 m2)

No Asbestos

B00E - R0005 - Toilet - M (4.05 m2)

Wall Linings Internal	Flat AC Sheeting								
	3519/B00E/R0005/Wall Linings Internal/S2								No Asbestos Detected

B00E - R0006 - General Storeroom (9.71 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00E/R0006/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00E - R0007 - Home Base - M (36.13 m2)

No Asbestos

B00E - R0008 - Practical Activities - M - 1hb (12.2 m2)

No Asbestos

B00E - R0009 - Cleaning Distributed Store (5.28 m2)

No Asbestos

B00E - R0010 - General Storeroom (7.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting	8m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground and/or no designated access point identified.					
Ceiling Voids	Flat AC Sheeting	5m2	Gable lining above FR0009	Some Damage - Unsealed (3)	Medium (2)	Low Priority (2-3)
	3519/B00F/Ceiling Voids/S11					Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting	<1m2	Loose access panel	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00F/Ceiling Voids/S11					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	NA	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3519/B00F/Gable Verge Lining/S23					Chrysotile (white asbestos)

Interior**B00F - R0001 - General Storeroom (3.31 m2)**

Wall Linings Internal	Flat AC Sheeting	14m2	Middle portion, Lower portion	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3519/B00F/R0006/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00F - R0002 - Practical Activities - 1hb (1.96 m2)

No Asbestos

B00F - R0003 - Home Base (86.99 m2)

No Asbestos

B00F - R0004 - Home Base (86.87 m2)

No Asbestos

B00F - R0005 - Practical Activities - 1hb (1.94 m2)

No Asbestos

B00F - R0006 - General Storeroom (3.27 m2)

Wall Linings Internal	Flat AC Sheeting	14m2	Middle portion, Lower portion	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3519/B00F/R0006/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00F - R0007 - Staff Toilet (2.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00F/R0010/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible - access requires					

B00F - R0008 - Toilets - Girls (38.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00F/R0010/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00F - R0009 - Cleaning Distributed Store (1.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00F/R0010/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00F - R0010 - Toilets - Boys (35.55 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00F/R0010/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00F - R0012 - Movement (87.29 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window In-fill-panel	Flat AC Sheeting	8m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3519/B00F/R0010/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00F - R0013 - Movement (94.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1984 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00G/Eaves Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance 30 - 40cm.					
Infill panel to side of access ramp	Flat AC Sheeting					
	3519/B00G/Infill panel to side of access ramp/S24					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00G - R0001 - General Storeroom (13.37 m2)

No Asbestos

B00G - R0002 - General Storeroom (9.35 m2)

No Asbestos

B00G - R0003 - Movement (3.28 m2)

No Asbestos

B00G - R0004 - Sports Store (6.08 m2)

No Asbestos

B00G - R0005 - Home Base (53.53 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00G/R0009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0006 - Home Base (36.1 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00G/R0009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0007 - Practical Activities - 1hb (17.21 m2)


No Asbestos

B00G - R0008 - Home Base (67.15 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00G/R0009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0009 - Movement (56.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00G/R0009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

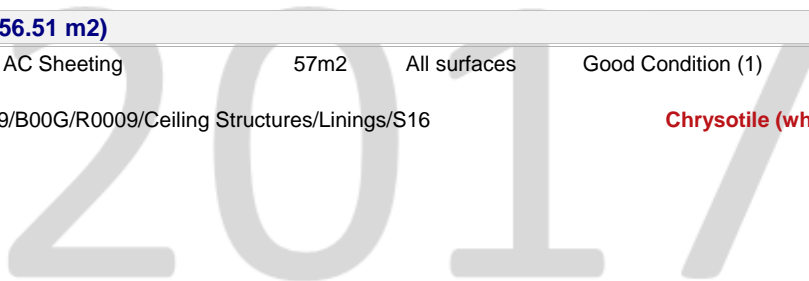

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-Commercial - 1972 - Brick/Block (Brick/Block)

Exterior

Window In-fill-panel	Flat AC Sheeting	10m2	North, west facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground and/or no designated access point identified.					
Ceiling Voids	Non Accessible Area - Area inaccessible - keys not held by school.					

Interior

B00H - R0001 - Other-Commercial (20.99 m2)

No Asbestos

B00H - R0002 - Other-Commercial (15.08 m2)

No Asbestos

B00H - R0003 - Other-Commercial (3.77 m2)

No Asbestos

B00H - R0004 - Other-Commercial (2.79 m2)

No Asbestos

B00H - R0005 - Other-Commercial (8.36 m2)

No Asbestos

B00H - R0006 - Other-Commercial (2.89 m2)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible - keys to dental						

B00H - R0007 - Other-Commercial (8.38 m2)

No Asbestos

B00H - R0008 - Other-Commercial (5.1 m2)

No Asbestos

B00H - R0009 - Other-Commercial (16.19 m2)

Window In-fill-panel	Flat AC Sheeting	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3519/B00B/R0001/Window In-fill-panel/S9					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1972 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - General Assistant/Bulk Store (35.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 1972 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground

Interior

B00K - R0001 - Cleaning Supplies (4.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00L - R0001 - Reading Area (169.57 m2)

No Asbestos

B00L - R0002 - Library Office/Workroom (22.8 m2)

No Asbestos

B00L - R0003 - Communications Room (8.08 m2)

No Asbestos

B00L - R0004 - K.L.A. Store (14.83 m2)

No Asbestos

B00L - R0005 - Toilet - Lobby (2.48 m2)

No Asbestos

B00L - R0006 - Staff Toilet (4.8 m2)

No Asbestos

B00L - R0007 - Cleaning Distributed Store (3.64 m2)

No Asbestos

B00L - R0008 - Distribution Board (0.66 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0009 - Garden Store (11.49 m2)

No Asbestos

B00L - R0010 - General Assistant/Bulk Store (15.42 m2)

No Asbestos

B00L - R0011 - Sports Store (11.9 m2)

No Asbestos

B00L - R0012 - Main Switch Board (2.68 m2)

No Asbestos

B00L - R0013 - External Movement (22.31 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017