


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wyndham Public School (3525)  
**Region :** Illawarra and South East  
**State Electorate :** Bega  
**Local Government Area :** Bega Valley

**Initial Survey :** Noel Arnold & Associates : 07 - May - 2008  
**Reviewed By :** Greencap-NAA : 17 - Jun - 2016

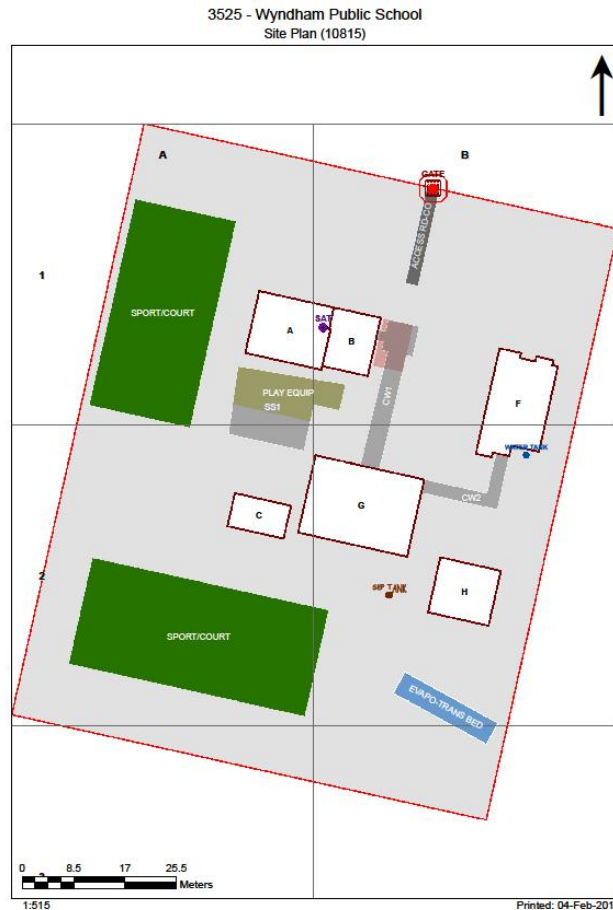

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Library - 1891 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction

**Interior**

**B00A - R0002 - Uniform Shop**

No Asbestos

**B00A - R0003 - Staff Kitchen**

No Asbestos

**B00A - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

3525/B00A/R0007/Ceiling Structures/Linings/S2

**Chrysotile (white asbestos)**

**B00A - R0008 - Library Office/Workroom**

No Asbestos

**B00A - R0009 - Reading Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3525/B00A/R0007/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	

**B00B - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	15.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3525/B00B/R0002/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	14.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3525/B00B/R0002/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

**B00B - R0007 - Disabled Toilet**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Special Purpose - 1891 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris	2m2	Southeast corner	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

**Interior**

**B00C - R0003 - Special Programs Room**

Wall Linings Internal	Flat AC Sheeting 3525/B00C/R0003/Wall Linings Internal/S8					<b>No Asbestos Detected</b>
-----------------------	--	--	--	--	--	-----------------------------

**B00C - R0004 - Craft Store**

No Asbestos

**B00C - R0005 - Special Programs Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration/Staff Facilities - 1903 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible					
Awnings	Flat AC Sheeting 3525/B00F/Awnings/S6					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 3525/B00F/Wall Cladding/S7					No Asbestos Detected

**Interior****B00F - R0001 - Principal**

No Asbestos

**B00F - R0002 - Clerical Office**

No Asbestos

**B00F - R0003 - Clerical Office/Workroom**

No Asbestos

**B00F - R0004 - Toilets - Boys/Girls**

No Asbestos

**B00F - R0005 - Sick Bay**

Floor Coverings Res/Textile	Vinyl Sheet 3525/B00F/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3525/B00F/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected

**B00F - R0006 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet 3525/B00F/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3525/B00F/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected

**B00F - R0007 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet 3525/B00F/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3525/B00F/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected

**B00F - R0008 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting 3525/B00C/R0001/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00F - R0009 - Staff Kitchen**

Floor Coverings Res/Textile	Vinyl Sheet 3525/B00F/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3525/B00F/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected

**B00F - R0010 - Staff Room**

Fire Place	Flat AC Sheeting 3525/B00F/R0010/Fire Place/S5					No Asbestos Detected
------------	---	--	--	--	--	----------------------

**B00F - R0011 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - R0012 - Clerical Office**

No Asbestos

**B00F - R0013 - Entry Vestibule**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Building Services - 2003 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Movement**

No Asbestos

**B00G - R0002 - Practical Activities - 1hb**

No Asbestos

**B00G - R0003 - Home Base Store**

No Asbestos

**B00G - R0004 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00G - R0005 - Withdrawal Space - 2hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00G - R0006 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00G - R0007 - Home Base Store**

No Asbestos

**B00G - R0008 - Practical Activities - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00G - R9001 - Cleaning Supplies**

No Asbestos

**B00G - R9002 - Movement**

No Asbestos

**B00G - R9003 - General Assistant/Bulk Store**

No Asbestos

**B00G - R9004 - P.E. Store**

No Asbestos

**B00G - R9005 - K.L.A. Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Multi Purpose Facilities - 2010 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00H - R0001 - Communal Space**

No Asbestos

**B00H - R0002 - Practical Activities**

No Asbestos

**B00H - R0003 - General Storeroom**

No Asbestos

**B00H - R0004 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017