


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wyong Creek Public School (3528)
Region : Hunter/Central Coast
State Electorate : Wyong
Local Government Area : Wyong

Initial Survey : Noel Arnold & Associates : 29 - Mar - 2008
Reviewed By : AECOM : 27 - Jun - 2016

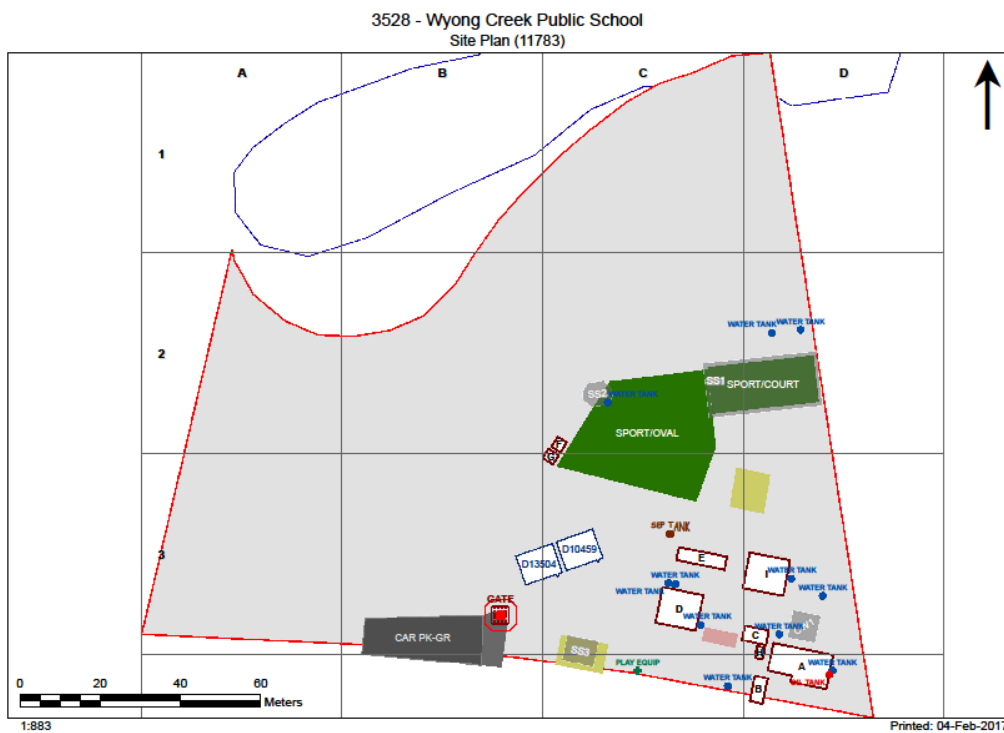

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/Library - 1962 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/Eaves Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3528/B00A/Underfloor Voids/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0011/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0011/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0002 - Craft Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0011/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0011/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0003 - Clerical Office

No Asbestos

B00A - R0004 - Sick Bay

No Asbestos

B00A - R0005 - Principal

No Asbestos

B00A - R0006 - Staff Room

No Asbestos

B00A - R0007 - Staff Toilet

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0009/Ceiling Structures/Linings/S12			Chrysotile (white asbestos)		

B00A - R0010 - Staff Room

No Asbestos

B00A - R0011 - Staff Kitchen

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0011/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R0011/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R9001 - Laundry - Type 2						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/R9001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					
	3528/B00A/R9001/Wall Linings Internal/S6				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3528/B00A/Eaves Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00B - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1960 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof Non Accessible Area
 - Area inaccessible no void entrance located.

Underfloor Voids - No Asbestos Found
 Packing to Floor Joists

Interior

B00C - R0001 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting	
	3528/B00C/R0001/Wall Linings Internal/S3	No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1920 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction					

Interior

B00D - R0001 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	3528/B00D/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	3528/B00D/R0002/Ceiling Structures/Linings/S8				No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	3528/B00D/R0002/Wall Linings Internal/S9				No Asbestos Detected

B00D - R0002 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	3528/B00D/R0002/Ceiling Structures/Linings/S8				No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	3528/B00D/R0002/Wall Linings Internal/S9				No Asbestos Detected

B00D - R0003 - Home Base

Panel behind heater	Compressed AC Sheet	3528/B00D/R0003/Pard Behind Heater/S10				No Asbestos Detected
Chalk Board	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1) Low Priority (2-3)	
		3528/B00D/R0003/Chalk Board/S11				Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	

Assumed Asbestos - Height Restriction unable to sample.

B00D - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3528/B00D/R0004/Ceiling Structures/Linings/S15				No Asbestos Detected
----------------------------	------------------	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1962 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance located.					

Interior

B00E - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
3528/B00E/R0001/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0002 - Staff Toilet

No Asbestos

B00E - R0003 - Cleaning Distributed Store

No Asbestos

B00E - R0004 - Staff Toilet

No Asbestos

B00E - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
3528/B00E/R0001/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1930 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Packing to Floor Joists Non Accessible Area
 - Area inaccessible no void entrance located.

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2006 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2006 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Packing to Floor Joists Non Accessible Area
 - Area inaccessible no void entrance located.

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Library - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - Reading Area

No Asbestos

B001 - R0002 - K.L.A. Store

No Asbestos

B001 - R0003 - Practical Activities

No Asbestos

B001 - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10459 - Learning Unit - Standard With P.A.A. : Placement Date - 18/01/2010

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D13504 - Learning Unit - Standard/Withdrawal : Placement Date - 19/02/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017