


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wyrallah Public School (3529)
Region : North Coast
State Electorate : Lismore
Local Government Area : Lismore

Initial Survey : Noel Arnold & Associates : 11 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

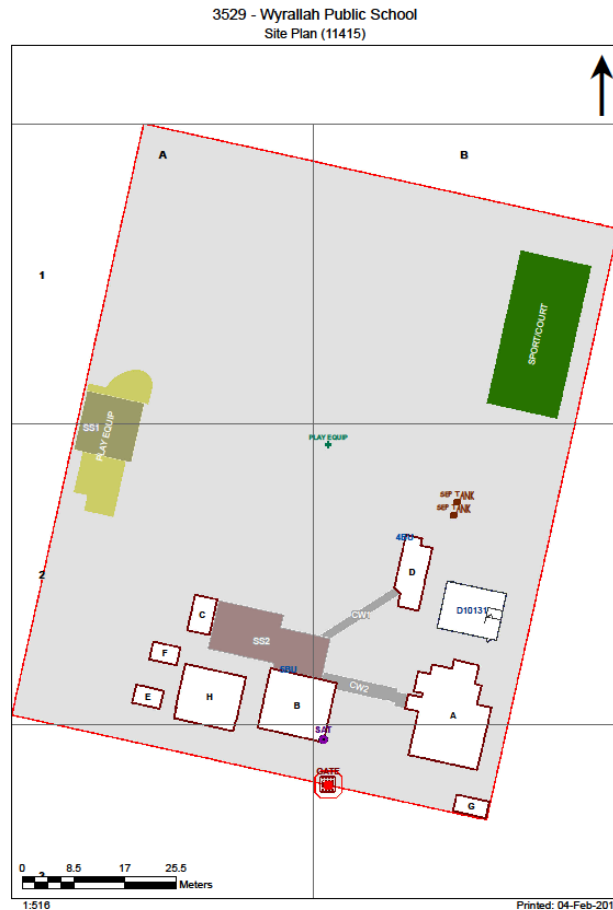

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1977 - Timber (Timber)**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3529/B00A/Underfloor Voids/S8					Chrysotile (white asbestos)

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00A/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - General Storeroom

No Asbestos

B00A - R0004 - Entry Vestibule

No Asbestos

B00A - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00A/R0008/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting					
	3529/B00A/R0008/Wall Linings Internal/S1					No Asbestos Detected

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Duplicating Workroom

No Asbestos

B00A - R0008 - Garden Store

Wall Linings Internal	Flat AC Sheeting					
	3529/B00A/R0008/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00A/R0008/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0009 - Cleaning Distributed Store

No Asbestos

B00A - R0010 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00A/R0008/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

Floor Coverings Res/Textile	Vinyl Tiles					
	3529/B00A/R0010/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0011 - Clerical Office/Workroom

No Asbestos

B00A - R0012 - Staff Room Annexe

No Asbestos

B00A - R0013 - Principal

No Asbestos

B00A - R0014 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1911 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00B/Eaves Linings/S6					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00B - R0001 - Reading Area

Wall Linings Internal	Flat AC Sheeting	100m2	North, East, West, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00B/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00B/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0002 - Communications Room

No Asbestos

B00B - R0003 - Library Office/Workroom

No Asbestos

B00B - R0004 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles					
	3529/B00B/R0004/Floor Coverings Res/Textile/S4					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1977 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00D/Eaves Linings/S7					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00D - R0005 - Sports Store

No Asbestos

B00D - R0006 - Movement

No Asbestos

B00D - R0007 - Toilets - Girls

No Asbestos

B00D - R0008 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Entrance to toilet	Good Condition (1)	Low (1)	Low Priority (2-3)
	3529/B00D/R0008/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1977 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00E - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1982 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Staff Facilities - 2002 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Home Base

No Asbestos

B00H - R0002 - Home Base Store

No Asbestos

B00H - R0003 - Practical Activities

No Asbestos

B00H - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10131 - Learning Unit - Standard With P.A.A. : Placement Date - 2/03/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017