


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woronora River Public School (3735)
Region : Sydney
State Electorate : Heathcote
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Register Issue Date : 07 - Jul - 2017

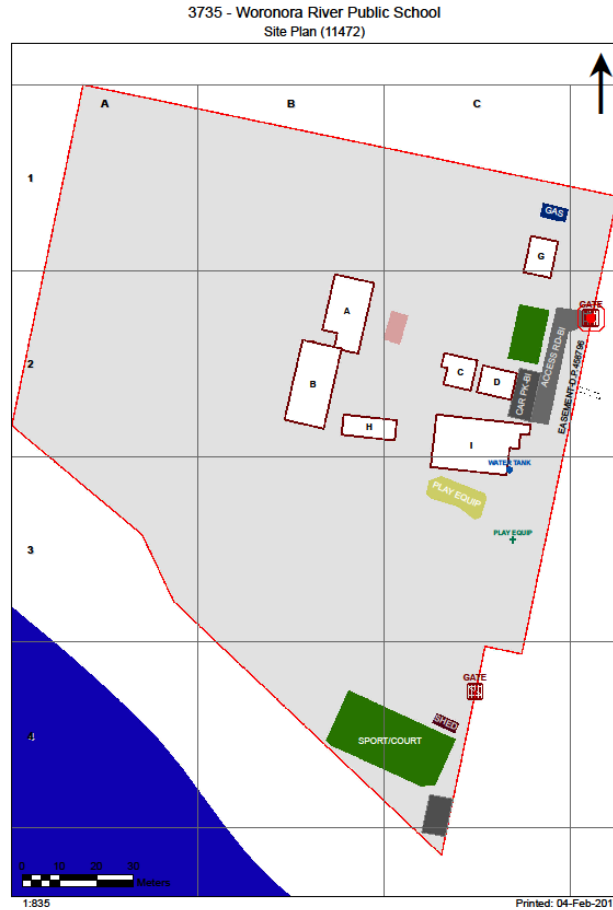

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1973 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos							
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos							
Wall at base of stairs, ground floor	Flat AC Sheeting	3735/B00A/Wall at base of stairs, ground floor/S12				No Asbestos Detected	
Ceiling Voids	Requires Inspection						
Underfloor Voids	Requires Inspection						

Interior**B00A - R0001 - General Storeroom (10.93 m2)**

No Asbestos

B00A - R0002 - General Assistant/Bulk Store (54.29 m2)

No Asbestos

B00A - R0003 - Movement (22.07 m2)

No Asbestos

B00A - R0004 - Movement (6.84 m2)

No Asbestos

B00A - R0005 - General Storeroom (8.17 m2)

Ceiling Structures/Linings	Vermiculite	3735/B00A/R0005/Ceiling Structures/Linings/S3				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00A - R0006 - Entry Vestibule (7.85 m2)

Ceiling Structures/Linings	Vermiculite	3735/B00A/R0005/Ceiling Structures/Linings/S3				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00A - R0007 - Staff Toilet (4.13 m2)

Ceiling Structures/Linings	Vermiculite	3735/B00A/R0005/Ceiling Structures/Linings/S3				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00A - R0008 - Cleaning Distributed Store (1.96 m2)

Ceiling Structures/Linings	Vermiculite	3735/B00A/R0005/Ceiling Structures/Linings/S3				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00A - R0009 - Principal (12.96 m2)

Ceiling Structures/Linings	Vermiculite	3735/B00A/R0005/Ceiling Structures/Linings/S3				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

Panels below windows	Compressed AC Sheet	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3735/B00A/R1001/Panels below windows/S2					Chrysotile (white asbestos)	

B00A - R0010 - Clerical Office (19.42 m2)

Ceiling Structures/Linings	Vermiculite	3735/B00A/R0005/Ceiling Structures/Linings/S3				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

Panels below windows	Compressed AC Sheet	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3735/B00A/R1001/Panels below windows/S2					Chrysotile (white asbestos)	

B00A - R1001 - Movement (38.33 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00A/R1009/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Panels below windows	Compressed AC Sheet	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00A/R1001/Panels below windows/S2					Chrysotile (white asbestos)
B00A - R1002 - Home Base (56.71 m2)						
Panels below windows	Compressed AC Sheet	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00A/R1001/Panels below windows/S2					Chrysotile (white asbestos)
B00A - R1003 - Home Base Store (5.85 m2)						
Panels below windows	Compressed AC Sheet	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00A/R1001/Panels below windows/S2					Chrysotile (white asbestos)
B00A - R1004 - Staff Room (19.71 m2)						
Panels below windows	Compressed AC Sheet	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00A/R1001/Panels below windows/S2					Chrysotile (white asbestos)
B00A - R1005 - Personal Effects Storage (7.22 m2)						
No Asbestos						
B00A - R1006 - General Storeroom (11.72 m2)						
No Asbestos						
B00A - R1007 - Staff Toilet (3.71 m2)						
No Asbestos						
B00A - R1008 - Duplicating Workroom (6.15 m2)						
No Asbestos						
B00A - R1009 - Movement (7.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00A/R1009/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1973 - Brick/Block (Brick/Block)

Exterior

Panels below windows	Compressed AC Sheet	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00B/R9001/Panels below windows/S4				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00B - R0001 - Movement (42.04 m2)

Panels below windows	Compressed AC Sheet	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00B/R9001/Panels below windows/S4				Chrysotile (white asbestos)	

B00B - R0002 - Communal Space (98.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	99m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00B/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Panels below windows	Compressed AC Sheet	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00B/R9001/Panels below windows/S4				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3735/B00B/R0002/Floor Coverings Res/Textile/S7					

B00B - R0003 - Home Base (57.26 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3735/B00B/R9003/Ceiling Structures/Linings/S5					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0004 - Home Base Store (6.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3735/B00B/R9003/Ceiling Structures/Linings/S5					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0005 - Personal Effects Storage (6.9 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3735/B00B/R9003/Ceiling Structures/Linings/S5					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R1001 - Movement (41.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00B/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Panels below windows	Compressed AC Sheet	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00B/R9001/Panels below windows/S4				Chrysotile (white asbestos)	

B00B - R1002 - Personal Effects Storage (5.64 m2)

No Asbestos

B00B - R1003 - Home Base Store (3.6 m2)

No Asbestos

B00B - R1004 - Toilets - Boys/Girls (3.78 m2)

No Asbestos

B00B - R1005 - Home Base (84.19 m2)

No Asbestos

B00B - R1006 - Home Base (57.58 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R1007 - Home Base Store (6.28 m2)

No Asbestos

B00B - R1008 - Distribution Board (0.76 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R1009 - Personal Effects Storage (6.19 m2)

No Asbestos

B00B - R9001 - Movement (16.83 m2)

Panels below windows Compressed AC Sheet 3m2 East facing Good Condition (1) Low (1) Low Priority (2-3)

3735/B00B/R9001/Panels below windows/S4

Chrysotile (white asbestos)

B00B - R9002 - Home Base (63.52 m2)

Ceiling Structures/Linings Vermiculite

3735/B00B/R9003/Ceiling Structures/Linings/S5

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R9003 - Practical Activities - 1hb (7.15 m2)

Ceiling Structures/Linings Vermiculite

3735/B00B/R9003/Ceiling Structures/Linings/S5

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1928 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Movement (12.01 m2)

No Asbestos

B00C - R0002 - Home Base (46.84 m2)

No Asbestos

B00C - R0003 - Drinking Facilities (5.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1940 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Movement (13.32 m2)

No Asbestos

B00D - R0002 - Canteen (15.95 m2)

No Asbestos

B00D - R0003 - Uniform Shop (10.57 m2)

No Asbestos

B00D - R0004 - Movement (11.15 m2)

No Asbestos

B00D - R0005 - Canteen Office/Store (10.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Special Purpose - 1953 - Timber (Timber)

Exterior

Wall outside room2	Compressed AC Sheet	12m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00G/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00G - R0001 - Movement (10.28 m2)

Wall Linings Internal	Compressed AC Sheet	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00G/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0002 - Craft Store (6.1 m2)

No Asbestos

B00G - R0003 - Special Programs Room (52.41 m2)

Wall Linings Internal	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00G/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities/Building Services - 1973 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00H - R0001 - Toilets - Girls (26.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00H/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					
	3735/B00H/R0003/Partition Walls (Cubicles)/S9					No Asbestos Detected

B00H - R0002 - Cleaning Distributed Store (4.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00H/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00H - R0003 - Toilets - Boys (30.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00H/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					
	3735/B00H/R0003/Partition Walls (Cubicles)/S9					No Asbestos Detected

B00H - R0004 - General Storeroom (4.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3735/B00H/R0003/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00I - General Learning/Library - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior**B00I - R0001 - Reading Area (90.4 m2)**

No Asbestos

B00I - R0002 - Library Office/Workroom (19.61 m2)

No Asbestos

B00I - R0003 - K.L.A. Store (10.29 m2)

No Asbestos

B00I - R0004 - Communications Room (9.25 m2)

No Asbestos

B00I - R0005 - Canteen Office/Store (5.31 m2)

No Asbestos

B00I - R0006 - Canteen (13.46 m2)

No Asbestos

B00I - R0007 - Covered Outdoor Learning Area (85.16 m2)

No Asbestos

B00I - R0008 - External Movement (59.29 m2)

No Asbestos

B00I - R1001 - Home Base (60.84 m2)

No Asbestos

B00I - R1002 - Home Base Store (6.09 m2)

No Asbestos

B00I - R1003 - Practical Activities - 1hb (19.08 m2)

No Asbestos

B00I - R1004 - Withdrawal Space - 2hb (12.38 m2)

No Asbestos

B00I - R1005 - Practical Activities - 1hb (18.76 m2)

No Asbestos

B00I - R1006 - Home Base (61.08 m2)

No Asbestos

B00I - R1007 - Home Base Store (5.26 m2)

No Asbestos

B00I - R1008 - External Movement (83.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3735_ASB_100913_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017