


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wiripaang Public School (3762)
Region : Hunter/Central Coast
State Electorate : Charlestown
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : Greencap-NAA : 26 - Mar - 2015

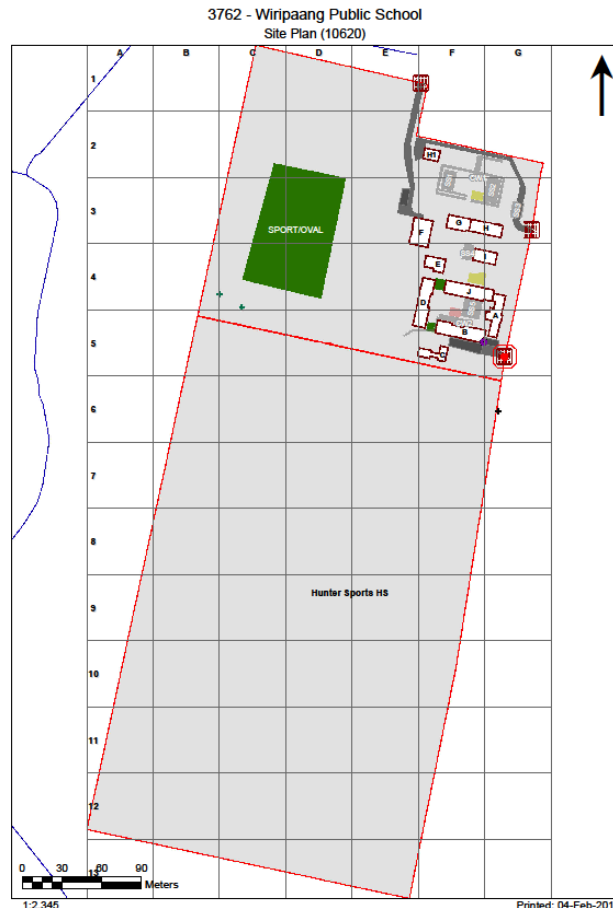

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/Eaves Linings/S10					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected

B00A - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting					
	3762/B00A/R0004/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected

B00A - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0004 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting					
	3762/B00A/R0004/Wall Linings Internal/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Deputy Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00A/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0007 - Security Store

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00A/R0016/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0008 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3762/B00A/R0008/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	3762/B00A/R0008/Floor Coverings Res/Textile/S13					No Asbestos Detected

B00A - R0009 - Movement

No Asbestos

B00A - R0010 - External Movement

No Asbestos

B00A - R0011 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3762/B00A/R0011/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					
	3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00A - R0012 - Staff Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00A - R0013 - Security Store						
Floor Coverings Res/Textile	Vinyl Tiles 3762/B00A/R0013/Floor Coverings Res/Textile/S1	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R0014 - Deputy Principal						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00A - R0015 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
B00A - R0016 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 3762/B00A/R0016/Floor Coverings Res/Textile/S3	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R0017 - Distribution Board				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting 3762/B00A/R0017/Wall Linings Internal/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0017/Wall Linings Internal/S2	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0018 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	100m2	North, South, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Sunhood (Louvers)	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00B/R0001/Floor Coverings Res/Textile/S16	57m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00B/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	10m2	North ,South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0002 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 3762/B00B/R0001/Floor Coverings Res/Textile/S16	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00B - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	16m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00B/R0001/Floor Coverings Res/Textile/S16	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	58m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00B/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected

B00B - R0006 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00B/R0001/Floor Coverings Res/Textile/S16	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	3762/B00B/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00B - R0007 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3762/B00B/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	3762/B00B/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected
Infil panels	Flat AC Sheeting	10m2	North ,South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5					Chrysotile (white asbestos)
B00B - R0008 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00B - R0009 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
B00B - R0011 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3762/B00B/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	3762/B00B/R0001/Floor Coverings Res/Textile/S17					No Asbestos Detected
Infil panels	Flat AC Sheeting	10m2	North ,South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5					Chrysotile (white asbestos)
B00B - R0012 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00B - R0013 - Shower/Change						
No Asbestos						
B00B - R0014 - Movement						
No Asbestos						
B00B - Room+1 - R0013						
Wall Linings Internal	Flat AC Sheeting					
	3762/B00B/Room+1/Wall Linings Internal/S6					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Building Services - 1920 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/Eaves Linings/S10				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5				Chrysotile (white asbestos)	
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00C - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Partition Walls (Cubicles)	Compressed AC Sheet					
	3762/B00C/R0001/Partition Walls (Cubicles)/S18				No Asbestos Detected	

B00C - R0002 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00C - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	

B00C - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Partition Walls (Cubicles)	Compressed AC Sheet					
	3762/B00C/R0001/Partition Walls (Cubicles)/S18				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3762/B00B/Eaves Linings/S10	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	80m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	56m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00D - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 3762/B00A/R0011/Floor Coverings Res/Textile/S14	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00D - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	56m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	56m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00D - R0006 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 3762/B00D/R0010/Floor Coverings Res/Textile/S7	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00D - R0007 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	56m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected	
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0008 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 3762/B00D/R0010/Floor Coverings Res/Textile/S7	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0009 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
B00D - R0010 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
B00D - R0011 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15				No Asbestos Detected	
Infil panels	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0012 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00E - R0001 - Library Office/Workroom**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00E - R0002 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00E - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00E - R0004 - Reading Area

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00A/R0011/Floor Coverings Res/Textile/S14	94m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00A/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Special Purpose - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Infil panels	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5					Chrysotile (white asbestos)

Interior**B00F - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected

B00F - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet					
	3762/B00C/R0001/Partition Walls (Cubicles)/S18					No Asbestos Detected

B00F - R0003 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00I/R0003/Wall Linings Internal/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet					
	3762/B00C/R0001/Partition Walls (Cubicles)/S18					No Asbestos Detected

B00F - R0005 - Canteen

In-fill-panel	Flat AC Sheeting	1m	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5					Chrysotile (white asbestos)

B00F - R0006 - Canteen Office/Store

No Asbestos

B00F - R0007 - Staff Toilet

No Asbestos

B00F - R0008 - General Storeroom

In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5					Chrysotile (white asbestos)

B00F - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00F - R0010 - No Access**

No Asbestos

B00F - R0011 - Sports Store

In-fill-panel	Flat AC Sheeting	0.5m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/In-fill-panel/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Administration - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3762/B00H/Gable Verge Lining/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00G/R0001/Ceiling Structures/Linings/S19	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00G/R0001/Ceiling Structures/Linings/S19	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00G/R0001/Ceiling Structures/Linings/S19	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R0007 - Home Base

No Asbestos

B00G - R0008 - Adjoining School

No Asbestos

B00G - R0009 - Adjoining School

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00G/R0001/Ceiling Structures/Linings/S19	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00G - R0010 - Adjoining School

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00G/R0001/Ceiling Structures/Linings/S19	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R0011 - Adjoining School

Wall Linings Internal	Flat AC Sheeting 3762/B00B/Room+1/Wall Linings Internal/S6					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3762/B00G/R0001/Ceiling Structures/Linings/S19	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R9001 - General Assistant/Bulk Store

No Asbestos

B00G - R9002 - Garden Store

No Asbestos

B00G - R9003 - External Movement

No Asbestos

B00G - R9004 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - Communal Facilities/Other-D.E.C. Admin - 1970 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3762/B00H/Gable Verge Lining/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Other - Regional Use

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00H - R0002 - Other - Regional Use

No Asbestos

B00H - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00A/R0011/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

B00H - R0004 - Communal Space

Wall Linings Internal	Flat AC Sheeting	40m2	West, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0008/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	134m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00H - R0005 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Support Unit/Staff Facilities - 1970 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00B/Eaves Linings/S10					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	3762/B00H/Gable Verge Lining/S20					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B001 - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00I/R0003/Wall Linings Internal/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00A/R0011/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

B001 - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B001 - R0003 - Home Base - M

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00I/R0003/Wall Linings Internal/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3762/B00A/R0011/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

B001 - R0004 - Practical Activities - M - 1hb

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B001 - R0005 - Toilet - M

No Asbestos

B001 - R0006 - Laundry - Type 2

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning/Staff Facilities - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3762/B00B/Eaves Linings/S10	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3762/B00B/In-fill-panel/S5	40m2	North, South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00J - R0001 - Staff Room**

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00J/R0001/Floor Coverings Res/Textile/S21	67m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00J/R0001/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00J - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard

B00J - R0004 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0005 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0006 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0007 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0010 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3762/B00J/R0001/Floor Coverings Res/Textile/S21	57m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3762/B00J/R0001/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00J - R0011 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting 3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3762/B00J/R0001/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)	
B00J - R0013 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected	
B00J - R0014 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
3762/B00A/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0H1 - Building Services - 2004 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B0H1 - R0001 - General Assistant/Bulk Store

No Asbestos

B0H1 - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017