


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wahroonga Public School (3833)
Region : Northern Sydney
State Electorate : Ku-ring-gai
Local Government Area : Ku-Ring-Gai

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : Grencap-NAA : 13 - Aug - 2014

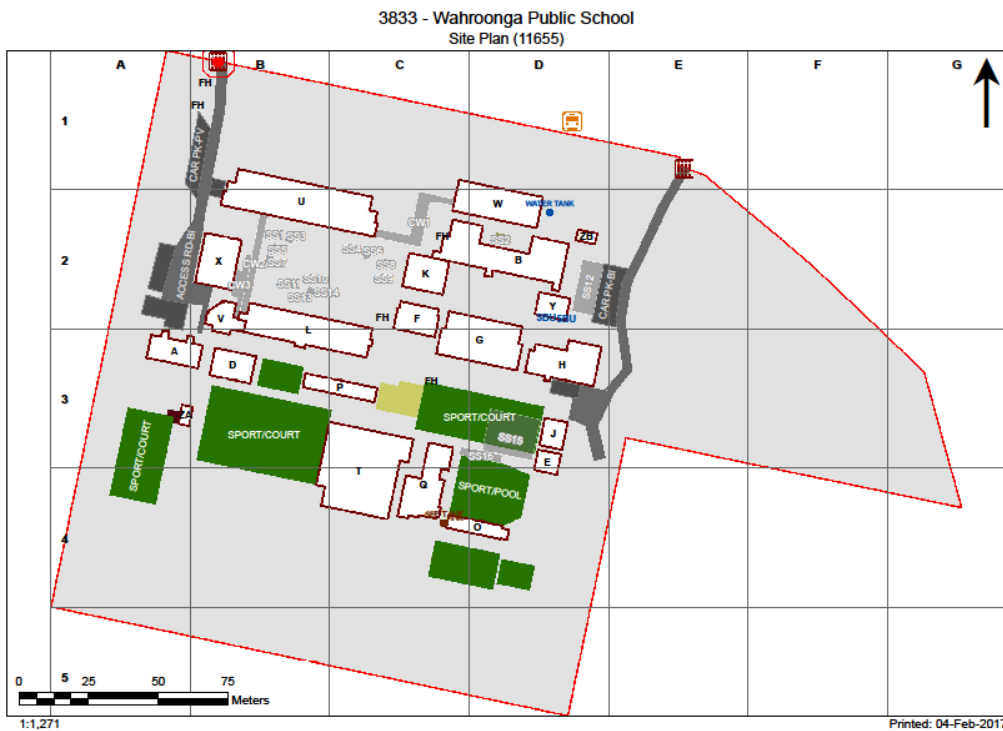

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1958 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restrictions					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restrictions						
Gable Verge Lining	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restrictions						

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3833/B00A/R0001/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
In-fill Panel	Flat AC Sheeting	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3833/B00A/R0001/In-fill Panel/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00A - R0002 - Toilets - Boys/Girls

No Asbestos

B00A - R0003 - Interview

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Personal Effects Storage

No Asbestos

B00A - R0006 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	1m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3833/B00A/R0006/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00A - R0007 - Home Base Store

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3833/B00A/R0001/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
In-fill Panel	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3833/B00A/R0001/In-fill Panel/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Uniform Shop

No Asbestos

B00A - R0012 - Communal Space

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - General Storeroom						
No Asbestos						
B00A - R0014 - General Storeroom						
No Asbestos						
B00A - R0015 - Security Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1952 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3833/B00B/Eaves Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00B/Gable verge lining/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3833/B00B/R0020/Ceiling Structures/Linings/S15					
In-fill Panel	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00B/R0011/In-fill Panel/S16					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00B - R0002 - Movement

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00B/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Home Base Store

No Asbestos

B00B - R0009 - Personal Effects Storage

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3833/B00B/R0020/Ceiling Structures/Linings/S15					
In-fill Panel	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00B/R0011/In-fill Panel/S16					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00B - R0012 - Personal Effects Storage

No Asbestos

B00B - R0013 - Home Base Store

No Asbestos

B00B - R0014 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0015 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles					
	3833/B00B/R0015/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R0016 - Movement						
No Asbestos						
B00B - R0017 - Toilets - Boys/Girls						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00B/R0004/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0018 - Personal Effects Storage						
No Asbestos						
B00B - R0019 - Movement						
No Asbestos						
B00B - R0020 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
	3833/B00B/R0020/Ceiling Structures/Linings/S15					No Asbestos Detected
In-fill Panel	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00B/R0011/In-fill Panel/S16					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
B00B - R0021 - Stairs						
Stairs	Compressed AC Sheet	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3833/B00B/R0021/Stairs/S13					Chrysotile (white asbestos)
B00B - R9001 - Main Switch Board						
No Asbestos						
B00B - R9002 - Out Of School Hours Care Centre						
No Asbestos						
B00B - R9003 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1952 - Steel (Steel)

Exterior

Ceiling Voids	Non Accessible Area - Height Restrictions
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Cleaning Supplies

No Asbestos

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Home Base

No Asbestos

B00D - R0004 - Sports Store

No Asbestos

B00D - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1944 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0004 - Staff Room Annexe

No Asbestos

B00E - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3833/B00E/R0005/Ceiling Structures/Linings/S24	No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3833/B00E/R0005/Wall Linings Internal/S25	No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Staff Facilities - 1960 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00F/Eaves Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00F/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00F - R0003 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00F/R0003/Wall Linings Internal/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00F/R0003/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0004 - Staff Room

Wall Linings Internal	Flat AC Sheeting Insulation Panel	2m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00F/R0003/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0005 - Staff Room

Wall Linings Internal	Flat AC Sheeting Insulation Panel	1m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00F/R0005/Wall Linings Internal/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1952 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3833/B00G/Eaves Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3833/B00G/R0001/Ceiling Structures/Linings/S19					

B00G - R0002 - Movement

No Asbestos

B00G - R0004 - Withdrawal Space - 1hb

No Asbestos

B00G - R0005 - Toilets - Boys/Girls

No Asbestos

B00G - R0006 - Personal Effects Storage

No Asbestos

B00G - R0007 - Home Base

No Asbestos

B00G - R0008 - Home Base

No Asbestos

B00G - R0009 - Personal Effects Storage

No Asbestos

B00G - R0010 - Security Store

No Asbestos

B00G - R0011 - General Storeroom

No Asbestos

B00G - R0012 - Withdrawal Space - 1hb

No Asbestos

B00G - R0013 - Movement

No Asbestos

B00G - R0014 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1952 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 3833/B00H/Eaves Linings/S20					No Asbestos Detected
Gable verge lining	Flat AC Sheeting	8m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3833/B00H/R0001/Ceiling Structures/Linings/S21					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00H - R0002 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting 3833/B00H/R0002/Wall Linings Internal/S22					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00H - R0003 - Special Programs Room

No Asbestos

B00H - R0005 - Personal Effects Storage

No Asbestos

B00H - R0006 - Home Base Store

No Asbestos

B00H - R0007 - Home Base

No Asbestos

B00H - R0008 - Home Base

No Asbestos

B00H - R0009 - Home Base Store

No Asbestos

B00H - R0010 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting 3833/B00H/R0002/Wall Linings Internal/S22					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00H - R0011 - Personal Effects Storage

No Asbestos

B00H - R0012 - Movement

No Asbestos

B00H - R0013 - Movement

No Asbestos

B00H - R0014 - Movement

No Asbestos

B00H - R0015 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3833/B00H/R0001/Ceiling Structures/Linings/S21					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1963 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3833/B00J/R0001/Ceiling Structures/Linings/S23					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00J/R0001/Wall Linings Internal/S7					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1961 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	4m2	East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - General Storeroom

No Asbestos

B00K - R0002 - Movement

No Asbestos

B00K - R0004 - General Storeroom

No Asbestos

B00K - R0005 - Home Base

No Asbestos

B00K - R0006 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting	2m2	Heater surround South West corner	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	---	--------------------	---------	--------------------

Assumed Asbestos - Area inaccessible

B00K - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1952 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00L - R0001 - Cleaning Distributed Store**

No Asbestos

B00L - R0002 - Movement

No Asbestos

B00L - R0003 - Personal Effects Storage

No Asbestos

B00L - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00L - R0005 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0008 - Personal Effects Storage

No Asbestos

B00L - R0009 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0010 - Home Base Store

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0011 - Home Base Store

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0012 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0013 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0014 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00L - R0015 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00L - R0016 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00L - R0017 - Cleaning Distributed Store						
No Asbestos						
B00L - R0018 - Movement						
No Asbestos						
B00L - R0019 - Movement						
No Asbestos						
B00L - R0020 - Movement						
No Asbestos						
B00L - R0021 - Stairs						
No Asbestos						
B00L - R0022 - Stairs						
No Asbestos						
B00L - R1001 - Personal Effects Storage						
No Asbestos						
B00L - R1002 - Distribution Board						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00L - R1003 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00L - R1004 - Home Base						
No Asbestos						
B00L - R1005 - Home Base						
No Asbestos						
B00L - R1006 - Personal Effects Storage						
No Asbestos						
B00L - R1007 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00L - R1008 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00L - R1009 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00L - R1010 - Home Base						
No Asbestos						
B00L - R1011 - Personal Effects Storage						
No Asbestos						
B00L - R1012 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Sheet					
	3833/B00L/R0005/Floor Coverings Res/Textile/S8					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - R1013 - Home Base Store

Floor Coverings Res/Textile Vinyl Sheet
 3833/B00L/R0005/Floor Coverings Res/Textile/S8 **No Asbestos Detected**

B00L - R1014 - Home Base

No Asbestos

B00L - R1015 - Movement

No Asbestos

B00L - R1016 - Stairs

No Asbestos

B00L - R1017 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 1965 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Non Accessible Area - No access to ceiling void
---------------	--

Underfloor Voids - Slab on Ground	No Asbestos Found
-----------------------------------	-------------------

Interior

B000 - R0001 - Toilets - Girls

No Asbestos

B000 - R0002 - Plant

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B000 - R0003 - Toilets - Boys

No Asbestos

B000 - R0004 - General Storeroom

No Asbestos

B000 - R1001 - Movement

No Asbestos

B000 - R1002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 1966 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - No access to ceiling void
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - Toilets - Girls

No Asbestos

B00P - R0002 - Handwashing Facilities

No Asbestos

B00P - R0003 - General Assistant/Bulk Store

No Asbestos

B00P - R0004 - Handwashing Facilities

No Asbestos

B00P - R0005 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Q - Pupil Facilities/Special Purpose - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3833/B00Q/Eaves Linings/S26					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00Q - M0001 - Craft Store**

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00Q/R0008/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00Q - M0002 - Craft Store

No Asbestos

B00Q - M0003 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00Q/R0008/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00Q - M0004 - Stairs

No Asbestos

B00Q - R0001 - Movement

No Asbestos

B00Q - R0002 - Canteen

No Asbestos

B00Q - R0003 - Movement

No Asbestos

B00Q - R0005 - Toilets - Girls

No Asbestos

B00Q - R0006 - Toilets - Boys

No Asbestos

B00Q - R0007 - Disabled Toilet

No Asbestos

B00Q - R0008 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00Q/R0008/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00Q - R0010 - Craft Store

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00Q/R0008/Wall Linings Internal/S9					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	To ceilings within cupboards	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00Q/R0008/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00Q - R0011 - Kiln Room

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3833/B00Q/R0008/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00Q - R0012 - External Movement

No Asbestos

B00Q - R0013 - Stairs

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Communal Facilities - 1966 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00T - R0001 - P.E. Store**

No Asbestos

B00T - R0002 - Raised Platform

No Asbestos

B00T - R0003 - Hall Chair Store

No Asbestos

B00T - R0004 - Communal Space

No Asbestos

B00T - R0005 - Plant

No Asbestos

B00T - R0006 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00T - R0007 - Cleaning Distributed Store

No Asbestos

B00T - R0008 - Movement

No Asbestos

B00T - R0009 - Movement

No Asbestos

B00T - R0010 - Stairs

No Asbestos

B00T - R9001 - Music Store

No Asbestos

B00T - R9002 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00T - R9003 - Music Store

No Asbestos

B00T - R9004 - Movement

No Asbestos

B00T - R9005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - General Learning/Administration - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00U - R0001 - Clerical Office**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0002 - Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0003 - General Storeroom

No Asbestos

B00U - R0004 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0005 - Staff Toilet

No Asbestos

B00U - R0006 - Staff Toilet

No Asbestos

B00U - R0007 - Staff Toilet

No Asbestos

B00U - R0008 - Cleaning Distributed Store

No Asbestos

B00U - R0009 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0010 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0011 - Home Base Store

No Asbestos

B00U - R0012 - Practical Activities - 1hb

No Asbestos

B00U - R0013 - Movement

No Asbestos

B00U - R0014 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0015 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0016 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00U - R0017 - Home Base Store

No Asbestos

B00U - R0018 - Practical Activities - 1hb

No Asbestos

B00U - R0019 - Stairs

No Asbestos

B00U - R0020 - Main Switch Board

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00U - R0021 - Movement						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00U - R0022 - Duplicating Workroom						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00U - R0023 - Deputy Principal						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00U - R0024 - Disabled Shower/Toilet						
No Asbestos						
B00U - R0025 - Sick Bay						
No Asbestos						
B00U - R0026 - Duplicating Workroom						
No Asbestos						
B00U - R0027 - Entry Vestibule						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00U - R0028 - Stairs						
No Asbestos						
B00U - R1001 - General Storeroom						
No Asbestos						
B00U - R1002 - Home Base Store						
No Asbestos						
B00U - R1003 - Home Base						
No Asbestos						
B00U - R1004 - Practical Activities - 1hb						
No Asbestos						
B00U - R1005 - Movement						
No Asbestos						
B00U - R1006 - Withdrawal Space - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00U - R1007 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00U - R1008 - Home Base Store						
No Asbestos						
B00U - R1009 - Practical Activities - 1hb						
No Asbestos						
B00U - R1010 - Stairs						
No Asbestos						
B00U - R1011 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00U - R1012 - Stairs						
No Asbestos						
B00U - R1013 - Practical Activities - 1hb						
No Asbestos						
B00U - R1014 - Home Base Store						
No Asbestos						
B00U - R1015 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00U - R1016 - Withdrawal Space - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00U - R1017 - Home Base Store						
No Asbestos						
B00U - R1018 - Practical Activities - 1hb						
No Asbestos						
B00U - R1019 - Home Base Store						
No Asbestos						
B00U - R1020 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00U - R1021 - Withdrawal Space - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00U - R1022 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00U - R1023 - Practical Activities - 1hb						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - Special Purpose - 1998 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00V - R0001 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00V - R0002 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00V - R0003 - Computer Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00V - R0004 - Movement

No Asbestos

B00V - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00W - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00W - R0001 - Reading Area

No Asbestos

B00W - R0002 - Library Office/Workroom

No Asbestos

B00W - R0003 - Movement

No Asbestos

B00W - R0004 - Communications Room

No Asbestos

B00W - R0005 - K.L.A. Store

No Asbestos

B00W - R0006 - Staff Toilet

No Asbestos

B00W - R0007 - Toilet - Lobby

No Asbestos

B00W - R0008 - Cleaning Distributed Store

No Asbestos

B00W - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00W - R0010 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00X - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00X - R0001 - Home Base

No Asbestos

B00X - R0002 - Home Base

No Asbestos

B00X - R0003 - Practical Activities - 1hb

No Asbestos

B00X - R0004 - Practical Activities - 1hb

No Asbestos

B00X - R0005 - Withdrawal Space - 2hb

No Asbestos

B00X - R0006 - Home Base Store

No Asbestos

B00X - R0007 - Home Base Store

No Asbestos

B00X - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00Y - R0001 - Toilets - Boys

No Asbestos

B00Y - R0002 - Toilets - Girls

No Asbestos

B00Y - R0003 - Disabled Toilet

No Asbestos

B00Y - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0ZA - Storage - 2012 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0ZA - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0ZB - Storage - 2012 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0ZB - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017