


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wallsend South Public School (3851)
Region : Hunter/Central Coast
State Electorate : Wallsend
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : AECOM : 25 - Jun - 2015

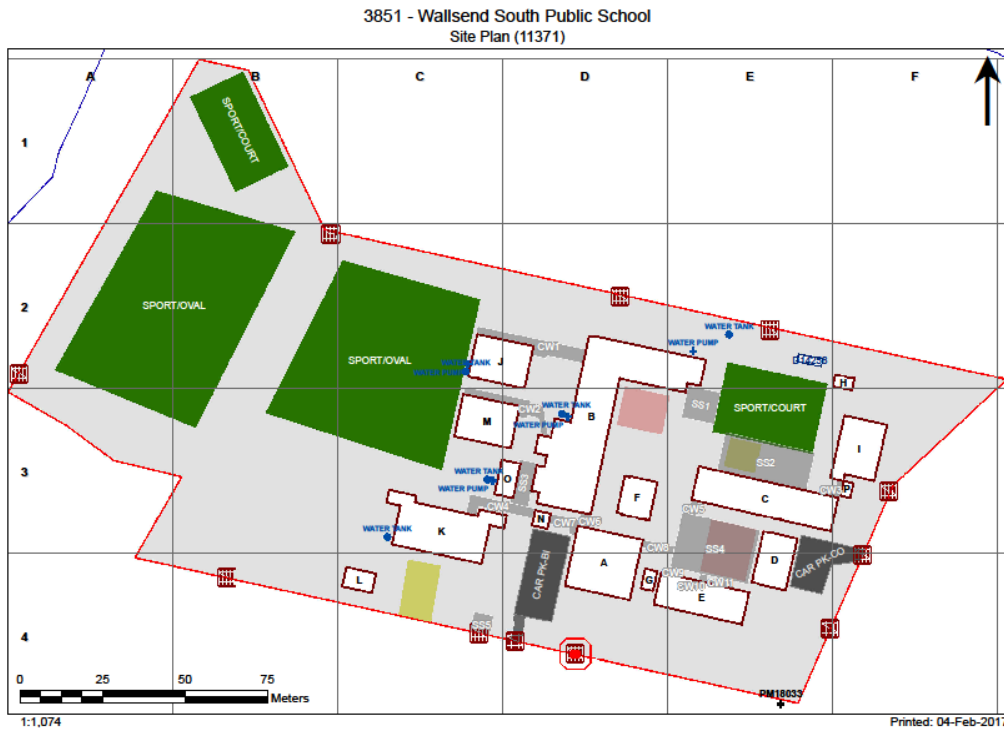

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/Library - 1965 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Compressed AC Sheet 3851/B00A/In-fill-panel/S9	24m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 3851/B00A/Gable Verge Lining/S7	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	20m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00A - R0001 - Deputy Principal (15.28 m2)**

Ceiling Structures/Linings	Vermiculite 3851/B00A/R0004/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0002 - External Movement (3.55 m2)

No Asbestos

B00A - R0003 - Entry Vestibule (5.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 3851/B00A/R0004/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Movement (39.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 3851/B00A/R0004/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Clerical Office (23.04 m2)

Ceiling Structures/Linings	Vermiculite 3851/B00A/R0004/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0006 - Main Switch Board (3.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00A - R0007 - General Storeroom (13.99 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 3851/B00A/R0004/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Principal (23.15 m2)

Ceiling Structures/Linings	Vermiculite 3851/B00A/R0004/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0009 - Security Store (14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0010 - Duplicating Workroom (76.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0011 - Staff Room Annexe (13.37 m2)						
No Asbestos						
B00A - R0012 - External Movement (48.51 m2)						
No Asbestos						
B00A - R0013 - Staff Room Annexe (15.68 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0014 - Staff Toilet (5.21 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0015 - Staff Toilet (8.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0016 - Cleaning Distributed Store (3.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0017 - Sick Bay (13.92 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0018 - Cleaning Supplies (8.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3851/B00A/R0004/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R1001 - Reading Area (192.89 m2)						
No Asbestos						
B00A - R1003 - Communications Room (11.04 m2)						
No Asbestos						
B00A - R1004 - Library Office/Workroom (23.72 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1005 - K.L.A. Store (2.95 m2)						
No Asbestos						
B00A - R1006 - Library Office/Workroom (10.55 m2)						
No Asbestos						
B00A - R1007 - Entry Vestibule (16.62 m2)						
No Asbestos						
B00A - R1008 - Distribution Board (0.74 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R1009 - Staff Toilet (3.94 m2)						
No Asbestos						
B00A - R1010 - Staff Toilet (3.94 m2)						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible unable to sample						
B00A - R1011 - Cleaning Distributed Store (3.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R1012 - External Movement (42.16 m2)						
No Asbestos						
B00A - R1015 - Interview (13.26 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1016 - Library Office/Workroom (13.16 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1976 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S9	36m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible. No floor void.					
Ceiling Voids	Flat AC sheeting man hole cover. 3851/B00A/In-fill-panel/S8	0.1m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00B - R0001 - External Movement (65.08 m2)**

No Asbestos

B00B - R0002 - Staff Toilet (4.32 m2)

No Asbestos

B00B - R0003 - Canteen Office/Store (1.53 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00B - R0004 - Canteen (28.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00B - R0005 - Canteen Office/Store (1.71 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00B - R0006 - Movement (2.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00A/R1011/Floor Coverings Res/Textile/S1	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00B - R0007 - Staff Toilet (3.67 m2)

No Asbestos

B00B - R0008 - Staff Toilet (3.67 m2)

No Asbestos

B00B - R0009 - Cleaning Supplies (6.74 m2)

No Asbestos

B00B - R0010 - Raised Platform (32.12 m2)

No Asbestos

B00B - R0011 - Canteen (11.93 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00B/R0011/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00B - R0012 - Communal Space (206.59 m2)

No Asbestos

B00B - R0013 - External Movement (151.23 m2)

No Asbestos

B00B - R0014 - Practical Activities - 1hb (14.21 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R0015 - Home Base (57.71 m2)						
No Asbestos						
B00B - R0016 - Home Base (57.16 m2)						
No Asbestos						
B00B - R0017 - Practical Activities - 1hb (15.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R0018 - Distribution Board (0.23 m2)				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00B/R0030/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00B - R0019 - Sports Store (14.42 m2)						
Ceiling Structures/Linings	Flat AC sheeting man hole cover.	0.1m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)	
B00B - R0020 - Toilets - Boys (14.72 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00F/R0003/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00B - R0021 - Toilets - Girls (14.72 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00F/R0003/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00B - R0022 - Practical Activities - 1hb (14.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R0023 - Home Base (57.87 m2)						
No Asbestos						
B00B - R0024 - Home Base (60.16 m2)						
No Asbestos						
B00B - R0025 - Practical Activities - 1hb (11.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/R1011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R0026 - Toilets - Girls (14.74 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00F/R0003/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00B - R0027 - Toilets - Boys (14.64 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00F/R0003/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00B - R0028 - Drinking Facilities (18.85 m2)						
No Asbestos						
B00B - R0029 - Movement (23.42 m2)						
No Asbestos						
B00B - R0030 - Distribution Board (0.45 m2)				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00B/R0030/Wall Linings Internal/S3					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R0031 - Hall Chair Store (11.12 m2)

No Asbestos

B00B - R0032 - External Movement (21.16 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1972 - Brick/Veneer (Brick/Veneer)**Exterior**

In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S9	32m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 3851/B00A/Gable Verge Lining/S7	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	10m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00C - R0002 - Home Base (78.24 m2)**

No Asbestos

B00C - R0003 - Practical Activities - 1hb (8.25 m2)

No Asbestos

B00C - R0004 - Toilets - Boys/Girls (3.6 m2)

No Asbestos

B00C - R0007 - Interview (20.15 m2)

No Asbestos

B00C - R0008 - Movement (6.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00C - R0009 - Distribution Board (0.72 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 3851/B00B/R0030/Wall Linings Internal/S3	3m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	-----	----------------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 3851/B00A/R0004/Ceiling Structures/Linings/S2					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00C - R0010 - General Storeroom (3.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00C - R0011 - Toilets - Boys/Girls (3.98 m2)

No Asbestos

B00C - R0012 - Home Base (83.43 m2)

No Asbestos

B00C - R0013 - Home Base (83.19 m2)

No Asbestos

B00C - R0014 - Toilets - Boys/Girls (4.1 m2)

No Asbestos

B00C - R0015 - Movement (8.11 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00C - R0016 - General Storeroom (3.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00C - R0017 - Access Shower/Toilet (7.32 m2)						
No Asbestos						
B00C - R0018 - External Movement (87.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1972 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S9	11m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 3851/B00A/Gable Verge Lining/S7	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	4m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible. Hatch access door bolted shut.					

Interior**B00D - R0001 - External Movement (1.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00D - R0002 - Interview (8.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00D - R0003 - Staff Room Annexe (15.62 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00D - R0004 - General Storeroom (9.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3851/B00C/R0010/Floor Coverings Res/Textile/S5	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Encapsulated Insulation material within unit 3851/B00A/In-fill-panel/S8	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0005 - General Storeroom (3.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0006 - Movement (16.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3851/B00C/R0010/Floor Coverings Res/Textile/S5	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 3851/B00A/In-fill-panel/S8	1.8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0007 - Home Base (57.55 m2)

No Asbestos

B00D - R0008 - Distribution Board (1.02 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting					
3851/B00A/R0004/Ceiling Structures/Linings/S2					No Asbestos Detected	
B00D - R0010 - Home Base Store (4.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00C/R0010/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00D - R0011 - Uniform Shop (7.8 m2)						
Recently Modified Space	Requires Inspection					
B00D - R0012 - External Movement (22.46 m2)						
Recently Modified Space	Requires Inspection					
B00D - Room+1 - Added Room						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1952 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction manhole too high too safely access AR0001.					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Special Programs Room (22.42 m2)

No Asbestos

B00E - R0002 - General Storeroom (7.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)

B00E - R0003 - External Movement (55.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)

B00E - R0004 - Special Programs Room (53.11 m2)

No Asbestos

B00E - R0005 - Home Base (53.11 m2)

No Asbestos

B00E - R0006 - Staff Room (66.96 m2)

Wall Linings Internal	Compressed AC Sheet	2m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Staff Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/Gable Verge Lining/S7					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible manhole blocked by shelving and equipment. FR0005					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00F - R0001 - External Movement (34.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)

B00F - R0002 - Staff Toilet (2.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible unit unable to be					

B00F - R0003 - Toilets - Girls (24.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00F/R0003/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

B00F - R0004 - Toilets - Boys (24.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00F/R0003/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

B00F - R0005 - Staff Toilet (2.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3851/B00A/In-fill-panel/S8					Chrysotile (white asbestos)

B00F - R0006 - Plant (15.16 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 1972 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store (20.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration - 1972 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store (20.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B001 - R0001 - External Movement (38.51 m2)**

No Asbestos

B001 - R0002 - Practical Activities - 1hb (19.41 m2)

No Asbestos

B001 - R0003 - Home Base Store (6.02 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B001 - R0004 - Home Base (59.25 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B001 - R0005 - Withdrawal Space - 2hb (11.37 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B001 - R0006 - Home Base (59.24 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B001 - R0007 - Home Base Store (6.02 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B001 - R0008 - Practical Activities - 1hb (19.42 m2)**

No Asbestos

B001 - R0009 - External Movement (8.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

No Asbestos

Interior

B00J - R0001 - External Movement (35.8 m2)

No Asbestos

B00J - R0002 - Practical Activities - 1hb (19.77 m2)

No Asbestos

B00J - R0003 - Home Base Store (5.85 m2)

No Asbestos

B00J - R0004 - Home Base (58.81 m2)

No Asbestos

B00J - R0005 - Withdrawal Space - 2hb (10.93 m2)

No Asbestos

B00J - R0006 - Home Base (58.8 m2)

No Asbestos

B00J - R0007 - Home Base Store (5.85 m2)

No Asbestos

B00J - R0008 - Practical Activities (19.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00K - R0001 - External Movement (105.83 m2)**

No Asbestos

B00K - R0002 - External Stairs (6.97 m2)

No Asbestos

B00K - R0003 - Practical Activities - 1hb (19.75 m2)

No Asbestos

B00K - R0004 - Home Base Store (6.2 m2)

No Asbestos

B00K - R0005 - Home Base (61.67 m2)

No Asbestos

B00K - R0006 - Withdrawal Space - 2hb (11.03 m2)

No Asbestos

B00K - R0007 - Practical Activities - 1hb (19.75 m2)

No Asbestos

B00K - R0008 - Home Base (61.67 m2)

No Asbestos

B00K - R0009 - Home Base Store (6.2 m2)

No Asbestos

B00K - R0010 - Practical Activities - 1hb (20.4 m2)

No Asbestos

B00K - R0011 - Withdrawal Space - 1hb (9.2 m2)

No Asbestos

B00K - R0012 - Home Base (59.13 m2)

No Asbestos

B00K - R0013 - Home Base Store (5.99 m2)

No Asbestos

B00K - R0014 - External Stairs (6.93 m2)

No Asbestos

B00K - R1001 - External Stairs (20.98 m2)

No Asbestos

B00K - R1002 - External Movement (66.6 m2)

No Asbestos

B00K - R1003 - Practical Activities - 1hb (18.87 m2)

No Asbestos

B00K - R1004 - Home Base Store (6.17 m2)

No Asbestos

B00K - R1005 - Home Base (61.04 m2)

No Asbestos

B00K - R1006 - Withdrawal Space - 2hb (11.48 m2)

No Asbestos

B00K - R1007 - Practical Activities - 1hb (18.87 m2)

No Asbestos

B00K - R1008 - Home Base (61.04 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R1009 - Home Base Store (6.17 m2)						
No Asbestos						
B00K - R1010 - Practical Activities - 1hb (20.27 m2)						
No Asbestos						
B00K - R1011 - Withdrawal Space - 1hb (9.12 m2)						
No Asbestos						
B00K - R1012 - Home Base (58.47 m2)						
No Asbestos						
B00K - R1013 - Home Base Store (5.93 m2)						
No Asbestos						
B00K - R1014 - External Stairs (20.97 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Other - 2008 - Metal Shed (Metal Shed)

Exterior

No Asbestos

Interior

B00L - R0001 - General Assistant/Bulk Store (53.9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

No Asbestos

Interior

B00M - R0001 - External Movement (36.48 m2)

No Asbestos

B00M - R0002 - Practical Activities (20.2 m2)

No Asbestos

B00M - R0003 - Home Base Store (5.89 m2)

No Asbestos

B00M - R0004 - Home Base (59.03 m2)

No Asbestos

B00M - R0005 - Practical Activities (11.05 m2)

No Asbestos

B00M - R0006 - Home Base (59.03 m2)

No Asbestos

B00M - R0007 - Home Base Store (5.9 m2)

No Asbestos

B00M - R0008 - Practical Activities (20.2 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Circulation - 2012 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00N - R0001 - Movement (4.26 m2)

No Asbestos

B00N - R0002 - Lift (2.24 m2)

No Asbestos

B00N - R0003 - External Movement (9.97 m2)

No Asbestos

B00N - R1001 - Movement (4.26 m2)

No Asbestos

B00N - R1002 - External Movement (9.64 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 2013 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - Canteen (42.59 m2)

No Asbestos

B000 - R0002 - Toilets-Unisex (3.17 m2)

No Asbestos

B000 - R0003 - General Storeroom (7.17 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Storage - - Metal Shed (Metal Shed)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00P - R0001 - General Storeroom (14.06 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 840 - D14258 - Girls Toilet : Placement Date - 10/05/2006

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		2.88 m2

Interior

R1 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017