


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Westmead Public School (3883)
Region : Western Sydney
State Electorate : Granville
Local Government Area : Holroyd

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Mar - 2015

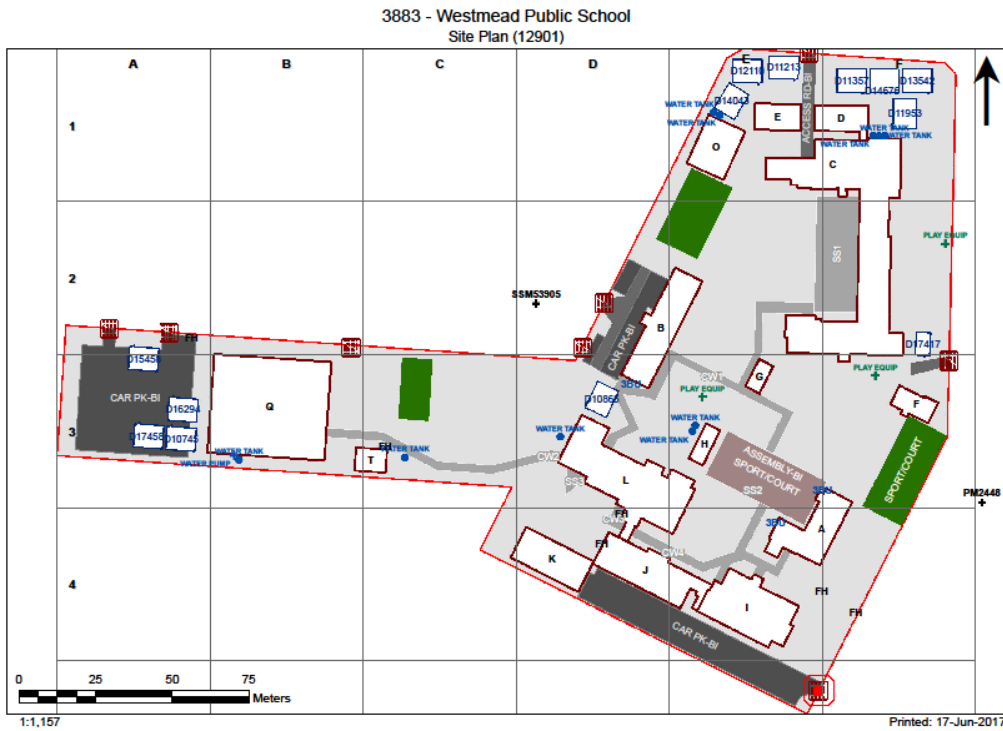

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1935 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 3883/B00A/Underfloor Voids/S25					No Asbestos Detected

Interior**B00A - R0005 - Interview (16.76 m2)**

No Asbestos

B00A - R0009 - Security Store (7.59 m2)

No Asbestos

B00A - R0011 - Movement (2.56 m2)

No Asbestos

B00A - R0014 - Cleaning Distributed Store (2.83 m2)

No Asbestos

B00A - R0015 - K.L.A. Store (1.13 m2)

No Asbestos

B00A - R0016 - Library Office/Workroom (10.07 m2)

No Asbestos

B00A - R0017 - Distribution Board (0.48 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0018 - Movement (13.21 m2)

No Asbestos

B00A - R0019 - Seminar/Study (12.4 m2)

No Asbestos

B00A - R0020 - Communications Room (8.03 m2)

No Asbestos

B00A - R0021 - Stairs (4.35 m2)

No Asbestos

B00A - R0022 - Staff Room (150.71 m2)

No Asbestos

B00A - R0023 - Staff Kitchen (13.1 m2)

No Asbestos

B00A - R0024 - Staff Toilet (7.44 m2)

No Asbestos

B00A - R0025 - Movement (1.42 m2)

No Asbestos

B00A - R0026 - Movement (1.4 m2)

No Asbestos

B00A - R0027 - Staff Toilet (6.28 m2)

No Asbestos

B00A - R0028 - Disabled Toilet (4.31 m2)

No Asbestos

B00A - R0029 - Movement (4.82 m2)

No Asbestos

B00A - R1007 - Cleaning Distributed Store (3.07 m2)

No Asbestos

B00A - R1008 - K.L.A. Store (14.32 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1010 - Staff Toilet (5.27 m2)						
No Asbestos						
B00A - R1011 - Home Base (64.72 m2)						
No Asbestos						
B00A - R1012 - Withdrawal Space - 2hb (16.06 m2)						
No Asbestos						
B00A - R1013 - Home Base (67.39 m2)						
No Asbestos						
B00A - R1014 - Movement (67.69 m2)						
No Asbestos						
B00A - R1015 - Stairs (13.51 m2)						
No Asbestos						
B00A - R1016 - Distribution Board (0.53 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R1017 - Home Base Store (4.45 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Administration - 1912 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00B/Eaves Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3883/B00B/Underfloor Voids/S27				Chrysotile (white asbestos)	

Interior**B00B - R0001 - Community Clinic (21.87 m2)**

No Asbestos

B00B - R0002 - Home Base (53.21 m2)

No Asbestos

B00B - R0003 - Home Base (53.14 m2)

No Asbestos

B00B - R0004 - Staff Room Annexe (10.95 m2)

No Asbestos

B00B - R0005 - Craft Store (10.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0006 - Home Base (53.51 m2)

No Asbestos

B00B - R0007 - Home Base (53.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0008 - K.L.A. Store (12.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0009 - K.L.A. Store (9.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0010 - Movement (93.17 m2)

No Asbestos

B00B - R0011 - Movement (6.8 m2)

No Asbestos

B00B - R0012 - Cleaning Distributed Store (2.3 m2)

No Asbestos

B00B - R0013 - Staff Toilet (3.08 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1947 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00C/Eaves Linings/S28				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Home Base Store (1.22 m2)**

No Asbestos

B00C - R0002 - Home Base (107.54 m2)

Chalk Board	Compressed AC Sheet					
	3883/B00C/R0002/Chalk Board/S37				No Asbestos Detected	

B00C - R0003 - Movement (4.49 m2)

No Asbestos

B00C - R0004 - Movement (4.56 m2)

No Asbestos

B00C - R0005 - Movement (4.53 m2)

No Asbestos

B00C - R0006 - Home Base (59.34 m2)

Chalk Board	Compressed AC Sheet					
	3883/B00C/R0006/Chalk Board/S38				No Asbestos Detected	

B00C - R0007 - Home Base Store (1.24 m2)

No Asbestos

B00C - R0008 - General Storeroom (7.32 m2)

No Asbestos

B00C - R0009 - Cleaning Distributed Store (4.01 m2)

No Asbestos

B00C - R0010 - General Storeroom (1.19 m2)

No Asbestos

B00C - R0011 - Staff Toilet (2.8 m2)

No Asbestos

B00C - R0012 - Deputy Principal (15.61 m2)

No Asbestos

B00C - R0013 - Movement (2.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00C/R0013/Ceiling Structures/Linings/S39				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting					
	3883/B00C/R0013/In-fill-panel/S40				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	2m2	Lining to electrical box	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	3883/B00C/R0013/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0014 - Entry Vestibule (7.65 m2)

No Asbestos

B00C - R0015 - Special Programs Room (29.41 m2)

No Asbestos

B00C - R0016 - Staff Toilet (2.01 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00C - R0017 - Home Base (51.81 m2)						
Chalk Board	Compressed AC Sheet					No Asbestos Detected
3883/B00C/R0017/Chalk Board/S42						
B00C - R0018 - Movement (7.03 m2)						
No Asbestos						
B00C - R0019 - Movement (7.02 m2)						
No Asbestos						
B00C - R0020 - Home Base (52.14 m2)						
Chalk Board	Compressed AC Sheet					No Asbestos Detected
3883/B00C/R0020/Chalk Board/S43						
B00C - R0021 - Home Base (52.14 m2)						
Chalk Board	Compressed AC Sheet					No Asbestos Detected
3883/B00C/R0021/Chalk Board/S44						
B00C - R0022 - Movement (7.03 m2)						
No Asbestos						
B00C - R0023 - Movement (6.49 m2)						
No Asbestos						
B00C - R0024 - Home Base (52.01 m2)						
Chalk Board	Compressed AC Sheet					No Asbestos Detected
3883/B00C/R0024/Chalk Board/S45						
B00C - R0025 - Home Base (73.21 m2)						
No Asbestos						
B00C - R0026 - Main Switch Board (8.32 m2)						
Wall Linings Internal	Flat AC Sheeting	NA	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0026/Wall Linings Internal/S5						
B00C - R0027 - Withdrawal Space - 1hb (14.45 m2)						
No Asbestos						
B00C - R0028 - Movement (85.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3						
B00C - R0029 - Movement (7.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3						
B00C - R0030 - Toilets - Girls (30.59 m2)						
Partition Walls (Cubicles)	Flat AC Sheeting					No Asbestos Detected
3883/B00C/R0030/Partition Walls (Cubicles)/S2						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3						
B00C - R0031 - Sports Store (10.98 m2)						
No Asbestos						
B00C - R0032 - Garden Store (10.92 m2)						
No Asbestos						
B00C - R0033 - Sports Store (10.78 m2)						
No Asbestos						
B00C - R0034 - Toilets - Boys (30.8 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0035 - Movement (11.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0036 - Movement (5.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0037 - Movement (147.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0038 - Cleaning Distributed Store (0.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0039 - Sports Store (0.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0040 - Sports Store (1.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0041 - Movement (79 m2)						
No Asbestos						
B00C - R0042 - Movement (4.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
3883/B00C/R0042/Ceiling Structures/Linings/S6				No Asbestos Detected		
B00C - R0043 - Movement (3.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0043/Ceiling Structures/Linings/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0044 - General Storeroom (0.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0044/Ceiling Structures/Linings/S47				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0045 - P.E. Store (35.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0046 - Disabled Toilet (14.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting					
3883/B00C/R0046/In-fill-panel/S7				No Asbestos Detected		
B00C - R0047 - Toilets - Boys/Girls (14.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00C/R0030/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
B00C - R0048 - Home Base (52.03 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R0049 - Home Base (52.01 m2)

No Asbestos

B00C - R0050 - Withdrawal Space - 1hb (10.57 m2)

No Asbestos

B00C - R0051 - Toilets - Boys/Girls (7.32 m2)

No Asbestos

B00C - R0052 - Movement (3.44 m2)

Ceiling Structures/Linings Flat AC Sheeting 4m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

3883/B00C/R0030/Ceiling Structures/Linings/S3

Chrysotile (white asbestos)

B00C - R0053 - Shelter (107.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - Other-Regional Use - 1952 - Concrete (Concrete)**Exterior**

Eaves Linings	Flat AC Sheeting 3883/B00D/Eaves Linings/S29	20m2	South, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Ends	Flat AC Sheeting 3883/B00D/Gable Ends/S30					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Other - Regional Use (25.05 m2)**

Wall Linings Internal	Flat AC Sheeting 3883/B00D/R0001/Wall Linings Internal/S8	10m2	South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 3883/B00D/R0001/Ceiling Structures/Linings/S9	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

B00D - R0002 - Home Base (46.79 m2)

Wall Linings Internal	Flat AC Sheeting 3883/B00D/R0002/Wall Linings Internal/S49	15m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 3883/B00D/R0002/Ceiling Structures/Linings/S48	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0003 - Withdrawal Space - 1hb (46.85 m2)

Wall Linings Internal	Flat AC Sheeting 3883/B00D/R0003/Wall Linings Internal/S51	15m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 3883/B00D/R0003/Ceiling Structures/Linings/S50	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0004 - Shelter (27.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning - 1952 - Concrete (Concrete)**Exterior**

Eaves Linings	Flat AC Sheeting 3883/B00E/Eaves Linings/S31	20m2	South, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Ends	Flat AC Sheeting 3883/B00E/Gable Ends/S32					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - External Movement (24.8 m2)**

Wall Linings Internal	Flat AC Sheeting 3883/B00D/R0001/Wall Linings Internal/S8	10m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 3883/B00D/R0001/Ceiling Structures/Linings/S9	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

B00E - R0002 - Home Base (47.06 m2)

Wall Linings Internal	Flat AC Sheeting 3883/B00E/R0002/Wall Linings Internal/S53	15m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 3883/B00E/R0002/Ceiling Structures/Linings/S52	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00E - R0003 - Home Base (47.07 m2)

Wall Linings Internal	Flat AC Sheeting 3883/B00E/R0003/Wall Linings Internal/S55	15m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting 3883/B00E/R0003/Ceiling Structures/Linings/S54	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Pupil Facilities - 1920 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00F/Eaves Linings/S33				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	6m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00F/R0008/Wall Linings Internal/S11				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Uniform Shop (29.28 m2)**

Workbench	Flat AC Sheeting	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					

B00F - R0002 - Staff Toilet (4.37 m2)

No Asbestos

B00F - R0003 - Movement (12.19 m2)

No Asbestos

B00F - R0004 - Shower/Change (12.23 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00F/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	

B00F - R0005 - Kiln Room (5.25 m2)

No Asbestos

B00F - R0006 - Movement (15.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3883/B00F/R0008/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00F/R0008/Wall Linings Internal/S11				Chrysotile (white asbestos)	

B00F - R0007 - Movement (2 m2)

No Asbestos

B00F - R0008 - Movement (2.59 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3883/B00F/R0008/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00F/R0008/Wall Linings Internal/S11				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00G/Eaves Linings/S13					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3883/B00G/Ceiling Voids/S34					Chrysotile (white asbestos)

Interior**B00G - R0001 - General Assistant/Bulk Store (39.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3883/B00G/R0002/Ceiling Structures/Linings/S14					

B00G - R0002 - Staff Toilet (1.41 m2)

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	3883/B00G/R0002/In-fill-panel/S15					

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3883/B00G/R0002/Ceiling Structures/Linings/S14					

B00G - R0003 - General Storeroom (1.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3883/B00G/R0002/Ceiling Structures/Linings/S14					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1965 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00G/Eaves Linings/S13					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Toilets - Girls (27.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00H/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00H - R0002 - Cleaning Distributed Store (1.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00H/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00H - R0003 - Toilets - Boys (24.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00H/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning/Administration - 1929 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3883/B00I/Eaves Linings/S35					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00I - R0001 - Movement (3.52 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00I/R0001/Ceiling Structures/Linings/S56					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00I - R0002 - Staff Toilet (5.06 m2)

No Asbestos

B00I - R0003 - Movement (2.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00I/R0003/Ceiling Structures/Linings/S57					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00I - R0006 - Other-Vacant (15.38 m2)

No Asbestos

B00I - R0007 - Principal (28.68 m2)

No Asbestos

B00I - R0014 - General Storeroom (9 m2)

No Asbestos

B00I - R0015 - Movement (10.41 m2)

No Asbestos

B00I - R0016 - Movement (2.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00I/R0016/Ceiling Structures/Linings/S58					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00I - R0022 - Staff Room Annexe (27.88 m2)

No Asbestos

B00I - R0023 - Movement (2.96 m2)

No Asbestos

B00I - R0024 - Interview (14.56 m2)

No Asbestos

B00I - R0025 - Movement (87.81 m2)

No Asbestos

B00I - R0028 - Disabled Toilet (5.87 m2)

No Asbestos

B00I - R0029 - Stairs (7.45 m2)

No Asbestos

B00I - R0030 - Sick Bay (8.63 m2)

No Asbestos

B00I - R0031 - Clerical Office (26.26 m2)

No Asbestos

B00I - R0032 - Duplicating Workroom (28.79 m2)

No Asbestos

B00I - R0033 - Security Store (17.28 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00I - R0034 - Stairs (4.92 m2)						
No Asbestos						
B00I - R0035 - Movement (6.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00I/R0035/Ceiling Structures/Linings/S59				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00I - R0036 - Staff Room (56.83 m2)						
No Asbestos						
B00I - R0037 - Staff Kitchen (11.2 m2)						
No Asbestos						
B00I - R0038 - Toilet - Lobby (2.41 m2)						
No Asbestos						
B00I - R0039 - Staff Toilet (2.25 m2)						
No Asbestos						
B00I - R0040 - Toilet - Lobby (2.51 m2)						
No Asbestos						
B00I - R0041 - Staff Toilet (2.35 m2)						
No Asbestos						
B00I - R1001 - Movement (8.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3883/B00I/R1001/Ceiling Structures/Linings/S60						
B00I - R1002 - Staff Room Annexe (8.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3883/B00I/R1002/Ceiling Structures/Linings/S61						
B00I - R1003 - Movement (5.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3883/B00I/R1003/Ceiling Structures/Linings/S62						
B00I - R1004 - Deputy Principal (15.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3883/B00I/R1004/Ceiling Structures/Linings/S63						
B00I - R1005 - Movement (9.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3883/B00I/R1005/Ceiling Structures/Linings/S64						
B00I - R1006 - Home Base (79.49 m2)						
No Asbestos						
B00I - R1007 - Home Base Store (9.99 m2)						
No Asbestos						
B00I - R1008 - Withdrawal Space - 1hb (9.54 m2)						
No Asbestos						
B00I - R1009 - Home Base (49.3 m2)						
No Asbestos						
B00I - R1010 - Movement (9.82 m2)						
No Asbestos						
B00I - R1011 - Movement (46.32 m2)						
No Asbestos						
B00I - R1012 - Withdrawal Space - 1hb (28.6 m2)						
No Asbestos						
B00I - R1013 - Other-Vacant (18.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - R1014 - Stairs (15.9 m2)

No Asbestos

B001 - R1015 - Stairs (6.82 m2)

Ceiling Structures/Linings Flat AC Sheeting

3883/B001/R1015/Ceiling Structures/Linings/S65

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning/Communal Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Distribution Board (6.65 m2) Note: No inspection of live electrical installation.

No Asbestos

B00J - R0002 - Movement (8.1 m2)

No Asbestos

B00J - R0003 - Plant (5.48 m2)

Flue	Fibre Cement Pipe	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2002/Flue/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0004 - Shower/Change (27.71 m2)

Ceiling Structures/Linings	Vermiculite	3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R0005 - Hall Chair Store (41.22 m2)

Ceiling Structures/Linings	Vermiculite	3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R0005/Partition Walls (Cubicles)/S20				Chrysotile (white asbestos)		

B00J - R0006 - Communal Space (227.97 m2)

Ceiling Structures/Linings	Vermiculite	3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00J - R0007 - P.E. Store (9.55 m2)

Flue	Fibre Cement Pipe	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2002/Flue/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0008 - Staff Toilet (6.48 m2)

No Asbestos

B00J - R0011 - Distribution Board (0.49 m2) Note: No inspection of live electrical installation.

No Asbestos

B00J - R0012 - Movement (3.85 m2)

No Asbestos

B00J - R0013 - Movement (4.62 m2)

No Asbestos

B00J - R0014 - Stairs (4.62 m2)

No Asbestos

B00J - R0015 - Stairs (1.74 m2)

No Asbestos

B00J - R0016 - Movement (11.99 m2)

No Asbestos

B00J - R0017 - Stairs (3.55 m2)

No Asbestos

B00J - R1002 - Movement (2.79 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00J - R1003 - Cleaning Distributed Store (2.42 m2)						
Flue	Fibre Cement Pipe	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2002/Flue/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00J - R1004 - Movement (6.73 m2)						
Ceiling Structures/Linings	Vermiculite					
3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R1005 - Staff Room Annexe (14.98 m2)						
Ceiling Structures/Linings	Vermiculite					
3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R1006 - Home Base (55.75 m2)						
Ceiling Structures/Linings	Vermiculite					
3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R1007 - Home Base (55.57 m2)						
Ceiling Structures/Linings	Vermiculite					
3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R1008 - Home Base (56.62 m2)						
No Asbestos						
B00J - R1009 - Other-Vacant (21.97 m2)						
Ceiling Structures/Linings	Vermiculite					
3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R1010 - Other-Vacant (7.41 m2)						
Flue	Fibre Cement Pipe	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2002/Flue/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Vermiculite					
3883/B00J/R1010/Ceiling Structures/Linings/S19				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R1013 - Staff Toilet (6.52 m2)						
No Asbestos						
B00J - R1014 - Stairs (5.79 m2)						
No Asbestos						
B00J - R1015 - Movement (91.36 m2)						
In-fill-panel	Flat AC Sheeting	22m	South, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2020/In-fill-panel/S18				Chrysotile (white asbestos)		
B00J - R1016 - Stairs (3.31 m2)						
No Asbestos						
B00J - R2002 - Cleaning Distributed Store (2.66 m2)						
Flue	Fibre Cement Pipe	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2002/Flue/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00J - R2009 - Other-Vacant (11.47 m2)						
No Asbestos						
B00J - R2010 - Home Base (55.88 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00J - R2011 - General Storeroom (13.41 m2)

Flue	Fibre Cement Pipe	1Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2002/Flue/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R2018 - Home Base (66.53 m2)

No Asbestos

B00J - R2019 - Home Base (80.99 m2)

No Asbestos

B00J - R2020 - Movement (91.05 m2)

In-fill-panel	Flat AC Sheeting	20m	South, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3883/B00J/R2020/In-fill-panel/S18				Chrysotile (white asbestos)		

B00J - R2021 - Stairs (3.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other-After School Care - 1965 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00K - R0001 - Movement (60.1 m2)**

No Asbestos

B00K - R0002 - Staff Kitchen (20.8 m2)

No Asbestos

B00K - R0003 - Other-After School Care (74.56 m2)

No Asbestos

B00K - R0004 - Other-After School Care (10.86 m2)

No Asbestos

B00K - R0005 - Other-After School Care (15.72 m2)

No Asbestos

B00K - R0006 - Other-After School Care (8.91 m2)

No Asbestos

B00K - R0007 - Other-After School Care (14.73 m2)

No Asbestos

B00K - R0008 - Other-After School Care (22.62 m2)

No Asbestos

B00K - R0009 - Movement (20.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting	50m2	North, South, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00L/In-fill-panel/S36					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00L - R0001 - Cleaning Distributed Store (7.35 m2)**

No Asbestos

B00L - R0002 - Toilets - Girls (50.28 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00L/R0005/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)

B00L - R0003 - Movement (18.07 m2)

No Asbestos

B00L - R0004 - Staff Toilet (13.76 m2)

No Asbestos

B00L - R0005 - Staff Toilet (11.46 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00L/R0005/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)

B00L - R0008 - Toilets - Boys (39.8 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00L/R0005/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)

B00L - R0009 - Main Switch Board (6.41 m2)

Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00L/R0009/Electrical Backing Board/S66					Chrysotile (white asbestos)

B00L - R0012 - Canteen (22.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3883/B00L/R0010/Ceiling Structures/Linings/S22					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0013 - Staff Kitchen (9.14 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3883/B00L/R0010/Ceiling Structures/Linings/S22					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00L - R0014 - Canteen Office/Store (2.41 m2)

No Asbestos

B00L - R0015 - Staff Toilet (1.83 m2)

Flue	Fibre Cement Pipe	1Unit(s)	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3883/B00J/R2002/Flue/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0018 - Movement (21.91 m2)

No Asbestos

B00L - R0019 - Movement (3.44 m2)

No Asbestos

B00L - R0020 - Lift (2.09 m2)

No Asbestos

B00L - R0021 - Stairs (11.74 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00L - R0022 - Movement (2.66 m2)						
No Asbestos						
B00L - R0023 - Movement (112.02 m2)						
No Asbestos						
B00L - R0024 - General Assistant/Bulk Store (15.46 m2)						
No Asbestos						
B00L - R0025 - Stairs (0.68 m2)						
No Asbestos						
B00L - R0026 - Movement (23.51 m2)						
No Asbestos						
B00L - R0027 - External Movement (13.48 m2)						
No Asbestos						
B00L - R0028 - Canteen (60.33 m2)						
Ceiling Structures/Linings	Vermiculite					
		3883/B00L/R0029/Ceiling Structures/Linings/S67				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0029 - Child Care Centre (81.72 m2)						
Ceiling Structures/Linings	Vermiculite					
		3883/B00L/R0029/Ceiling Structures/Linings/S67				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0030 - Child Care Centre (41.41 m2)						
Ceiling Structures/Linings	Vermiculite					
		3883/B00L/R0029/Ceiling Structures/Linings/S67				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0031 - Kitchen - Pre (26.16 m2)						
Ceiling Structures/Linings	Vermiculite					
		3883/B00L/R0029/Ceiling Structures/Linings/S67				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R0032 - External Movement (20.6 m2)						
No Asbestos						
B00L - R0033 - Shelter (58.09 m2)						
No Asbestos						
B00L - R1008 - Home Base Store (6.06 m2)						
No Asbestos						
B00L - R1009 - Movement (57.11 m2)						
In-fill-panel	Flat AC Sheeting	12m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
		3883/B00L/R1009/In-fill-panel/S23				Chrysotile (white asbestos)
B00L - R1010 - Special Programs Room (27.96 m2)						
No Asbestos						
B00L - R1011 - Movement (3.87 m2)						
No Asbestos						
B00L - R1012 - Lift (2.08 m2)						
No Asbestos						
B00L - R1013 - Movement (5.24 m2)						
No Asbestos						
B00L - R1014 - Movement (15.59 m2)						
No Asbestos						
B00L - R1015 - Movement (15.42 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00L - R1016 - Stairs (4.58 m2)						
No Asbestos						
B00L - R1017 - Distribution Board (0.85 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
3883/B00L/R0010/Ceiling Structures/Linings/S22					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00L - R1018 - Movement (8.72 m2)						
No Asbestos						
B00L - R1019 - Stairs (13.13 m2)						
No Asbestos						
B00L - R1020 - Plant (0.22 m2)						
No Asbestos						
B00L - R1021 - Withdrawal Space - 1hb (10.56 m2)						
No Asbestos						
B00L - R1022 - Practical Activities - 1hb (17.62 m2)						
No Asbestos						
B00L - R1023 - Home Base (54.16 m2)						
No Asbestos						
B00L - R1024 - Home Base (62.63 m2)						
No Asbestos						
B00L - R1025 - Practical Activities - 1hb (17.94 m2)						
No Asbestos						
B00L - R1026 - Withdrawal Space - 1hb (11.48 m2)						
No Asbestos						
B00L - R1027 - Special Programs Store (6.91 m2)						
No Asbestos						
B00L - R1028 - Home Base Store (5.99 m2)						
No Asbestos						
B00L - R2025 - Withdrawal Space - 1hb (11.58 m2)						
No Asbestos						
B00L - R2026 - Home Base Store (8.74 m2)						
No Asbestos						
B00L - R2027 - Distribution Board (0.92 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00L - R2028 - Movement (57.8 m2)						
No Asbestos						
B00L - R2029 - Movement (3.87 m2)						
No Asbestos						
B00L - R2030 - Lift (2.08 m2)						
No Asbestos						
B00L - R2031 - Movement (5.26 m2)						
No Asbestos						
B00L - R2032 - Movement (15.7 m2)						
No Asbestos						
B00L - R2033 - Stairs (2.3 m2)						
No Asbestos						
B00L - R2034 - Movement (17.36 m2)						
No Asbestos						
B00L - R2035 - Movement (8.37 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00L - R2036 - Stairs (13.48 m2)

No Asbestos

B00L - R2037 - Staff Toilet (6.57 m2)

No Asbestos

B00L - R2038 - Staff Toilet (6.47 m2)

No Asbestos

B00L - R2039 - Cleaning Distributed Store (2.57 m2)

No Asbestos

B00L - R2040 - Withdrawal Space - 1hb (9.42 m2)

No Asbestos

B00L - R2041 - Movement (10.41 m2)

No Asbestos

B00L - R2042 - Plant (0.22 m2)

No Asbestos

B00L - R2043 - Home Base Store (6.66 m2)

No Asbestos

B00L - R2044 - Home Base (64.42 m2)

No Asbestos

B00L - R2045 - Practical Activities - 1hb (14.26 m2)

No Asbestos

B00L - R2046 - Practical Activities - 1hb (17.21 m2)

No Asbestos

B00L - R2047 - Home Base (70.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B000 - R0001 - Movement (38.47 m2)

No Asbestos

B000 - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B000 - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B000 - R0004 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B000 - R0005 - Withdrawal Space - 2hb (11.35 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B000 - R0006 - Home Base (59.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B000 - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B000 - R0008 - Practical Activities - 1hb (19.4 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Other-Dse Admin - 1995 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00Q - M1001 - Plant (6.53 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Q - M1003 - Special Programs Room (23.65 m2)

No Asbestos

B00Q - R0001 - No Access (9.17 m2)

No Asbestos

B00Q - R0026 - Movement (7.42 m2)

No Asbestos

B00Q - R0027 - Distribution Board (0.71 m2)

Note: No inspection of live electrical installation.

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Q - R0028 - General Storeroom (0.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Q - R0030 - Movement (127.31 m2)

No Asbestos

B00Q - R0031 - Movement (35.7 m2)

No Asbestos

B00Q - R0032 - Stairs (6.1 m2)

No Asbestos

B00Q - R0033 - Stairs (4.5 m2)

No Asbestos

B00Q - R0034 - Stairs (4.48 m2)

No Asbestos

B00Q - R0035 - Sports Store (7.24 m2)

No Asbestos

B00Q - R0036 - Interview (13.51 m2)

No Asbestos

B00Q - R0037 - Home Base Store (8.5 m2)

No Asbestos

B00Q - R0038 - Home Base (71.13 m2)

No Asbestos

B00Q - R0039 - Home Base (77.88 m2)

No Asbestos

B00Q - R0040 - Practical Activities (118.7 m2)

No Asbestos

B00Q - R0041 - Special Programs Room (88.99 m2)

No Asbestos

B00Q - R0042 - Distribution Board (1.31 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00Q - R0043 - Communications Cupboard (0.91 m2)

No Asbestos

B00Q - R0044 - Home Base (62.67 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00Q - R0045 - Home Base Store (29.06 m2)						
No Asbestos						
B00Q - R0046 - Home Base (81.73 m2)						
No Asbestos						
B00Q - R0047 - Home Base (76.3 m2)						
No Asbestos						
B00Q - R0048 - Home Base (76.64 m2)						
No Asbestos						
B00Q - R0049 - Special Programs Room (65.14 m2)						
No Asbestos						
B00Q - R0050 - Home Base (69.28 m2)						
No Asbestos						
B00Q - R0051 - Movement (15.42 m2)						
No Asbestos						
B00Q - R0052 - Access Shower/Toilet/Change (6.25 m2)						
No Asbestos						
B00Q - R0053 - Toilets - Boys (20.48 m2)						
No Asbestos						
B00Q - R0054 - Toilets - Girls (20.58 m2)						
No Asbestos						
B00Q - R0055 - Movement (57.53 m2)						
No Asbestos						
B00Q - R1001 - No Access (19.04 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1002 - Movement (17.78 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1003 - Seminar/Study (134.25 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1004 - Staff Toilet (16 m2)						
No Asbestos						
B00Q - R1005 - Seminar/Study (23.79 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1006 - Movement (87.35 m2)						
No Asbestos						
B00Q - R1007 - Staff Toilet (15.74 m2)						
No Asbestos						
B00Q - R1008 - General Storeroom (0.23 m2)						
No Asbestos						
B00Q - R1009 - Movement (1.96 m2)						
No Asbestos						
B00Q - R1010 - Plant (17.81 m2)						
No Asbestos						
B00Q - R1011 - Distribution Board (0.4 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00Q - R1012 - General Storeroom (6.62 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00Q - R1013 - Staff Kitchen (6.84 m2)						
No Asbestos						
B00Q - R1014 - Staff Room (25.99 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1015 - Movement (34.59 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1016 - Plant (27.86 m2)						
No Asbestos						
B00Q - R1017 - General Storeroom (29.16 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1018 - Other - Regional Use (240.88 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1019 - Movement (1.89 m2)						
No Asbestos						
B00Q - R1020 - Staff Toilet (1.81 m2)						
No Asbestos						
B00Q - R1021 - General Storeroom (0.27 m2)						
No Asbestos						
B00Q - R1022 - Staff Room Annexe (19.16 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1023 - Staff Room Annexe (12.64 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1024 - Movement (21.44 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1025 - Staff Room Annexe (19.16 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00Q - R1026 - Movement (16.01 m2)						
No Asbestos						
B00Q - R1027 - Movement (85.81 m2)						
No Asbestos						
B00Q - R1028 - Communal/Performance Store (29.91 m2)						
No Asbestos						
B00Q - R1029 - Stairs (13.63 m2)						
No Asbestos						
B00Q - R1030 - Stairs (14.11 m2)						
No Asbestos						
B00Q - R1031 - Stairs (12.15 m2)						
No Asbestos						
B00Q - R1032 - Library Office/Workroom (24.79 m2)						
No Asbestos						
B00Q - R1033 - Special Programs Room (82.13 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Other - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00T - R0001 - Movement (5.71 m2)

No Asbestos

B00T - R0002 - General Storeroom (11.51 m2)

No Asbestos

B00T - R0003 - Sports Store (56.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10239 - Learning Unit - Standard With P.A.A. : Placement Date - 6/07/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D10745 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 1/12/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D11213 - Learning Unit - Standard/Withdrawal : Placement Date - 24/01/2002

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D11357 - Learning Unit - Standard/Withdrawal : Placement Date - 16/06/2003

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D11681 - Learning Unit - Standard With P.A.A. : Placement Date - 18/08/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D11953 - Learning Unit - Standard/Withdrawal : Placement Date - 10/06/2003						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D12110 - Learning Unit - Standard/Withdrawal : Placement Date - 24/01/2001						
Exterior						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

OS 602 - D13542 - Learning Unit - Standard With P.A.A. : Placement Date - 19/06/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 751 - D14043 - Learning Unit - ESL : Placement Date - 8/09/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Es1**

No Asbestos Found.

R2 - Es1

No Asbestos Found.

OS 601 - D14676 - Learning Unit - Standard/Withdrawal : Placement Date - 10/06/2003**Exterior**

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D16294 - Learning Unit - Standard With P.A.A. : Placement Date - 7/01/2014**Exterior**

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 750 - D17417 - Learning Unit - ESL : Placement Date - 28/01/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Esl						
No Asbestos Found.						
OS 603 - D17458 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 13/11/2013						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3883_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017