


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Waratah West Public School (3932)
Region : Hunter/Central Coast
State Electorate : Wallsend
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 29 - Apr - 2008
Reviewed By : AECOM : 25 - Jun - 2015

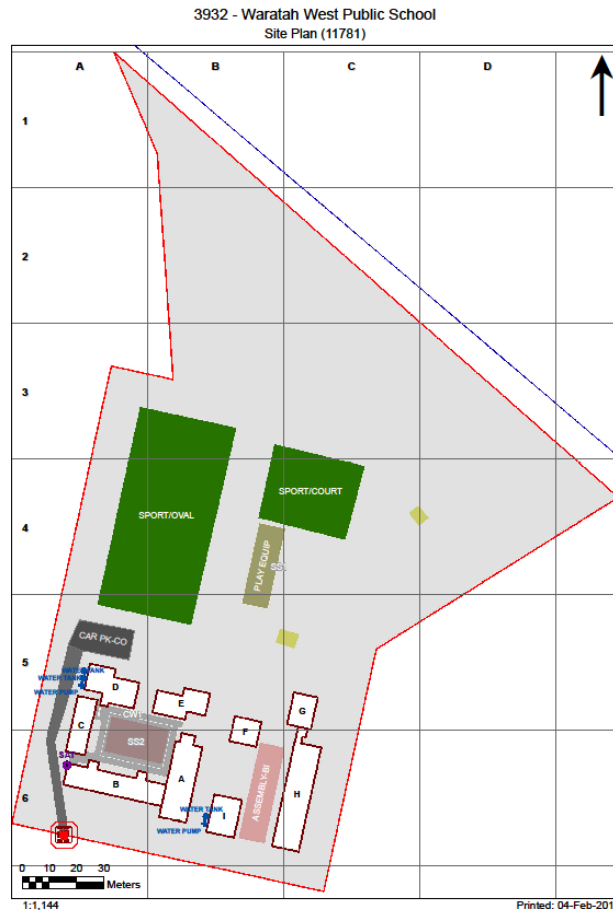

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
In-fill-panel	Compressed AC Sheet	10m2	North and west of building.	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00A/R0001/In-fill-panel/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no ceiling space access point.					
Underfloor Voids	Non Accessible Area - Area inaccessible no floor access hatch.					

Interior**B00A - R0002 - Uniform Shop**

No Asbestos

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00A - R0005 - Staff Toilet

No Asbestos

B00A - R0006 - Staff Toilet

No Asbestos

B00A - R0007 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0008 - Interview

In-fill-panel	Flat AC Sheeting	6m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00A/R0001/In-fill-panel/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0009 - Deputy Principal

In-fill-panel	Flat AC Sheeting	6m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00A/R0001/In-fill-panel/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0010 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0011 - Principal

No Asbestos

B00A - R0014 - Sick Bay

Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00A - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00A - R0021 - Interview

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0022 - Staff Room

No Asbestos

B00A - R0023 - Staff Kitchen

No Asbestos

B00A - R0024 - Movement

No Asbestos

B00A - R0025 - Clerical Office

No Asbestos

B00A - R0026 - Movement

No Asbestos

B00A - R0027 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	--------	------------	--------------------	---------	--------------------

3932/B00C/R0002/Wall Linings Internal/S12

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Library - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris	6Unit	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3932/B00B/Underfloor Voids - Packing to Floor Joists/S10			Chrysotile (white asbestos)		
Underfloor Voids	AC Fragments/Debris	2Unit	Throughout	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)
	3932/B00B/Underfloor Voids - Packing to Floor Joists/S10			Chrysotile (white asbestos)		
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no access hatch.					
In-fill-panel	Compressed AC Sheet	20m2	North, south	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00A/R0001/In-fill-panel/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00B - R0001 - Home Base**

No Asbestos

B00B - R0002 - Home Base Store

Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00B - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0004 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00B - R0005 - Library Office/Workroom

No Asbestos

B00B - R0006 - K.L.A. Store

No Asbestos

B00B - R0007 - Reading Area

No Asbestos

B00B - R0008 - K.L.A. Store

No Asbestos

B00B - R0009 - Library Office/Workroom

No Asbestos

B00B - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0011 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00B - R0012 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	3932/B00B/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R0013 - Home Base						
No Asbestos						
B00B - R9001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R9003 - Movement						
No Asbestos						
B00B - R9004 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	16.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Partition Walls (Cubicles)	Corrugated AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/Room+1/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
B00B - R9005 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	19.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/Room+1/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no access hatch.
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - no floor access hatch, no floor space.

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	107m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00C - R0002 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	11.5m2	North, south.	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00C - R0003 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	11m2	North, west	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00C - R0004 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6.45m2	East, north.	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible - no access hatch.					

Interior**B00D - R0001 - P.E. Store**

No Asbestos

B00D - R0002 - Sports Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00D/R0002/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00D - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00D/R0002/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00D - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00D/R0002/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00D - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00D/R0002/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00D - R9001 - Movement

No Asbestos

B00D - R9002 - Movement

No Asbestos

B00D - R9003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/Room+1/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	

B00D - R9004 - General Assistant/Bulk Store

No Asbestos

B00D - R9005 - Garden Store

No Asbestos

B00D - R9006 - General Storeroom

No Asbestos

B00D - R9007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00D - R9008 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3932/B00B/R0010/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	13m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no ceiling space access hatch.					

Interior**B00E - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00E/R0001/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00E - R0002 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00E/R0001/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00E - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00E - R0008 - P.E. Store

Wall Linings Internal	Flat AC Sheeting	35m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00E/R0001/Wall Linings Internal/S6					Chrysotile (white asbestos)
Divider wall lining, half wall.	Flat AC Sheeting					
	3932/B00E/R0008/Divider wall lining, half wall./S13					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	56.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00E - R0009 - Sports Store

Wall Linings Internal	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00E/R0001/Wall Linings Internal/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00E - R0010 - Disabled Shower/Toilet

No Asbestos

B00E - R0011 - Movement

Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00E/R0001/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00E - R0012 - Entry Vestibule

Ceiling Structures/Linings	Flat AC Sheeting	2.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Divider wall lining	Flat AC Sheeting					
	3932/B00E/R0008/Divider wall lining, half wall./S13					No Asbestos Detected

B00E - R0013 - Practical Activities - 2hb

Ceiling Structures/Linings	Flat AC Sheeting	5.06m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	5.5m2	North, east (upper).	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12				Chrysotile (white asbestos)	
Divider wall.	Flat AC Sheeting					
	3932/B00E/R0008/Divider wall lining, half wall./S13				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Other-Community Use - 1970 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed Area - Access hatch obstructed by Projector.					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed Area - Access hatch obstructed by Projector.					

Interior**B00F - R0001 - Other-Community Use**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00F/R0003/Ceiling Structures/Linings/S14			Chrysotile (white asbestos)		

B00F - R0002 - Other-Community Use

In-fill-panel	Flat AC Sheeting	2m2	North western corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/R0010/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0003 - Other-Community Use

Ceiling Structures/Linings	Flat AC Sheeting	3.52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00F/R0003/Ceiling Structures/Linings/S14			Chrysotile (white asbestos)		
Electrical Backing Board	Resinous Board	0.2m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3932/B00G/Gable Verge Lining/S16				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible no access hatch.					
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**B00G - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00G/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/Room+1/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	

B00G - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00G/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00B/Room+1/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	

B00G - R0003 - Staff Shower/Change

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00G/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

B00G - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	3932/B00G/R0004/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - General Learning/Communal Facilities - 1970 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	AC Fragments/Debris	3Unit	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3932/B00H/Underfloor Voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00H - R0001 - Movement**

No Asbestos

B00H - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0003 - Staff Room Annexe

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles					
	3932/B00H/R0004/Floor Coverings Res/Textile/S7			No Asbestos Detected		

B00H - R0005 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00H - R0007 - General Storeroom						
No Asbestos						
B00H - R0008 - General Storeroom						
No Asbestos						
B00H - R0009 - Communal Space						
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	108m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00H - R0010 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3932/B00H/R0004/Floor Coverings Res/Textile/S7					
B00H - R0011 - Music Store						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00H/R0003/Wall Linings Internal/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3932/B00H/R0004/Floor Coverings Res/Textile/S7					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1954 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00G/Gable Verge Lining/S16					Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	8Unit	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3932/B00I/Underfloor Voids/S19					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible Height Restriction					

Interior**B00I - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3932/B00C/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00I - R0002 - Practical Activities - 1hb

No Asbestos

B00I - R0003 - Home Base

No Asbestos

B00I - R0004 - Toilets - Boys/Girls

No Asbestos

B00I - R0005 - Home Base Store

No Asbestos

B00I - R0006 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3932_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017