


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Waverley Public School (3953)
Region : Sydney
State Electorate : Coogee
Local Government Area : Waverley

Initial Survey : Noel Arnold & Associates : 17 - Dec - 2007
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

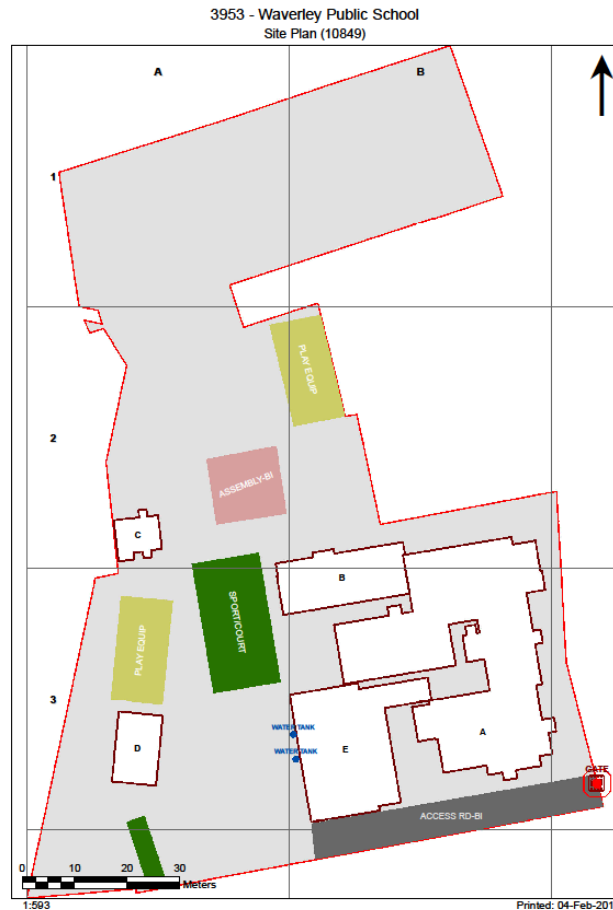

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1879 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	Flat AC Sheeting 3953/B00A/Underfloor Voids/S10					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00A - R0001 - General Storeroom**

No Asbestos

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Personal Effects Storage

No Asbestos

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Communal Space

No Asbestos

B00A - R0010 - Raised Platform

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Movement

No Asbestos

B00A - R0014 - Duplicating Workroom

No Asbestos

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Movement

No Asbestos

B00A - R0017 - Entry Vestibule

No Asbestos

B00A - R0018 - Movement

No Asbestos

B00A - R0019 - Clerical Office

No Asbestos

B00A - R0020 - Principal

No Asbestos

B00A - R0021 - Hall Chair Store

No Asbestos

B00A - R0022 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0042/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00A - R0024 - Stairs						
No Asbestos						
B00A - R0025 - Uniform Shop						
No Asbestos						
B00A - R0026 - Staff Toilet						
No Asbestos						
B00A - R0027 - Movement						
No Asbestos						
B00A - R0029 - Toilets - Boys/Girls						
No Asbestos						
B00A - R0030 - Cleaning Distributed Store						
No Asbestos						
B00A - R0031 - Cleaning Distributed Store						
No Asbestos						
B00A - R0032 - Movement						
No Asbestos						
B00A - R0033 - Home Base						
No Asbestos						
B00A - R0034 - Home Base						
No Asbestos						
B00A - R0035 - Home Base						
Chalk Board	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0044/Chalk Board/S7					Chrysotile (white asbestos)	
B00A - R0036 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0036/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R0037 - Movement						
No Asbestos						
B00A - R0038 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0036/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R0039 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00A/R0043/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00A - R0040 - Movement						
No Asbestos						
B00A - R0041 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0042/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00A - R0042 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0042/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00A - R0043 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00A/R0043/Floor Coverings Res/Textile/S6					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0044 - Special Programs Room						
Chalk Board	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0044/Chalk Board/S7					Chrysotile (white asbestos)	
B00A - R0045 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00A/R0043/Floor Coverings Res/Textile/S6					No Asbestos Detected	
Chalk Board	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0044/Chalk Board/S7					Chrysotile (white asbestos)	
B00A - R0046 - Practical Activities - 1hb						
No Asbestos						
B00A - R0047 - Movement						
No Asbestos						
B00A - R1001 - Movement						
No Asbestos						
B00A - R1002 - Home Base						
No Asbestos						
B00A - R1003 - Sick Bay						
No Asbestos						
B00A - R1004 - Home Base						
No Asbestos						
B00A - R1005 - Staff Room						
No Asbestos						
B00A - R1006 - Staff Kitchen						
Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00A/R0043/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00A - R1007 - Movement						
No Asbestos						
B00A - R1008 - Movement						
No Asbestos						
B00A - R1009 - General Storeroom						
No Asbestos						
B00A - R1010 - General Storeroom						
No Asbestos						
B00A - R1011 - Home Base						
No Asbestos						
B00A - R1012 - Movement						
No Asbestos						
B00A - R1013 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R1014 - Home Base						
No Asbestos						
B00A - R1015 - Staff Toilet						
No Asbestos						
B00A - R1016 - Staff Toilet						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Encapsulated material within unit						
B00A - R1017 - Movement						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1018 - Home Base						
No Asbestos						
B00A - R1019 - Home Base						
No Asbestos						
B00A - R1020 - Home Base						
No Asbestos						
B00A - R1021 - Movement						
No Asbestos						
B00A - R1022 - Library Office/Workroom						
No Asbestos						
B00A - R1023 - Seminar/Study						
No Asbestos						
B00A - R1024 - Reading Area						
No Asbestos						
B00A - R1025 - Home Base						
Chalk Board	Flat AC Sheeting	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00A/R0044/Chalk Board/S7					Chrysotile (white asbestos)	
B00A - R1026 - General Storeroom						
No Asbestos						
B00A - R1027 - Stairs						
No Asbestos						
B00A - R9001 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00A/R0043/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00A - R9002 - General Storeroom						
No Asbestos						
B00A - R9003 - Stairs						
Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00A/R0043/Floor Coverings Res/Textile/S6					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Other-After School Care/Pupil Facilities - 1889 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	Non Accessible Area - No Access - Ceiling too high (>5m) to sample safely
Underfloor Void	No Asbestos Found

Interior

B00B - R0001 - Drinking Facilities

No Asbestos

B00B - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00B/R0002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles					
3953/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00B - R0003 - Out Of School Hours Care Centre

No Asbestos

B00B - R0004 - Canteen

No Asbestos

B00B - R0005 - Staff Kitchen

No Asbestos

B00B - R0006 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1924 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00C - R0001 - Drinking Facilities

No Asbestos

B00C - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00C/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

B00C - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00C/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00C/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Other-Vacant - 1924 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	Packing	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3953/B00D/Ceiling Void/S11					Chrysotile (white asbestos)	

Interior

B00D - R0002 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00D/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0003 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00D/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0004 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00D/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0005 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3953/B00D/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Communal Space

No Asbestos

B00E - R0002 - Covered Outdoor Learning Area

No Asbestos

B00E - R0003 - Main Switch Board

No Asbestos

B00E - R0004 - Disabled Shower/Toilet

No Asbestos

B00E - R0005 - Cleaning Distributed Store

No Asbestos

B00E - R0006 - Plant

No Asbestos

B00E - R0007 - Plant

No Asbestos

B00E - R0008 - Toilet - Lobby

No Asbestos

B00E - R0009 - Toilets - Boys

No Asbestos

B00E - R0010 - Sound Cupboard

No Asbestos

B00E - R0011 - Toilets - Girls

No Asbestos

B00E - R0012 - Toilet - Lobby

No Asbestos

B00E - R0013 - P.E. Store

No Asbestos

B00E - R0014 - Communal/Performance Store

No Asbestos

B00E - R0015 - Hall Chair Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017