


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Warilla Public School (4005)  
**Region :** Illawarra and South East  
**State Electorate :** Shellharbour  
**Local Government Area :** Shellharbour

**Initial Survey :** Noel Arnold & Associates : 06 - May - 2008  
**Reviewed By :** AECOM : 18 - Jun - 2015

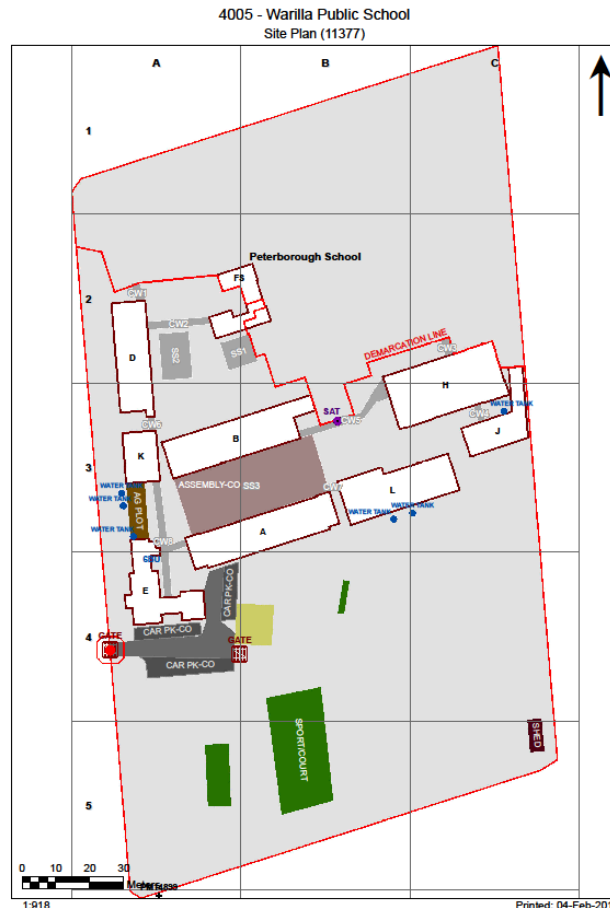

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1968 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00A/R1001/Ceiling Structures/Linings/S30				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00A/R1001/Ceiling Structures/Linings/S30				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
In-fill-panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4005/B00A/In-fill-panel/S23					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00A - R0001 - Movement (84.08 m2)**

In-fill-panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4005/B00A/In-fill-panel/S23					

**B00A - R0002 - Cleaning Distributed Store (6.75 m2)**

No Asbestos

**B00A - R0003 - General Storeroom (15.45 m2)**

No Asbestos

**B00A - R0004 - Home Base (56.31 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0005 - Home Base Store (3.99 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00A/R0009/Floor Coverings Res/Textile/S24					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0006 - Personal Effects Storage (12.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00A/R0009/Floor Coverings Res/Textile/S24					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0007 - Home Base (56.23 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0008 - Home Base Store (3.99 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00A/R0009/Floor Coverings Res/Textile/S24					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0009 - Movement (6 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0010 - Home Base (54.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0011 - Home Base Store (3.93 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0012 - Personal Effects Storage (12.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0013 - Distribution Board Cupboard (0.33 m2)</b>						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Electrical Mounting Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00A - R0014 - Home Base (55.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0015 - Home Base Store (3.93 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0016 - Movement (5.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0017 - General Storeroom (6.41 m2)</b>						
No Asbestos						
<b>B00A - R0018 - General Storeroom (15.73 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0019 - Movement (1.41 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Stairs (0.57 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Movement (1.31 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Stairs (0.69 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Movement (105.57 m2)</b>						
In-fill-panel	Flat AC Sheeting 4005/B00A/In-fill-panel/S23				<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Flat AC Sheeting 4005/B00A/R1001/Ceiling Structures/Linings/S30	106m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>						
<b>B00A - R1002 - Home Base (56.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1003 - Home Base Store (4.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00A - R1004 - Personal Effects Storage (12.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1005 - Home Base (56.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1006 - Home Base Store (4.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00A - R1007 - Movement (5.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1008 - Home Base (56.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1009 - Home Base Store (4.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1010 - Personal Effects Storage (12.35 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00A - R1011 - Home Base (56.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00A - R1012 - Home Base Store (4.05 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1013 - Movement (5.93 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00A/R0009/Floor Coverings Res/Textile/S24					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00A - R1014 - Stairs (13.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00A - R1015 - Stairs (14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1984 - Brick/Veneer (Brick/Veneer)****Exterior**

Gable Verge Lining	Flat AC Sheeting 4005/B00B/Gable Verge Lining/S31					<b>No Asbestos Detected</b>
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00B - R0001 - Movement (95.67 m2)**

Ceiling Structures/Linings	Moulded FC sheet 4005/B00B/R0001/Ceiling Structures/Linings/S10	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting 4005/B00B/R0001/In-fill-panel/S11	15m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
In-fill-panel	Flat AC Sheeting 4005/B00B/R0001/In-fill-panel/S13	5m	South, above doors + windows	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0002 - Main Switch Board Cupboard (7.51 m2)**

Electrical Mounting Board	Resinous Board	4Unit	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Assumed Asbestos - Electrical Hazard</b>		
Ceiling Structures/Linings	Flat AC Sheeting 4005/B00B/R0002/Ceiling Structures/Linings/S9	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0003 - Cleaning Distributed Store (5.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00B/R0005/Floor Coverings Res/Textile/S12	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0004 - Other-Community Use (16.07 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00B/R0005/Floor Coverings Res/Textile/S12	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0005 - Movement (5.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00B/R0005/Floor Coverings Res/Textile/S12	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0006 - Home Base (56.96 m2)**

No Asbestos

**B00B - R0007 - Home Base Store (4.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00B/R0005/Floor Coverings Res/Textile/S12	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0008 - Personal Effects Storage (9.06 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00B/R0005/Floor Coverings Res/Textile/S12	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0009 - Home Base (56.81 m2)**

No Asbestos

**B00B - R0010 - Home Base Store (4.43 m2)**

No Asbestos

**B00B - R0011 - Movement (8.55 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0005/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0012 - Staff Room (85.45 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0005/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0013 - Staff Toilet (3.25 m2)</b>						
No Asbestos						
<b>B00B - R0014 - General Storeroom (2.56 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0005/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0015 - Movement (7.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0005/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0016 - General Storeroom (29.38 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
4005/B00B/R0016/Ceiling Structures/Linings/S32					<b>No Asbestos Detected</b>	
<b>B00B - R0017 - Movement (2.95 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0001/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00B - R0018 - Covered Outdoor Learning Area (31.17 m2)</b>						
Ceiling Structures/Linings	Moulded FC sheet	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0001/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
In-fill-panel	Flat AC Sheeting	19m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0001/In-fill-panel/S11					<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	5m	North above windows & doors	Good Condition (1)	Low (1)	Low Priority (2-3)
4005/B00B/R0001/In-fill-panel/S13					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Staff Facilities - 1962 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00D/R0002/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00D/R0002/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	Non Accessible Area - Height Restriction					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Movement (6.64 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00D/R0002/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0004 - Special Programs Room (27.24 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00D/R0004/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>	

**B00D - R0005 - Handwashing Facilities (1.45 m2)**

No Asbestos

**B00D - R0006 - General Storeroom (2.03 m2)**

No Asbestos

**B00D - R0010 - Home Base (54.18 m2)**

No Asbestos

**B00D - R0012 - Movement (3.35 m2)**

No Asbestos

**B00D - R0014 - Entry Vestibule (12.87 m2)**

No Asbestos

**B00D - R0015 - General Storeroom (9.64 m2)**

No Asbestos

**B00D - R0019 - External Movement (4.7 m2)**

No Asbestos

**B00D - R0020 - Home Base (80.44 m2)**

No Asbestos

**B00D - R0021 - Home Base (66.06 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00D/R0021/Ceiling Structures/Linings/S34				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00D - R0022 - Disabled Toilet (24.4 m2)**

No Asbestos

**B00D - R0023 - Study Annexe (15.63 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Administration/Pupil Facilities - 1968 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4005/B00E/Eaves Linings/S29	120m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting 4005/B00E/Eaves Linings/S29	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting 4005/B00A/In-fill-panel/S23					<b>No Asbestos Detected</b>
Wall Cladding	Flat AC Sheeting 4005/B00E/Eaves Linings/S29	15m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00E - R0001 - Clerical Office/Workroom (26.53 m2)**

No Asbestos

**B00E - R0002 - Sick Bay - Shower/Toilet (4.24 m2)**

No Asbestos

**B00E - R0003 - Sick Bay (12.28 m2)**

No Asbestos

**B00E - R0004 - Movement (4.04 m2)**

No Asbestos

**B00E - R0005 - Cleaning Supplies (4.46 m2)**

Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	--	-----	------------	--------------------	---------	--

**B00E - R0006 - Staff Toilet (4.3 m2)**

No Asbestos

**B00E - R0007 - Distribution Board Cupboard (1.1 m2)**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	--	-----	------------	--------------------	---------	--

Electrical Mounting Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
---------------------------	----------------	-------	-------	--------------------	---------	---

Wall Linings Internal	Flat AC Sheeting 4005/B00E/R0007/Wall Linings Internal/S27	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	---	-----	------------	----------------------------	---------	--

**B00E - R0008 - Staff Toilet (5.62 m2)**

No Asbestos

**B00E - R0009 - Staff Study (14.84 m2)**

Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00E - R0010 - General Storeroom (13.11 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0011 - General Storeroom (7.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0012 - Movement (5.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4005/B00E/R0012/Ceiling Structures/Linings/S28	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting 4005/B00A/In-fill-panel/S23				<b>No Asbestos Detected</b>	
<b>B00E - R0013 - Principal (21.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00E - R0014 - Staff Toilet (3.39 m2)</b>						
No Asbestos						
<b>B00E - R0015 - General Storeroom (9.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4005/B00A/R0009/Floor Coverings Res/Textile/S24	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0016 - Clerical Office (15.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00E - R0017 - Movement (35.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4005/B00A/R0009/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00E - R0018 - Toilets - Boys (46.61 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 4005/B00K/R0001/Partition Walls (Cubicles)/S17				<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Flat AC Sheeting 4005/B00K/R0001/Ceiling Structures/Linings/S16	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00E - R0019 - Movement (9.06 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities/Pupil Facilities - 1982 - Brick/Veneer (Brick/Veneer)****Exterior**

Wall Cladding	Flat AC Sheeting 4005/B00H/Wall Cladding/S33					No Asbestos Detected
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00H - R0001 - Cleaning Distributed Store (0.98 m2)**

No Asbestos

**B00H - R0002 - Other-Vacant (0.91 m2)**

No Asbestos

**B00H - R0003 - Student Shower (2.25 m2)**

No Asbestos

**B00H - R0004 - Movement (6.65 m2)**

No Asbestos

**B00H - R0005 - Toilets - Girls (10.69 m2)**

No Asbestos

**B00H - R0006 - Stage (53.99 m2)**

No Asbestos

**B00H - R0007 - Movement (6.14 m2)**

No Asbestos

**B00H - R0008 - Student Shower (3.11 m2)**

No Asbestos

**B00H - R0009 - Toilets - Boys (10.67 m2)**

No Asbestos

**B00H - R0010 - Chair Store (2.84 m2)**

No Asbestos

**B00H - R0011 - Chair Store (2.81 m2)**

No Asbestos

**B00H - R0012 - Communal Space (186.25 m2)**

No Asbestos

**B00H - R0013 - P.E. Store (15.38 m2)**

No Asbestos

**B00H - R0014 - Canteen (43.63 m2)**

No Asbestos

**B00H - R0015 - Canteen Office/Store (5.65 m2)**

No Asbestos

**B00H - R0016 - No Access (5.65 m2)**

No Asbestos

**B00H - R0017 - Disabled Toilet (3.31 m2)**

No Asbestos

**B00H - R0018 - Sports Store (14.09 m2)**

No Asbestos

**B00H - R0019 - Distribution Board Cupboard (1.75 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0020 - Movement (94.38 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting					
	4005/B00H/R0020/Wall cladding/S18					<b>No Asbestos Detected</b>
<b>B00H - R0021 - Movement (31.62 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4005/B00H/R0020/Wall cladding/S18					<b>No Asbestos Detected</b>
<b>B00H - R0022 - Movement (15.71 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4005/B00H/R0020/Wall cladding/S18					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Other-Regional Use - 1966 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00J/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00J/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00J - R0001 - Movement (33.47 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00J/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00J - R0002 - Home Base (44.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00J/R0002/Floor Coverings Res/Textile/S20				<b>Chrysotile (white asbestos)</b>	

**B00J - R0003 - Home Base (44.34 m2)**

No Asbestos

**B00J - R0004 - Machine Storage (33.27 m2)**

No Asbestos

**B00J - R0005 - Covered Vehicle Area/Porte Cochere (51.35 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1962 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00K/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00K/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00K - R0001 - Toilets - Girls (70.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00K/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet					
	4005/B00K/R0001/Partition Walls (Cubicles)/S17			<b>No Asbestos Detected</b>		

**B00K - R0002 - Cleaning Distributed Store (2.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00K/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00K - R0003 - General Storeroom (9.8 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00K/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet					
	4005/B00K/R0001/Partition Walls (Cubicles)/S17			<b>No Asbestos Detected</b>		

**B00K - R0004 - General Storeroom (2.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4005/B00K/R0001/Ceiling Structures/Linings/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00K - R0005 - Cleaning Supplies (13.57 m2)**

No Asbestos

**B00K - R0006 - General Storeroom (4.87 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	4005/B00K/R0006/Ceiling Structures/Linings/S15			<b>No Asbestos Detected</b>		

**B00K - R0007 - Movement (30.81 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning/Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00L - R0001 - Practical Activities (20.77 m2)**

No Asbestos

**B00L - R0002 - Home Base (58.79 m2)**

No Asbestos

**B00L - R0003 - Home Base Store (5.79 m2)**

No Asbestos

**B00L - R0004 - Withdrawal Space - 1hb (8.98 m2)**

No Asbestos

**B00L - R0005 - Entry Vestibule (23.39 m2)**

No Asbestos

**B00L - R0006 - Entry Vestibule (3.41 m2)**

No Asbestos

**B00L - R0007 - Access Shower/Toilet (6.54 m2)**

No Asbestos

**B00L - R0008 - Cleaning Distributed Store (3.43 m2)**

No Asbestos

**B00L - R0009 - Distribution Board (0.7 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0010 - Communal Space (169.81 m2)**

No Asbestos

**B00L - R0011 - K.L.A. Store (14.58 m2)**

No Asbestos

**B00L - R0012 - Communal/Performance Store (7.8 m2)**

No Asbestos

**B00L - R0013 - Library Office/Workroom (22.87 m2)**

No Asbestos

**B00L - R0014 - External Movement (31.45 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0FS - Pupil Facilities - 1962 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior**

**B0FS - R0003 - Toilets - Boys (39.97 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

4005/B0FS/R0003/Ceiling Structures/Linings/S35

Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

**B0FS - R0004 - Cleaning Distributed Store (1.65 m2)**

Non Accessible

**B0FS - R0007 - External Movement (14.82 m2)**

No Asbestos

**B0FS - R0008 - Adjoining School (19.58 m2)**

Non Accessible

**B0FS - R0009 - Adjoining School (1.58 m2)**

Non Accessible

**B0FS - R0010 - General Storeroom (11.62 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	11.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	--------	------------	--------------------	---------	--------------------

4005/B0FS/R0003/Ceiling Structures/Linings/S35

Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

**B0FS - R0011 - Adjoining School (34.51 m2)**

No Asbestos

**B0FS - R0012 - Adjoining School (12.37 m2)**

Non Accessible

**B0FS - R0013 - Adjoining School (26.4 m2)**

Non Accessible

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017