


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wattawa Heights Public School (4059)
Region : South Western Sydney
State Electorate : Bankstown
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Mar - 2017

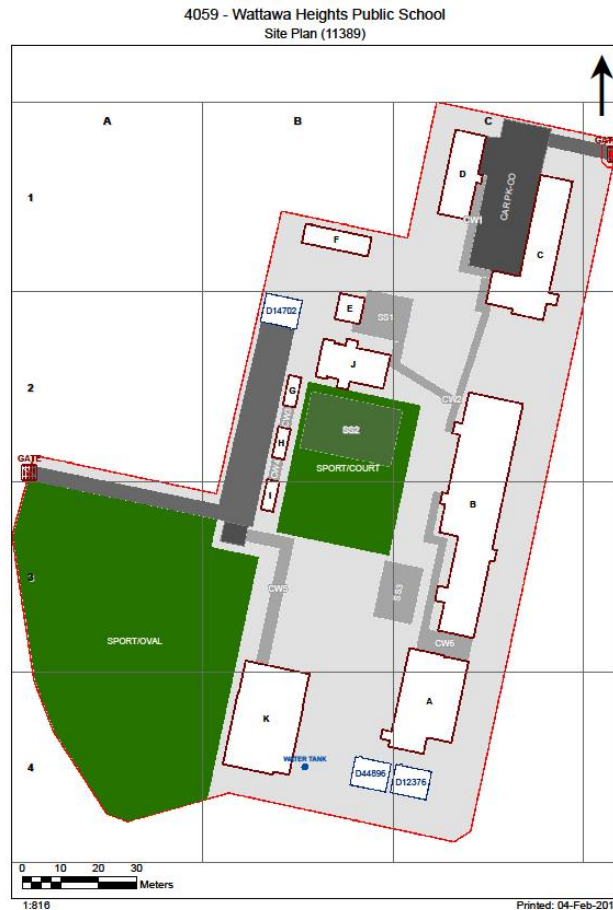

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1956 - Concrete (Concrete)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00A/Eaves Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4059/B00A/Gable Verge Lining/S35					
Wall Cladding	Flat AC Sheeting				No Asbestos Detected	
	4059/B00A/Wall Cladding/S36					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4059/B00A/Underfloor Voids/S33				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B00A - R0001 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					
	4059/B00A/R0001/Floor Coverings Res/Textile/S9				No Asbestos Detected	

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	4059/B00A/R0003/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00A - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	4059/B00A/R0003/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00A - R0005 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	4059/B00A/R0003/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Practical Activities - 1hb

No Asbestos

B00A - R0008 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4059/B00A/R0008/Floor Coverings Res/Textile/S10				No Asbestos Detected	

B00A - R0009 - Practical Activities - 1hb

No Asbestos

B00A - R0010 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00A/R0010/Wall Linings Internal/S31				Chrysotile (white asbestos)	

B00A - R0011 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	4059/B00A/R0003/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00A - R0012 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	4059/B00A/R0003/Floor Coverings Res/Textile/S8				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R0013 - Handwashing Facilities

Floor Coverings Res/Textile	Vinyl Tiles					
4059/B00A/R0003/Floor Coverings Res/Textile/S8					No Asbestos Detected	

B00A - R0014 - Toilet - E

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0015 - Movement

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0016 - Movement

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0017 - Movement

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0018 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00A/R0018/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1956 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4059/B00B/Eaves Linings/S11	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting 4059/B00B/Gable Verge Lining/S38					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 4059/B00B/Wall Cladding/S39					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 4059/B00B/Eaves Linings/S13	12m2	North, South and East. Adjacent to BR0005 and BR0012.	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris 4059/B00B/Underfloor Voids/S37	1m2	R002	Minimal Damage (2)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Personal Effects Storage

No Asbestos

B00B - R0005 - Movement

No Asbestos

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Home Base Store

Wall Linings Internal	Flat AC Sheeting 4059/B00B/R0015/Wall Linings Internal/S15	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

B00B - R0010 - Personal Effects Storage

No Asbestos

B00B - R0011 - Personal Effects Storage

No Asbestos

B00B - R0012 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 4059/B00B/R0012/Floor Coverings Res/Textile/S16	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

B00B - R0013 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 4059/B00B/R0013/Ceiling Structures/Linings/S17	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0014 - Home Base						
No Asbestos						
B00B - R0015 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00B/R0015/Wall Linings Internal/S15					Chrysotile (white asbestos)	
B00B - R0016 - Movement						
No Asbestos						
B00B - R0017 - General Storeroom						
No Asbestos						
B00B - R0018 - Deputy Principal						
No Asbestos						
B00B - R0019 - Teachers Aide Special Ed						
No Asbestos						
B00B - R0020 - Cleaning Supplies						
No Asbestos						
B00B - R0021 - Movement						
No Asbestos						
B00B - R0022 - Home Base						
No Asbestos						
B00B - R0023 - Home Base Store						
No Asbestos						
B00B - R0024 - Personal Effects Storage						
No Asbestos						
B00B - R0025 - Personal Effects Storage						
No Asbestos						
B00B - R0026 - Movement						
No Asbestos						
B00B - R0027 - Home Base						
No Asbestos						
B00B - R0028 - Home Base Store						
No Asbestos						
B00B - R0030 - Movement						
No Asbestos						
B00B - R0031 - External Movement						
Eave Lining	Flat AC Sheeting	12m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00B/Eaves Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0032 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00B/R0032/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)	
B00B - R9001 - Garden Store						
Pillar Packing	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00B/R9001/Packing/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R9002 - General Storeroom						
Pillar Packing	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00B/R9001/Packing/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1956 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 4059/B00C/Eaves Linings/S18	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 4059/B00C/Gable Verge Lining/S41					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris 4059/B00C/Underfloor Voids/S40	1m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior**B00C - R0002 - Main Switch Board**

Wall Linings Internal	Flat AC Sheeting 4059/B00C/R0002/Wall Linings Internal/S21	4m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4059/B00C/R0002/Wall Linings Internal/S21	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0004 - Sick Bay

No Asbestos

B00C - R0007 - Principal

No Asbestos

B00C - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 4059/B00C/R0008/Floor Coverings Res/Textile/S22					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0009 - Movement

No Asbestos

B00C - R0010 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles 4059/B00C/R0010/Floor Coverings Res/Textile/S23					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0012 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting 4059/B00C/R0013/Wall Linings Internal/S32	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4059/B00C/R0013/Wall Linings Internal/S32	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0013 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting 4059/B00C/R0013/Wall Linings Internal/S32	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4059/B00C/R0013/Wall Linings Internal/S32	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0014 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0016 - Reading Area						
No Asbestos						
B00C - R0018 - Reading Area						
No Asbestos						
B00C - R0019 - Cleaning Distributed Store						
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00C/R0013/Wall Linings Internal/S32				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0020 - Cleaning Distributed Store						
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00C/R0013/Wall Linings Internal/S32				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0021 - Movement						
No Asbestos						
B00C - R0022 - Movement						
No Asbestos						
B00C - R0023 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					
4059/B00C/R0023/Wall Linings Internal/S28				No Asbestos Detected		
B00C - R0024 - General Storeroom						
No Asbestos						
B00C - R0025 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00C/R0025/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0026 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00C/R0025/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0027 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00C/R0025/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0028 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4059/B00C/R0025/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0029 - Movement						
No Asbestos						
B00C - R0030 - Clerical Office						
No Asbestos						
B00C - R0031 - Security Store						
No Asbestos						
B00C - R0032 - Clerical/Printing						
No Asbestos						
B00C - R0033 - Reading Area						
No Asbestos						
B00C - R9001 - General Assistant/Bulk Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Pillar Packing	Flat AC Sheeting 4059/B00C/R9001/Packing/S19					No Asbestos Detected
B00C - R9002 - General Storeroom						
Pillar Packing	Flat AC Sheeting 4059/B00C/R9001/Packing/S19					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1956 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00D/Eaves Linings/S42				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4059/B00D/Gable Verge Lining/S43					
Wall Cladding	Flat AC Sheeting				No Asbestos Detected	
	4059/B00D/Wall Cladding/S44					
Underfloor Voids	Flat AC Sheeting	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00D/Underfloor Voids/S45				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	AC Fragments/Debris	2m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4059/B00D/Underfloor Voids/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - Sports Store

No Asbestos

B00D - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	4059/B00D/R0004/Floor Coverings Res/Textile/S30				No Asbestos Detected	

B00D - R0005 - Clerical Office

No Asbestos

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - Home Base Store

No Asbestos

B00D - R0008 - Special Programs Room

No Asbestos

B00D - R0009 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00D/R0010/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)	

B00D - R0010 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00D/R0010/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)	

B00D - R0011 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Pupil Facilities - 1956 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Eaves Linings	Flat AC Sheeting 4059/B00E/Eaves Linings/S47	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00E - R0001 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 4059/B00E/R0003/Ceiling Structures/Linings/S25	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4059/B00E/R0001/Floor Coverings Res/Textile/S26					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 4059/B00E/R0001/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00E - R0002 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 4059/B00E/R0003/Ceiling Structures/Linings/S25	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 4059/B00E/R0001/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00E - R0003 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting 4059/B00E/R0003/Ceiling Structures/Linings/S25	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 4059/B00E/R0001/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00E - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4059/B00E/R0004/Ceiling Structures/Linings/S24	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	------------	--------------------	---------	---

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1956 - Concrete (Concrete)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

B00F - R0002 - Hall Chair Store

No Asbestos

B00F - R0003 - Hall Chair Store

No Asbestos

B00F - R0004 - Movement

No Asbestos

B00F - R0005 - Hall Chair Store

No Asbestos

B00F - R0006 - Hall Chair Store

No Asbestos

B00F - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1956 - Concrete (Concrete)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids

Interior

B00G - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00G/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00G/R0001/In-fill-panel/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1956 - Concrete (Concrete)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
In-fill-panel	Flat AC Sheeting 4059/B00H/In-fill-panel/S2					No Asbestos Detected

Interior

B00H - R0001 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00H/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 4059/B00H/In-fill-panel/S2					No Asbestos Detected

B00H - R0002 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4059/B00H/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 4059/B00H/In-fill-panel/S2					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1956 - Concrete (Concrete)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
In-fill-panel	Flat AC Sheeting 4059/B001/In-fill-panel/S4					No Asbestos Detected

Interior

B001 - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 4059/B001/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 4059/B001/In-fill-panel/S4					No Asbestos Detected

B001 - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 4059/B001/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Communal Facilities/Other-Community Use - 2006 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - No Access to sub-Floor

Interior

B00J - R0001 - Communal Space

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0002 - Raised Platform

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0003 - External Movement

No Asbestos

B00J - R0004 - Kitchen - Pre

No Asbestos

B00J - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0006 - Disabled Toilet

No Asbestos

B00J - R0007 - Disabled Toilet

No Asbestos

B00J - R0008 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0009 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - Communal Space

No Asbestos

B00K - R0002 - Raised Platform

No Asbestos

B00K - R0003 - Chair Storeroom

No Asbestos

B00K - R0004 - Communal/Performance Store

No Asbestos

B00K - R0005 - P.E. Store

No Asbestos

B00K - R0006 - Toilet - Lobby

No Asbestos

B00K - R0007 - Toilets - Girls

No Asbestos

B00K - R0008 - Sound Cupboard

No Asbestos

B00K - R0009 - Toilet - Lobby

No Asbestos

B00K - R0010 - Toilets - Boys

No Asbestos

B00K - R0011 - No Access

No Asbestos

B00K - R0012 - No Access

No Asbestos

B00K - R0013 - No Access

No Asbestos

B00K - R0014 - Access Shower/Toilet/Change

No Asbestos

B00K - R0015 - Covered Outdoor Learning Area

No Asbestos

B00K - R0016 - Movement

No Asbestos

B00K - R0017 - Movement

No Asbestos

B00K - R0018 - Movement

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 750 - D11502 - Learning Unit - ESL : Placement Date - 16/06/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

OS 602 - D12376 - Learning Unit - Standard With P.A.A. : Placement Date - 16/04/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14702 - Learning Unit - Standard With P.A.A. : Placement Date - 26/02/2010

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D44896 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 16/12/2004

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4059_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017