


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Windsor South Public School (4066)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

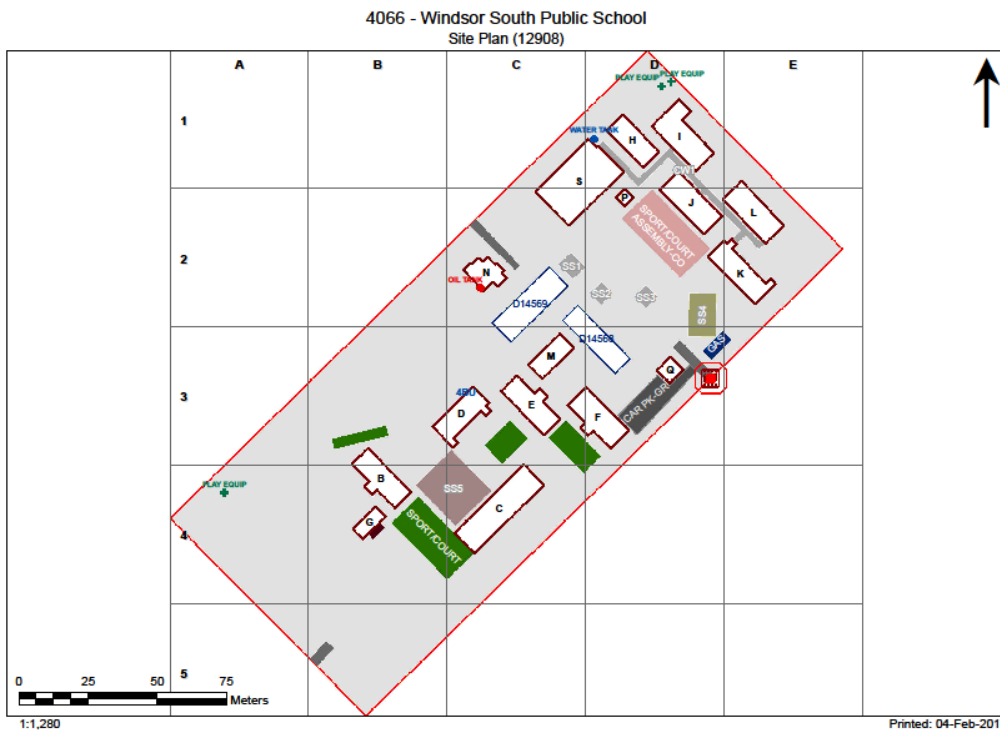

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/Eaves Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4066/B00F/Gable Verge Lining/S23					
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - Manhole padlock is unable to be opened with key					

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Movement

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00B/R0004/Electrical Backing Board/S26				Chrysotile (white asbestos)	

B00B - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00B - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles				No Asbestos Detected	
	4066/B00B/R0006/Floor Coverings Res/Textile/S5					

B00B - R0007 - Personal Effects Storage

No Asbestos

B00B - R0008 - Home Base Store

No Asbestos

B00B - R0009 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4066/B00E/Eaves Linings/S18	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4066/B00F/Gable Verge Lining/S23					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 4066/B00C/In-fill-panel/S3					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No access - No manhole located					

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4066/B00C/R0001/Ceiling Structures/Linings/S4	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	------------	--------------------	---------	---

B00C - R0002 - K.L.A. Store

No Asbestos

B00C - R0003 - Library Office/Workroom

No Asbestos

B00C - R0004 - Reading Area

No Asbestos

B00C - R0005 - P.E. Store

No Asbestos

B00C - R0006 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/Eaves Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4066/B00F/Gable Verge Lining/S23					
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - General Storeroom

No Asbestos

B00D - R0002 - Cleaning Distributed Store

No Asbestos

B00D - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00C/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Personal Effects Storage

No Asbestos

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base

No Asbestos

B00D - R0009 - Home Base Store

No Asbestos

B00D - R0010 - Personal Effects Storage

No Asbestos

B00D - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00C/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1958 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/Eaves Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4066/B00F/Gable Verge Lining/S23					
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4066/B00F/Underfloor Voids/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Practical Activities - 1hb

No Asbestos

B00E - R0004 - Home Base Store

No Asbestos

B00E - R0005 - Personal Effects Storage

No Asbestos

B00E - R0006 - Movement

No Asbestos

B00E - R0007 - Movement

No Asbestos

B00E - R0008 - General Storeroom

No Asbestos

B00E - R0009 - Cleaning Distributed Store

No Asbestos

B00E - R0010 - Personal Effects Storage

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0012 - Home Base

No Asbestos

B00E - R0013 - Practical Activities - 1hb

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 4066/B00F/Eaves Linings/S19					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 4066/B00F/Gable Verge Lining/S23					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4066/B00F/Underfloor Voids/S25	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					

Interior**B00F - R0001 - Home Base**

Chalk Board	Flat AC Sheeting 4066/B00F/R0011/Chalk Board/S2	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-------------	--	-----	------	--------------------	---------	---

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Practical Activities - 1hb

No Asbestos

B00F - R0004 - Staff Room Annexe

No Asbestos

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4066/B00E/R0001/Ceiling Structures/Linings/S1	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00F - R0007 - Interview

No Asbestos

B00F - R0008 - Personal Effects Storage

No Asbestos

B00F - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard - Sealed metal unit
--------------------------	----------------	-----	-------	--------------------	---------	---

B00F - R0010 - Home Base Store

No Asbestos

B00F - R0011 - Home Base

Chalk Board	Flat AC Sheeting 4066/B00F/R0011/Chalk Board/S2	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-------------	--	-----	------	--------------------	---------	---

B00F - R0012 - Practical Activities - 1hb

No Asbestos

B00F - R0013 - Plant

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00G - R0001 - Drinking Facilities

No Asbestos

B00G - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 4066/B00G/R0002/Partition Walls (Cubicles)/S6	No Asbestos Detected
----------------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1958 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4066/B00L/Eaves Linings/S20	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting 4066/B00L/Gable Verge Lining/S24					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - Manhole lock will not open with key					

Interior

B00H - R0001 - Home Base

No Asbestos

B00H - R0002 - Home Base Store

No Asbestos

B00H - R0003 - Personal Effects Storage

No Asbestos

B00H - R0004 - Movement

No Asbestos

B00H - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4066/B00E/R0001/Ceiling Structures/Linings/S1	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00H - R0006 - Home Base

No Asbestos

B00H - R0007 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Support Unit - 1963 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4066/B00L/Eaves Linings/S20	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting 4066/B00L/Gable Verge Lining/S24					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - Manhole lock does not open with key provided					

Interior

B00I - R0001 - Home Base

Wall Linings Internal	Flat AC Sheeting 4066/B00I/R0001/Wall Linings Internal/S11					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00I - R0002 - Personal Effects Storage

No Asbestos

B00I - R0004 - Movement

No Asbestos

B00I - R0008 - Home Base Store - E

No Asbestos

B00I - R0010 - Practical Activities - E

No Asbestos

B00I - R0011 - Home Base - E

No Asbestos

B00I - R0014 - Outdoor Learning Area

No Asbestos

B00I - R0015 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet 4066/B00I/R0015/Partition Walls (Cubicles)/S12	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	--------------------	--------------------	---------	--

B00I - R0016 - Movement

No Asbestos

B00I - R0017 - Toilet - E

No Asbestos

B00I - R0018 - Movement

No Asbestos

B00I - R0019 - Movement

No Asbestos

B00I - R0020 - Cleaning Distributed Store

No Asbestos

B00I - R0021 - Staff Room

Wall Linings Internal	Flat AC Sheeting 4066/B00I/R0021/Wall Linings Internal/S13					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1963 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4066/B00L/Eaves Linings/S20	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting 4066/B00L/Gable Verge Lining/S24					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No manhole located					

Interior

B00J - R0002 - Home Base

No Asbestos

B00J - R0003 - General Storeroom

No Asbestos

B00J - R0004 - Staff Room Annexe

No Asbestos

B00J - R0005 - General Storeroom

No Asbestos

B00J - R0006 - Movement

No Asbestos

B00J - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4066/B00C/R0001/Ceiling Structures/Linings/S4	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	------------	--------------------	---------	---

B00J - R0008 - Personal Effects Storage

No Asbestos

B00J - R0009 - Home Base Store

No Asbestos

B00J - R0010 - Home Base

No Asbestos

B00J - R0011 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1958 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00L/Eaves Linings/S20				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4066/B00L/Gable Verge Lining/S24					
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00C/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00K - R0002 - Movement

No Asbestos

B00K - R0003 - Personal Effects Storage

No Asbestos

B00K - R0004 - Home Base Store

No Asbestos

B00K - R0005 - Home Base

Chalk Board	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00F/R0011/Chalk Board/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00K - R0006 - Home Base

Chalk Board	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00F/R0011/Chalk Board/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00K - R0007 - Practical Activities - 1hb

No Asbestos

B00K - R0008 - Personal Effects Storage

No Asbestos

B00K - R0009 - Toilets - Boys/Girls

No Asbestos

B00K - R0010 - Movement

No Asbestos

B00K - R0011 - General Storeroom

No Asbestos

B00K - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00C/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1963 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00L/Eaves Linings/S20				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting				No Asbestos Detected	
	4066/B00L/Gable Verge Lining/S24					
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No manhole located					

Interior

B00L - R0002 - Toilets - Boys/Girls

No Asbestos

B00L - R0003 - Movement

No Asbestos

B00L - R0004 - Home Base Store

No Asbestos

B00L - R0005 - Personal Effects Storage

No Asbestos

B00L - R0006 - Movement

No Asbestos

B00L - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00C/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00L - R0008 - Home Base

No Asbestos

B00L - R0009 - Practical Activities - 1hb

No Asbestos

B00L - R0010 - Home Base

No Asbestos

B00L - R0011 - Practical Activities - 1hb

No Asbestos

B00L - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00C/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00L - R0013 - Movement

No Asbestos

B00L - R0014 - Personal Effects Storage

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00M - R0001 - Drinking Facilities

No Asbestos

B00M - R0002 - Drinking Facilities

No Asbestos

B00M - R0003 - Drinking Facilities

No Asbestos

B00M - R0004 - No Access

Partition Walls (Cubicles)	Compressed AC Sheet	
4066/B00M/R0004/Partition Walls (Cubicles)/S7		No Asbestos Detected

B00M - R0005 - Garden Store

No Asbestos

B00M - R0006 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Staff Facilities - 1963 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00N/Eaves Linings/S21					Chrysotile (white asbestos)
Wall Cladding	Compressed AC Sheet	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00N/Wall Cladding/S14					Chrysotile (white asbestos)
Ceiling Void	Non Accessible Area - Manhole is sealed shut - No Access					
Underfloor Voids	No Asbestos Found					

Interior

B00N - R0001 - Movement

No Asbestos

B00N - R0002 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00N/R0002/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

B00N - R0003 - Staff Room

No Asbestos

B00N - R0004 - Staff Toilet

No Asbestos

B00N - R0005 - Movement

No Asbestos

B00N - R0006 - Interview

No Asbestos

B00N - R0007 - Uniform Shop

No Asbestos

B00N - R0008 - Movement

No Asbestos

B00N - R0009 - Laundry - Type 2

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 1958 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00P - R0001 - Drinking Facilities

No Asbestos

B00P - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Building Services - 1963 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	12m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00Q/Eaves Linings/S22					Chrysotile (white asbestos)

Interior

B00Q - R0001 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00Q/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)

B00Q - R0002 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00Q/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)

B00Q - R0003 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00Q/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)

B00Q - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4066/B00E/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00S - R0001 - Communal Space

No Asbestos

B00S - R0002 - Raised Platform

No Asbestos

B00S - R0003 - Hall Chair Store

No Asbestos

B00S - R0004 - Communal/Performance Store

No Asbestos

B00S - R0005 - P.E. Store

No Asbestos

B00S - R0006 - Toilet - Lobby

No Asbestos

B00S - R0007 - Toilets - Girls

No Asbestos

B00S - R0008 - Sound Cupboard

No Asbestos

B00S - R0009 - Toilet - Lobby

No Asbestos

B00S - R0010 - Toilets - Boys

No Asbestos

B00S - R0011 - Cleaning Distributed Store

No Asbestos

B00S - R0012 - Plant

No Asbestos

B00S - R0013 - Main Switch Board

No Asbestos

B00S - R0014 - Access Shower/Toilet/Change

No Asbestos

B00S - R0015 - Covered Outdoor Learning Area

No Asbestos

B00S - R0016 - Movement

No Asbestos

B00S - R0017 - Movement

No Asbestos

B00S - R0018 - Ramp

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 501 - D14568 - Admin Staff/Principal/Deputy/Dup/Clinic : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		31.68 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		25 m2

R10 - Staff Toilet

Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2
Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2

R11 - Cleaning Supplies

Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2
---------	---------------	------------------	--	------

R12 - Handicap toilet

Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2
---------	---------------	------------------	--	------

R13 - Clerk

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2

R2 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		12 m2
---------	---------------	------------------	--	-------

R4 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos		12 m2
---------	---------------	------------------	--	-------

R5 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R6 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		58 m2
---------	---------------	------------------	--	-------

R7 - Deputy Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R8 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		20 m2
---------	---------------	------------------	--	-------

R9 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2

NS 311 - D14569 - Shelter/FSU /Communal Area/Store/Toilet : Placement Date - 30/06/1995

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Canteen						
No Asbestos Found.						
R2 - Bulk Store						
No Asbestos Found.						
R3 - Garden Store						
No Asbestos Found.						
R4 - Entry						
No Asbestos Found.						
R5 - Communal Space						
No Asbestos Found.						
R6 - Cleaning Supplies						
No Asbestos Found.						
R7 - Toilets-Boys/Girls						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017