


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** West Pymble Public School (4283)  
**Region :** Northern Sydney  
**State Electorate :** Ku-ring-gai  
**Local Government Area :** Ku-Ring-Gai

**Initial Survey :** Noel Arnold & Associates : 23 - Jan - 2008  
**Reviewed By :** Parsons Brinckerhoff : 09 - Feb - 2017

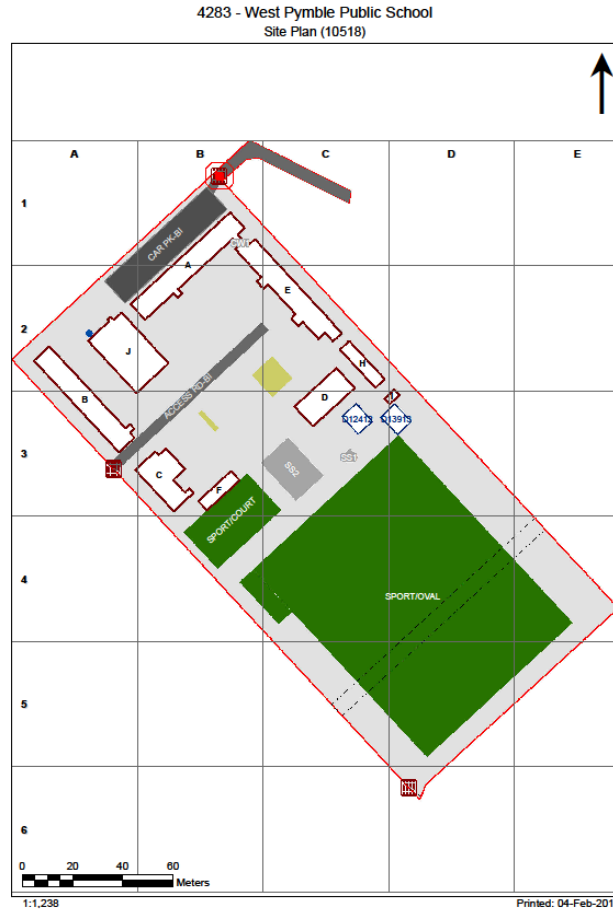

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Gable verge strips	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00A - R0001 - Canteen Office/Store**

No Asbestos

**B00A - R0002 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0004/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0003 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0004/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0004/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0005 - Home Base**

No Asbestos

**B00A - R0006 - Home Base Store**

No Asbestos

**B00A - R0007 - Personal Effects Storage**

No Asbestos

**B00A - R0008 - Movement**

No Asbestos

**B00A - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0004/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0010 - Home Base**

No Asbestos

**B00A - R0011 - Home Base Store**

No Asbestos

**B00A - R0012 - Home Base**

No Asbestos

**B00A - R0013 - General Storeroom**

No Asbestos

**B00A - R0015 - Movement**

No Asbestos

**B00A - R0016 - Uniform Shop**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0017 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0029/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
<b>B00A - R0018 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00A - R0019 - General Storeroom</b>						
No Asbestos						
<b>B00A - R0020 - Staff Room</b>						
No Asbestos						
<b>B00A - R0021 - Clerical Office</b>						
No Asbestos						
<b>B00A - R0023 - Sick Bay</b>						
No Asbestos						
<b>B00A - R0025 - Movement</b>						
No Asbestos						
<b>B00A - R0026 - Handwashing Facilities</b>						
No Asbestos						
<b>B00A - R0029 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0029/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
<b>B00A - R0030 - Main Switch Board</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00A/R0004/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00A - R0031 - Principal</b>						
No Asbestos						
<b>B00A - R0032 - Security Store</b>						
No Asbestos						
<b>B00A - R0033 - Sick Bay</b>						
No Asbestos						
<b>B00A - R0034 - Entry Vestibule</b>						
No Asbestos						
<b>B00A - R0035 - Handwashing Facilities</b>						
No Asbestos						
<b>B00A - R0036 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R0037 - Staff Toilet</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Gable verge strips	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction due to low clearance.					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

**Interior**

**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0004/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

**B00B - R0002 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	16m2	Wall lining to toilet only, not sink area	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00B/R0002/Wall Linings Internal/S4				<b>Chrysotile (white asbestos)</b>		

**B00B - R0003 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Sheet					
4283/B00B/R0003/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>		

**B00B - R0004 - General Storeroom**

No Asbestos

**B00B - R0005 - Handwashing Facilities**

Floor Coverings Res/Textile	Vinyl Sheet					
4283/B00B/R0003/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>		

**B00B - R0006 - Out Of School Hours Care Centre**

No Asbestos

**B00B - R0007 - Out Of School Hours Care Centre**

Floor Coverings Res/Textile	Vinyl Sheet					
4283/B00B/R0003/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>		

**B00B - R0008 - Out Of School Hours Care Centre**

No Asbestos

**B00B - R0009 - Out Of School Hours Care Centre**

No Asbestos

**B00B - R0010 - Out Of School Hours Care Centre**

No Asbestos

**B00B - R0011 - Home Base**

No Asbestos

**B00B - R0012 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Southeast corner adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0003/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B00B - R0013 - Personal Effects Storage**

No Asbestos

**B00B - R0014 - Personal Effects Storage**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	45m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Gable verge strips	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						

**Interior**

**B00C - R0001 - Toilets - Boys/Girls**

Wall Linings Internal	Flat AC Sheeting	16m2	Wall lining to toilet only, not sink area	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00B/R0002/Wall Linings Internal/S4				<b>Chrysotile (white asbestos)</b>		

**B00C - R0002 - Personal Effects Storage**

No Asbestos

**B00C - R0003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Southeast corner adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0003/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B00C - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Ceiling panel outside R0003	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0004/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

**B00C - R0005 - Home Base**

No Asbestos

**B00C - R0006 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0003/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B00C - R0007 - Personal Effects Storage**

No Asbestos

**B00C - R0008 - Movement**

No Asbestos

**B00C - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0004/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

**B00C - R9001 - Sports Store**

No Asbestos

**B00C - R9002 - Kiln Room**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R9002/Ceiling Structures/Linings/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R9003 - Movement**

Wall Linings Internal	Flat AC Sheeting	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R9003/Wall Linings Internal/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Packing to column tops	Flat AC Sheeting	12Unit(s)	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R9003/Packing to column tops/S14					Chrysotile (white asbestos)	
<b>B00C - R9004 - General Storeroom</b>						
Wall Linings Internal	Flat AC Sheeting	8m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R9003/Wall Linings Internal/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Library - 1984 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible &gt;3m.</b>						
Gable verge strips	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Infill panels under windows	Flat AC Sheeting					No Asbestos Detected
4283/B00D/R1002/infill panels under window/S7						No Asbestos Detected

**Interior**

<b>B00D - R0001 - Sports Store</b>						
No Asbestos						
<b>B00D - R0002 - Sports Store</b>						
No Asbestos						
<b>B00D - R0003 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00D - R0004 - Movement</b>						
No Asbestos						
<b>B00D - R0005 - Movement</b>						
infill panels under window	Flat AC Sheeting					No Asbestos Detected
4283/B00D/R1002/infill panels under window/S7						No Asbestos Detected
<b>B00D - R0009 - Stairs</b>						
No Asbestos						
<b>B00D - R0011 - Home Base</b>						
No Asbestos						
<b>B00D - R0012 - Withdrawal - M</b>						
No Asbestos						
<b>B00D - R0013 - Practical Activities - M - 2hb</b>						
No Asbestos						
<b>B00D - R0014 - General Storeroom</b>						
No Asbestos						
<b>B00D - R0015 - General Storeroom</b>						
No Asbestos						
<b>B00D - R0016 - Home Base</b>						
No Asbestos						
<b>B00D - R1001 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00D - R1002 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Ceiling over balcony	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00D/R1002/Ceiling Structures/Linings/S6						<b>Chrysotile (white asbestos)</b>
infill panels under window	Flat AC Sheeting					No Asbestos Detected
4283/B00D/R1002/infill panels under window/S7						No Asbestos Detected
<b>B00D - R1003 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00D - R1004 - Home Base</b>						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R1005 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
4283/B00D/R1005/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>	
<b>B00D - R1006 - Personal Effects Storage</b>						
No Asbestos						
<b>B00D - R1007 - Special Programs Room</b>						
No Asbestos						
<b>B00D - R1008 - Computer Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
4283/B00D/R1005/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>	
<b>B00D - R1009 - Stairs</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Communal Facilities/General Learning - 1984 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Gable verge strips	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Underfloor Voids	Flat AC Sheeting	NA	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
<b>Assumed Asbestos - Could not be sampled due to storage.</b>						

**Interior****B00E - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0004/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

**B00E - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0004/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

**B00E - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00C/R0004/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

**B00E - R0012 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
4283/B00E/R0012/Ceiling Structures/Linings/S10				<b>No Asbestos Detected</b>		

**B00E - R0013 - Disabled Toilet**

No Asbestos

**B00E - R0014 - General Storeroom**

No Asbestos

**B00E - R0015 - General Storeroom**

No Asbestos

**B00E - R0016 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					
4283/B00B/R0003/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>		
Electrical Mounting Board	Flat AC Sheeting	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4283/B00E/R0016/Electrical Mounting Board/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0017 - Duplicating Workroom**

No Asbestos

**B00E - R0018 - Security Store**

No Asbestos

**B00E - R0019 - Security Store**

No Asbestos

**B00E - R0020 - Library Office/Workroom**

No Asbestos

**B00E - R0021 - Movement**

No Asbestos

**B00E - R0022 - Library Office/Workroom**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R0023 - Communications Room</b>						
No Asbestos						
<b>B00E - R0024 - Reading Area</b>						
No Asbestos						
<b>B00E - R9001 - General Assistant/Bulk Store</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1992 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Ceiling Voids	No Asbestos Found					

**Interior**

**B00F - R0001 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
		4283/B00F/R0001/Partition Walls (Cubicles)/S1				

**B00F - R0002 - Drinking Facilities**

No Asbestos

**B00F - R0003 - Drinking Facilities**

No Asbestos

**B00F - R0004 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
		4283/B00F/R0001/Partition Walls (Cubicles)/S1				

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 1984 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Height Restriction >3m.**

**Interior**

**B00H - R0001 - Drinking Facilities**

No Asbestos

**B00H - R0002 - Toilets - Girls**

No Asbestos

**B00H - R0003 - Cleaning Distributed Store**

No Asbestos

**B00H - R0004 - Garden Store**

No Asbestos

**B00H - R0005 - Toilets - Boys**

No Asbestos

**B00H - R0006 - Drinking Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Building Services - 1984 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B001 - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00J - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00J - R0001 - Covered Outdoor Learning Area**

No Asbestos

**B00J - R0002 - Communal Space**

No Asbestos

**B00J - R0003 - Raised Platform**

No Asbestos

**B00J - R0004 - Chair Storeroom**

No Asbestos

**B00J - R0005 - Communal/Performance Store**

No Asbestos

**B00J - R0006 - P.E. Store**

No Asbestos

**B00J - R0007 - Toilet - Lobby**

No Asbestos

**B00J - R0008 - Toilets - Girls**

No Asbestos

**B00J - R0009 - Sound Cupboard**

No Asbestos

**B00J - R0010 - Toilets - Boys**

No Asbestos

**B00J - R0011 - Toilet - Lobby**

No Asbestos

**B00J - R0012 - Cleaning Distributed Store**

No Asbestos

**B00J - R0013 - Main Switch Board**

No Asbestos

**B00J - R0014 - Toilet - P**

No Asbestos

**B00J - R0015 - Plant**

No Asbestos

**B00J - R0016 - External Movement**

No Asbestos

**B00J - R0017 - Movement**

No Asbestos

**B00J - R0018 - Ramp**

No Asbestos

**B00J - R0019 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D12412 - Learning Unit - Standard/Withdrawal : Placement Date - 26/10/2007**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - General Learning Space**

No Asbestos Found.

**R3 - Store**

No Asbestos Found.

**OS 601 - D13913 - Learning Unit - Standard/Withdrawal : Placement Date - 3/06/2003**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 602 - D18228 - Learning Unit - Standard With P.A.A. : Placement Date - 12/01/2017**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017