


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Weilmoringle Public School (4305)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Brewarrina

Initial Survey : Noel Arnold & Associates : 03 - May - 2008
Reviewed By : Greencap-NAA : 15 - Jun - 2016

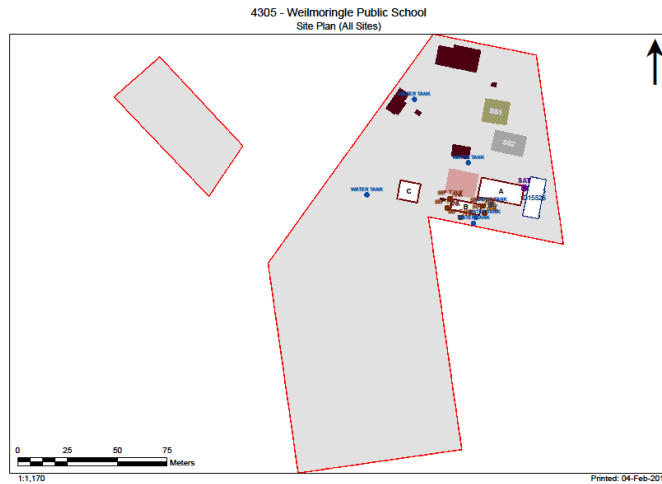

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/General Learning - 1962 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 4305/B00A/R1001/Floor Coverings Res/Textile/S1					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 4305/B00A/Wall Cladding/S7	8m2	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Pitched Roof - Flat ceiling	Non Accessible Area - Height restricted 4 m high					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting 4305/B00A/R0002/Ceiling Structures/Linings/S5	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4305/B00A/R0002/Wall Linings Internal/S6	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Plant

Ceiling Structures/Linings	Flat AC Sheeting 4305/B00A/R0002/Ceiling Structures/Linings/S5	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4305/B00A/R0002/Wall Linings Internal/S6	30m2	South	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0003 - Special Programs Room

Splashback lining	Vinyl Tiles 4305/B00A/R0003/Splashback/S8	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board 4305/B00A/R0003/Electrical Backing Board/S19	1m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4305/B00A/R0002/Ceiling Structures/Linings/S5	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0004 - Reading Area

Ceiling Structures/Linings	Flat AC Sheeting 4305/B00A/R0002/Ceiling Structures/Linings/S5	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4305/B00A/R0004/Wall Linings Internal/S9	20m2	South	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0005 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 4305/B00A/R0002/Ceiling Structures/Linings/S5	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 4305/B00A/R1005/Floor Coverings Res/Textile/S17					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 4305/B00A/R1005/Floor Coverings Res/Textile/S18					No Asbestos Detected

B00A - R0006 - Plant

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4305/B00A/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00A - R1001 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4305/B00A/R1001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
4305/B00A/R1001/Floor Coverings Res/Textile/S1					No Asbestos Detected	
B00A - R1002 - Staff Room						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4305/B00A/R1001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
4305/B00A/R1002/Floor Coverings Res/Textile/S15					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
4305/B00A/R1002/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00A - R1003 - Clerical Office						
No Asbestos						
B00A - R1004 - Principal						
No Asbestos						
B00A - R1005 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet					
4305/B00A/R1005/Floor Coverings Res/Textile/S17					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
4305/B00A/R1005/Floor Coverings Res/Textile/S18					No Asbestos Detected	
B00A - R1006 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
4305/B00A/R1005/Floor Coverings Res/Textile/S17					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
4305/B00A/R1005/Floor Coverings Res/Textile/S18					No Asbestos Detected	
B00A - R1007 - Home Base						
Heater Surround	Flat AC Sheeting	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4305/B00A/R1007/Board around heater/S4					Chrysotile (white asbestos)	
B00A - R1008 - Home Base						
Heater Surround	Flat AC Sheeting	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4305/B00A/R1007/Board around heater/S4					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Staff Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4305/B00B/Eaves Linings/S12					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole					

Interior

B00B - R0001 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4305/B00A/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

B00B - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4305/B00B/R0002/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4305/B00B/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00B - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4305/B00B/R0002/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4305/B00B/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00B - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4305/B00B/R0002/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00C - R0001 - Home Base

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Practical Activities - 1hb

No Asbestos

B00C - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Old School Building

Exterior

Eaves Linings	Flat AC Sheeting 4305/B00D/Eaves Linings/S13	20m	North & South	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	Low (1)	Low Priority (2-3)
Wall Cladding	Flat AC Sheeting 4305/B00D/Wall Cladding/S14	120m2	Variable positions	Some Damage - Unsealed (3) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Medium Priority (4-5)

Interior

B00D - DR0001 - Interior

Non Accessible

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 809 - D15526 - FSU/Shelter/Stores : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

Interior

R1 - Canteen/food service

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				28 m2

R2 - Covered Area/shelter

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				110 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
---------	---------------	------------------	--	--	--	------

R4 - Change Room

Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
---------	---------------	------------------	--	--	--	------

R5 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
---------	---------------	------------------	--	--	--	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017