


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Walters Road Public School (4310)  
**Region :** Western Sydney  
**State Electorate :** Blacktown  
**Local Government Area :** Blacktown

**Initial Survey :** Noel Arnold & Associates : 19 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

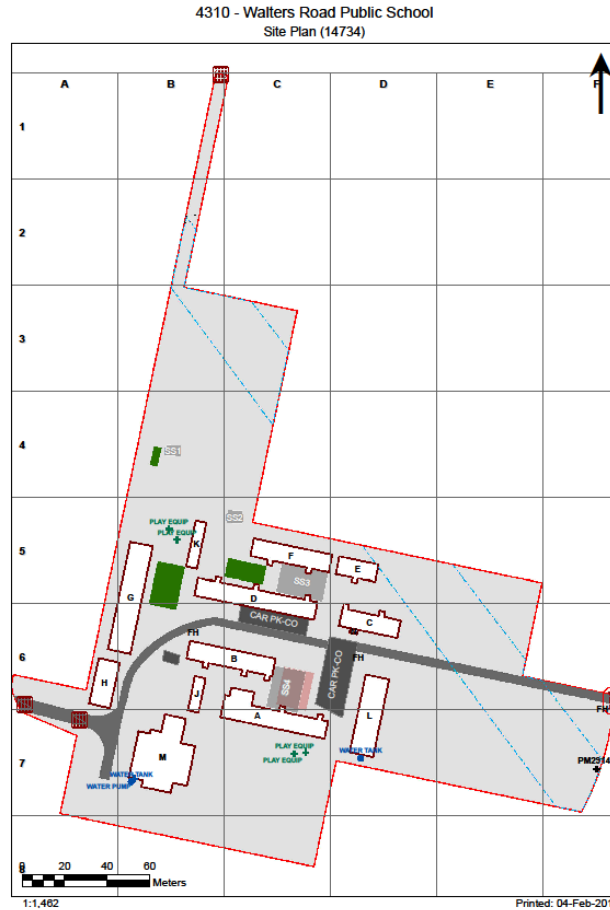

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - General Learning - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Gable Ends	Compressed AC Sheet 4310/B00A/Gable Ends/S43	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Eaves Linings	Compressed AC Sheet 4310/B00C/Eaves Linings/S39	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Underfloor Voids	Flat AC Sheeting 4310/B00A/Underfloor Voids/S44					<b>No Asbestos Detected</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4310/B00A/Underfloor Voids/S46	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**Interior**

**B00A - R0001 - Staff Room Annexe (17.33 m2)**

No Asbestos

**B00A - R0002 - Staff Toilet (3.11 m2)**

Wall Linings Internal	Compressed AC Sheet 4310/B00A/R0002/Wall Linings Internal/S6	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Floor Coverings Res/Textile	Textile 4310/B00A/R0002/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>

**B00A - R0003 - Movement (12.65 m2)**

No Asbestos

**B00A - R0004 - Personal Effects Storage (6.39 m2)**

No Asbestos

**B00A - R0005 - General Storeroom (10 m2)**

No Asbestos

**B00A - R0006 - External Movement (4.81 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00A/R0006/Ceiling Structures/Linings/S3	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Clerical Error - No Sample Taken</b>		

**B00A - R0007 - Home Base (56.39 m2)**

No Asbestos

**B00A - R0008 - Home Base Store (3.93 m2)**

No Asbestos

**B00A - R0009 - Home Base (56.31 m2)**

No Asbestos

**B00A - R0010 - Home Base Store (3.84 m2)**

No Asbestos

**B00A - R0011 - Personal Effects Storage (6.38 m2)**

No Asbestos

**B00A - R0012 - Movement (12.91 m2)**

No Asbestos

**B00A - R0013 - External Movement (4.79 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Compressed AC Sheet	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00A/R0023/Ceiling Structures/Linings/S37				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R0014 - Staff Room (21.05 m2)</b>						
No Asbestos						
<b>B00A - R0015 - Personal Effects Storage (6.47 m2)</b>						
No Asbestos						
<b>B00A - R0016 - Home Base Store (3.63 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Practical Activities - 1hb (56.32 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Home Base (77.75 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Home Base Store (3.08 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Toilets - Boys/Girls (1.61 m2)</b>						
Wall Linings Internal	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00A/R0002/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Textile					
4310/B00A/R0002/Floor Coverings Res/Textile/S2				No Asbestos Detected		
<b>B00A - R0021 - Personal Effects Storage (10.92 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Movement (4.82 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Outdoor Learning Area (72.28 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00A/R0023/Ceiling Structures/Linings/S37				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Infill above door	Compressed AC Sheet	0.5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00A/R0023/Infill above door/S38				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R9001 - General Storeroom (39.41 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00A/R9001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R9002 - Sports Store (11.55 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00A/R9001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Compressed AC Sheet					
4310/B00A/R9002/Wall Linings Internal/S8				No Asbestos Detected		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Administration - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Gable Ends	Compressed AC Sheet 4310/B00C/Gable Ends/S42	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Eaves Linings	Compressed AC Sheet 4310/B00C/Eaves Linings/S39	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	Flat AC Sheeting 4310/B00B/Underfloor Voids/S45					<b>No Asbestos Detected</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4310/B00B/Underfloor Voids/S47	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**Interior**

**B00B - R0001 - Cleaning Distributed Store (1.57 m2)**

No Asbestos

**B00B - R0002 - Duplicating Workroom (21.56 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 4310/B00B/R0002/Floor Coverings Res/Textile/S36					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00B - R0003 - Movement (4.78 m2)**

No Asbestos

**B00B - R0004 - External Movement (4.86 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00B/R0004/Ceiling Structures/Linings/S5	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Infill above door	Compressed AC Sheet 4310/B00B/R0004/Infill above door/S35	0.5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Home Base (56.53 m2)**

No Asbestos

**B00B - R0006 - Home Base Store (3.7 m2)**

No Asbestos

**B00B - R0007 - Personal Effects Storage (6.33 m2)**

No Asbestos

**B00B - R0008 - Movement (6.37 m2)**

No Asbestos

**B00B - R0009 - External Movement (4.86 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00B/R0004/Ceiling Structures/Linings/S5	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Infill above door	Compressed AC Sheet 4310/B00B/R0004/Infill above door/S35	0.5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**B00B - R0010 - Personal Effects Storage (6.4 m2)**

No Asbestos

**B00B - R0011 - Home Base Store (3.72 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00B - R0012 - Home Base (56.71 m2)</b>						
No Asbestos						
<b>B00B - R0013 - Home Base (56.71 m2)</b>						
No Asbestos						
<b>B00B - R0014 - Home Base Store (4.86 m2)</b>						
No Asbestos						
<b>B00B - R0015 - Personal Effects Storage (10.19 m2)</b>						
No Asbestos						
<b>B00B - R0016 - Movement (6.46 m2)</b>						
No Asbestos						
<b>B00B - R0017 - External Movement (4.51 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00B/R0004/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Infill above door	Compressed AC Sheet	0.5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00B/R0004/Infill above door/S35				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0018 - Home Base (56.71 m2)</b>						
No Asbestos						
<b>B00B - R0019 - Home Base Store (4.86 m2)</b>						
No Asbestos						
<b>B00B - R9001 - Community Clinic (21.89 m2)</b>						
No Asbestos						
<b>B00B - R9002 - Community Clinic (3.05 m2)</b>						
No Asbestos						
<b>B00B - R9003 - Community Clinic (3.11 m2)</b>						
No Asbestos						
<b>B00B - R9004 - Community Clinic (22.32 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Gable Ends	Compressed AC Sheet 4310/B00C/Gable Ends/S42	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Eaves Linings	Compressed AC Sheet 4310/B00C/Eaves Linings/S39	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4310/B00C/Underfloor Voids/S48					<b>No Asbestos Detected</b>

**Interior**

**B00C - R0001 - Home Base (56.69 m2)**

No Asbestos

**B00C - R0002 - Home Base Store (5.03 m2)**

No Asbestos

**B00C - R0003 - Personal Effects Storage (16.87 m2)**

No Asbestos

**B00C - R0004 - External Movement (4.45 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00C/R0004/Ceiling Structures/Linings/S32	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Infill above door	Compressed AC Sheet 4310/B00C/R0004/Infill above door/S33	0.5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00C - R0005 - Home Base (56.46 m2)**

No Asbestos

**B00C - R0006 - Home Base Store (5.03 m2)**

No Asbestos

**B00C - R0007 - Home Base (56.38 m2)**

No Asbestos

**B00C - R0008 - Home Base Store (5.19 m2)**

No Asbestos

**B00C - R0009 - Personal Effects Storage (4.2 m2)**

No Asbestos

**B00C - R0010 - Movement (3.01 m2)**

No Asbestos

**B00C - R0011 - External Movement (4.92 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00C/R0004/Ceiling Structures/Linings/S32	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Infill above door	Compressed AC Sheet 4310/B00C/R0004/Infill above door/S33	0.5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration/Staff Facilities - 1963 - Brick/Block (Brick/Block)****Exterior**

Gable Ends	Compressed AC Sheet 4310/B00C/Gable Ends/S42	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Eaves Linings	Compressed AC Sheet 4310/B00C/Eaves Linings/S39	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	No Asbestos Found					

**Interior****B00D - R0001 - Principal (20.87 m2)**

Infill panel to window	Compressed AC Sheet 4310/B00D/R0009/Infill panel to window/S26					<b>No Asbestos Detected</b>
------------------------	---	--	--	--	--	-----------------------------

**B00D - R0002 - Sick Bay (8.55 m2)**

No Asbestos

**B00D - R0003 - Clerical Office (15.96 m2)**

No Asbestos

**B00D - R0004 - General Storeroom (10.17 m2)**

No Asbestos

**B00D - R0005 - Staff Toilet (5.27 m2)**

Wall Linings Internal	Compressed AC Sheet 4310/B00D/R0006/Wall Linings Internal/S28	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0006 - Staff Toilet (5.27 m2)**

Wall Linings Internal	Compressed AC Sheet 4310/B00D/R0006/Wall Linings Internal/S28	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0007 - Cleaning Distributed Store (0.85 m2)**

Non Accessible

**B00D - R0008 - Cleaning Distributed Store (20.9 m2)**

Infill panel to window	Compressed AC Sheet 4310/B00D/R0009/Infill panel to window/S26					<b>No Asbestos Detected</b>
------------------------	---	--	--	--	--	-----------------------------

**B00D - R0009 - Staff Room (56.54 m2)**

Infill panel to window	Compressed AC Sheet 4310/B00D/R0009/Infill panel to window/S26					<b>No Asbestos Detected</b>
------------------------	---	--	--	--	--	-----------------------------

**B00D - R0010 - Movement (25.6 m2)**

No Asbestos

**B00D - R0011 - Entry Vestibule (28.08 m2)**

No Asbestos

**B00D - R0012 - External Movement (3.88 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00D/R0017/Ceiling Structures/Linings/S27	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Infill above door	Compressed AC Sheet 4310/B00D/R0012/Infill above door/S34	0.5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**B00D - R0013 - Deputy Principal (8.75 m2)**

No Asbestos

**B00D - R0014 - General Storeroom (6.34 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R0015 - General Storeroom (7.36 m2)</b>						
No Asbestos						
<b>B00D - R0016 - Movement (6.48 m2)</b>						
No Asbestos						
<b>B00D - R0017 - External Movement (4.88 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R0017/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos)</b>	
Infill above door	Compressed AC Sheet	0.5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R0012/Infill above door/S34				<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0018 - General Storeroom (6.34 m2)</b>						
No Asbestos						
<b>B00D - R0019 - Communal Space (113.48 m2)</b>						
No Asbestos						
<b>B00D - R0020 - General Storeroom (6.16 m2)</b>						
No Asbestos						
<b>B00D - R0021 - General Storeroom (7.42 m2)</b>						
No Asbestos						
<b>B00D - R0022 - Movement (6.46 m2)</b>						
No Asbestos						
<b>B00D - R0023 - External Movement (4.81 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R0017/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos)</b>	
Infill above door	Compressed AC Sheet	0.5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R0012/Infill above door/S34				<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0024 - Home Base (57 m2)</b>						
No Asbestos						
<b>B00D - R0025 - Home Base Store (6.15 m2)</b>						
No Asbestos						
<b>B00D - R9001 - General Assistant/Bulk Store (27.05 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R9002/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Compressed AC Sheet	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R9002/Wall Linings Internal/S20				<b>Chrysotile (white asbestos)</b>	
Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R9001/Electrical Mounting Board/S25				<b>Chrysotile (white asbestos)</b>	
<b>B00D - R9002 - Garden Store (27.13 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R9002/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Compressed AC Sheet	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00D/R9002/Wall Linings Internal/S20				<b>Chrysotile (white asbestos)</b>	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Gable Ends	Compressed AC Sheet 4310/B00C/Gable Ends/S42	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Eaves Linings	Compressed AC Sheet 4310/B00C/Eaves Linings/S39	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4310/B00E/Underfloor Voids/S49	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**Interior**

**B00E - R0001 - Home Base (57.21 m2)**

No Asbestos

**B00E - R0002 - Home Base Store (4.14 m2)**

No Asbestos

**B00E - R0003 - Personal Effects Storage (19.15 m2)**

No Asbestos

**B00E - R0004 - External Movement (4.51 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00E/R0004/Ceiling Structures/Linings/S30	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Infill above door	Compressed AC Sheet 4310/B00E/R0004/Infill above door/S31	0.5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0005 - Home Base (57.43 m2)**

No Asbestos

**B00E - R0006 - Home Base Store (4.14 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Gable Ends	Compressed AC Sheet 4310/B00C/Gable Ends/S42	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Eaves Linings	Compressed AC Sheet 4310/B00F/Eaves Linings/S40	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - No key fits lock on site					

**Interior**

**B00F - R0001 - Home Base (57.13 m2)**

No Asbestos

**B00F - R0002 - Home Base Store (6 m2)**

No Asbestos

**B00F - R0003 - Personal Effects Storage (8.4 m2)**

No Asbestos

**B00F - R0004 - Movement (6.3 m2)**

No Asbestos

**B00F - R0005 - External Movement (4.49 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00F/R0005/Ceiling Structures/Linings/S29	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0006 - Home Base (57.07 m2)**

No Asbestos

**B00F - R0007 - Home Base Store (5.95 m2)**

No Asbestos

**B00F - R0008 - Home Base (57.31 m2)**

No Asbestos

**B00F - R0009 - Home Base Store (5.42 m2)**

No Asbestos

**B00F - R0010 - Personal Effects Storage (10.19 m2)**

No Asbestos

**B00F - R0011 - Movement (6.3 m2)**

No Asbestos

**B00F - R0012 - External Movement (4.44 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 4310/B00F/R0005/Ceiling Structures/Linings/S29	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0013 - Home Base (57.7 m2)**

No Asbestos

**B00F - R0014 - Home Base Store (5.42 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Ends	Compressed AC Sheet	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00C/Gable Ends/S42			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Eaves Linings	Compressed AC Sheet	40m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00C/Eaves Linings/S39			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Wall Cladding	Compressed AC Sheet	40m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00G/R1007/Wall Linings Internal/S14			<b>Chrysotile (white asbestos)</b>		
Ceiling Void	No Asbestos Found					

**Interior**

**B00G - R0001 - Toilets - Girls (22.99 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	23m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4310/B00G/R0001/Partition Walls (Cubicles)/S10			<b>Clerical Error - No Sample Taken</b>		
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11			<b>Limited Samples Taken</b>		
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00G - R0002 - Cleaning Distributed Store (2.31 m2)**

Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11			<b>Limited Samples Taken</b>		
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00G - R0003 - External Movement (97.65 m2)**

Wall Linings Internal	Compressed AC Sheet	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00G/R1007/Wall Linings Internal/S14			<b>Chrysotile (white asbestos)</b>		

**B00G - R0004 - Toilets - Boys (25.78 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4310/B00G/R0001/Partition Walls (Cubicles)/S9			<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11			<b>Limited Samples Taken</b>		
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00G - R0005 - Security Store (5.38 m2)**

No Asbestos

**B00G - R0006 - General Storeroom (12.46 m2)**

No Asbestos

**B00G - R0007 - Home Base (57.19 m2)**

Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11			<b>Limited Samples Taken</b>		
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00G - R0008 - Home Base Store (6.59 m2)**

Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11			<b>Limited Samples Taken</b>		
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00G - R0009 - Personal Effects Storage (13.77 m2)**

Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11			<b>Limited Samples Taken</b>		
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Emerald floor tiles					
	4310/B00G/R0009/Floor Coverings Res/Textile/S15				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Mottled floor tiles					
	4310/B00G/R0009/Floor Coverings Res/Textile/S16				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Green floor tiles	13m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00G/R0009/Floor Coverings Res/Textile/S17				<b>Chrysotile (white asbestos)</b>	
<b>B00G - R0010 - Home Base (56.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0011 - Home Base Store (6.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0012 - Home Base (56.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0013 - Home Base Store (6.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0014 - Personal Effects Storage (13.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Mottled floor tiles	14m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00G/R0009/Floor Coverings Res/Textile/S17				<b>Chrysotile (white asbestos)</b>	
<b>B00G - R0015 - Distribution Board (0.25 m2)</b>						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0015/Ceiling Structures/Linings/S52				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0016 - Home Base (56.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0017 - Home Base Store (6.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4310/B00G/R0001/Ceiling Structures/Linings/S11				<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R0018 - Movement (6.53 m2)</b>						
No Asbestos						
<b>B00G - R0019 - Sports Store (13.5 m2)</b>						
No Asbestos						
<b>B00G - R0020 - Stairs (7.02 m2)</b>						
No Asbestos						
<b>B00G - R0021 - Stairs (6.97 m2)</b>						
No Asbestos						
<b>B00G - R1001 - Interview (28.16 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R1002 - Staff Toilet (4.31 m2)</b>						
No Asbestos						
<b>B00G - R1003 - Staff Toilet (4.3 m2)</b>						
No Asbestos						
<b>B00G - R1004 - Movement (4.55 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
4310/B00G/R1004/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>	
<b>B00G - R1005 - General Assistant/Bulk Store (13.84 m2)</b>						
No Asbestos						
<b>B00G - R1006 - General Storeroom (8.19 m2)</b>						
No Asbestos						
<b>B00G - R1007 - Movement (121.25 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	122m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00G/R1007/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Compressed AC Sheet	30m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00G/R1007/Wall Linings Internal/S14					<b>Chrysotile (white asbestos)</b>	
<b>B00G - R1008 - Movement (6.39 m2)</b>						
No Asbestos						
<b>B00G - R1009 - Library Office/Workroom (21.11 m2)</b>						
No Asbestos						
<b>B00G - R1010 - Reading Area (114.3 m2)</b>						
No Asbestos						
<b>B00G - R1011 - Home Base (56.48 m2)</b>						
No Asbestos						
<b>B00G - R1012 - Home Base Store (6.67 m2)</b>						
No Asbestos						
<b>B00G - R1013 - Personal Effects Storage (13.39 m2)</b>						
No Asbestos						
<b>B00G - R1014 - Distribution Board (0.34 m2)</b>				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles					
4310/B00G/R1004/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>	
<b>B00G - R1015 - Home Base (56.87 m2)</b>						
No Asbestos						
<b>B00G - R1016 - Home Base Store (6.75 m2)</b>						
No Asbestos						
<b>B00G - R1017 - General Assistant/Bulk Store (8.16 m2)</b>						
No Asbestos						
<b>B00G - R1018 - Stairs (6.63 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00G/R1018/Ceiling Structures/Linings/S51					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
<b>B00G - R1019 - Stairs (6.63 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4310/B00G/R1018/Ceiling Structures/Linings/S51					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Pupil Facilities - 1968 - Timber (Timber)**

**Exterior**

Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4310/B00H/Underfloor Voids/S50			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	No Asbestos Found					

**Interior**

**B00H - R0001 - External Movement (38.49 m2)**

No Asbestos

**B00H - R0002 - General Storeroom (11.04 m2)**

No Asbestos

**B00H - R0003 - Home Base (52.78 m2)**

No Asbestos

**B00H - R0004 - Uniform Shop (51.16 m2)**

No Asbestos

**B00H - R0005 - No Access (51.19 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Compressed AC Sheet	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00J/Eaves Linings/S41			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Voids - Flat Roof	No Asbestos Found					

**Interior**

**B00J - R0001 - Drinking Facilities (8.29 m2)**

No Asbestos

**B00J - R0002 - Toilets - Boys (28.71 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00J/R0002/Partition Walls (Cubicles)/S4			<b>Chrysotile (white asbestos)</b>		

**B00J - R0003 - Toilets - Girls (24.57 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00J/R0002/Partition Walls (Cubicles)/S4			<b>Chrysotile (white asbestos)</b>		

**B00J - R0004 - Drinking Facilities (8.29 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities/Building Services - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Compressed AC Sheet	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4310/B00J/Eaves Linings/S41			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**Interior**

**B00K - R0001 - Drinking Facilities (8.26 m2)**

No Asbestos

**B00K - R0002 - Toilets - Boys (32.9 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4310/B00K/R0002/Partition Walls (Cubicles)/S18				<b>No Asbestos Detected</b>
----------------------------	---------------------	--	--	--	--	-----------------------------

**B00K - R0003 - Cleaning Supplies (5.98 m2)**

No Asbestos

**B00K - R0004 - Toilets - Girls (32.85 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4310/B00K/R0002/Partition Walls (Cubicles)/S18				<b>No Asbestos Detected</b>
----------------------------	---------------------	--	--	--	--	-----------------------------

**B00K - R0005 - Drinking Facilities (8.23 m2)**

No Asbestos

**B00K - R0006 - General Storeroom (5.95 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Administration - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior**

**B00L - R0001 - Entry Vestibule (24.11 m2)**

No Asbestos

**B00L - R0002 - Interview (13.09 m2)**

No Asbestos

**B00L - R0003 - Principal (17.08 m2)**

No Asbestos

**B00L - R0004 - Deputy Principal (12.86 m2)**

No Asbestos

**B00L - R0005 - Staff Room (63.86 m2)**

No Asbestos

**B00L - R0006 - Staff Room (27.15 m2)**

No Asbestos

**B00L - R0007 - Security Store (14.07 m2)**

No Asbestos

**B00L - R0008 - Interview (17 m2)**

No Asbestos

**B00L - R0009 - Staff Toilet (5.17 m2)**

No Asbestos

**B00L - R0010 - Staff Toilet (5.17 m2)**

No Asbestos

**B00L - R0011 - Staff Toilet (5.17 m2)**

No Asbestos

**B00L - R0012 - Cleaning Distributed Store (4.2 m2)**

No Asbestos

**B00L - R0013 - Disabled Shower/Toilet (5.22 m2)**

No Asbestos

**B00L - R0014 - Sick Bay (8.92 m2)**

No Asbestos

**B00L - R0015 - Clerical Office (33.71 m2)**

No Asbestos

**B00L - R0016 - External Movement (7.14 m2)**

No Asbestos

**B00L - R0017 - External Movement (6.1 m2)**

No Asbestos

**B00L - R0018 - Clerical Office (23.92 m2)**

No Asbestos

**B00L - R0019 - Deputy Principal (12.9 m2)**

No Asbestos

**B00L - R0020 - Movement (66.62 m2)**

No Asbestos

**B00L - R0021 - Plant (1.99 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Communal Facilities/Other - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior**

**B00M - R0001 - Communal Space (203.38 m2)**

No Asbestos

**B00M - R0002 - Raised Platform (61.58 m2)**

No Asbestos

**B00M - R0003 - Sound Cupboard (2.69 m2)**

No Asbestos

**B00M - R0004 - Access Shower/Toilet (7.02 m2)**

No Asbestos

**B00M - R0005 - Toilets - Girls (10.24 m2)**

No Asbestos

**B00M - R0006 - Garden Store (11.69 m2)**

No Asbestos

**B00M - R0007 - Other (1.98 m2)**

No Asbestos

**B00M - R0008 - Hall Chair Store (11.19 m2)**

No Asbestos

**B00M - R0009 - Distribution Board (3 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00M - R0010 - Communal/Performance Store (17.41 m2)**

No Asbestos

**B00M - R0011 - Cleaning Distributed Store (3.62 m2)**

No Asbestos

**B00M - R0012 - P.E. Store (16.53 m2)**

No Asbestos

**B00M - R0013 - Toilets - Boys (7.36 m2)**

No Asbestos

**B00M - R0014 - Canteen (43.88 m2)**

No Asbestos

**B00M - R0015 - Canteen Office/Store (10.49 m2)**

No Asbestos

**B00M - R0016 - Canteen Covered Area (33.97 m2)**

No Asbestos

**B00M - R0017 - Covered Outdoor Learning Area (187 m2)**

No Asbestos

**B00M - R0018 - External Movement (13.75 m2)**

No Asbestos

**B00M - R0019 - Toilet - Lobby (3.71 m2)**

No Asbestos

**B00M - R0020 - Movement (2.5 m2)**

No Asbestos

**B00M - R0021 - External Movement (5.42 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00M - R0022 - External Movement (7.11 m2)</b>						
No Asbestos						
<b>B00M - R0023 - Movement (7.66 m2)</b>						
No Asbestos						
<b>B00M - R0024 - Movement (11.42 m2)</b>						
No Asbestos						
<b>B00M - R0025 - Movement (13.26 m2)</b>						
No Asbestos						
<b>B00M - R0026 - Movement (2.3 m2)</b>						
No Asbestos						
<b>B00M - R0027 - External Movement (5.22 m2)</b>						
No Asbestos						
<b>B00M - R0028 - Toilet - Lobby (1.91 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Electrical Services - 2010 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00N - R0001 - Main Switch Board (5.39 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017