


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Whalan Public School (4378)  
**Region :** Western Sydney  
**State Electorate :** Londonderry  
**Local Government Area :** Blacktown

**Initial Survey :** Noel Arnold & Associates : 02 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 07 - Feb - 2017

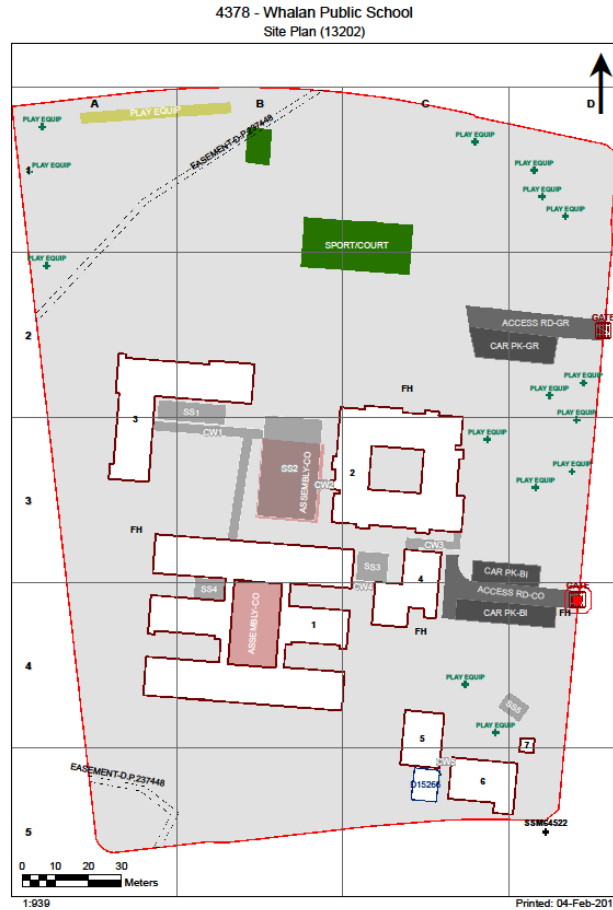

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - General Learning/Library - 1966 - Brick/Block (Brick/Block)****Exterior**

Wall Cladding	Flat AC Sheeting 4378/B001/Wall Cladding/S25					<b>No Asbestos Detected</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Under floor void	No Asbestos Found					

**Interior****B001 - R0003 - External Movement (499.95 m2)**

No Asbestos

**B001 - R0004 - External Movement (73.13 m2)**

No Asbestos

**B001 - R0005 - Home Base (58.07 m2)**

No Asbestos

**B001 - R0006 - Personal Effects Storage (8.08 m2)**

No Asbestos

**B001 - R0007 - Home Base Store (6 m2)**

No Asbestos

**B001 - R0008 - Personal Effects Storage (7.98 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B001 - R0009 - Home Base Store (5.92 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B001 - R0010 - Home Base (57.43 m2)**

No Asbestos

**B001 - R0011 - Home Base (57.43 m2)**

No Asbestos

**B001 - R0012 - Personal Effects Storage (7.98 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B001 - R0013 - Home Base Store (5.66 m2)**

No Asbestos

**B001 - R0014 - Distribution Board (0.25 m2)**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B001/R0032/Wall Linings Internal/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0015 - Toilets - Girls (42.31 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B001/R0017/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0016 - Plant (7.27 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Toilet Cistern	Fibre Cement Casting (Monocrete) 4378/B001/R0016/Cistern/S5	12Unit(s)	East, West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R0017 - Toilets - Boys (42.29 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 4378/B001/R0017/Partition Walls (Cubicles)/S4	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R0018 - Home Base Store (5.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0012/Floor Coverings Res/Textile/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R0019 - Distribution Board (0.25 m2)</b>						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0012/Floor Coverings Res/Textile/S6	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting 4378/B001/R0032/Wall Linings Internal/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R0020 - Personal Effects Storage (7.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0020/Floor Coverings Res/Textile/S7					
				<b>No Asbestos Detected</b>		
<b>B001 - R0021 - Home Base (57.43 m2)</b>						
No Asbestos						
<b>B001 - R0022 - Home Base (86.11 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0012/Floor Coverings Res/Textile/S6	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R0023 - Toilets - Boys/Girls (1.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4378/B001/R0028/Ceiling Structures/Linings/S9	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R0024 - Home Base Store (4.37 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0020/Floor Coverings Res/Textile/S7					
				<b>No Asbestos Detected</b>		
<b>B001 - R0025 - Personal Effects Storage (8.08 m2)</b>						
No Asbestos						
<b>B001 - R0026 - Personal Effects Storage (8.08 m2)</b>						
No Asbestos						
<b>B001 - R0027 - Home Base Store (4.33 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0012/Floor Coverings Res/Textile/S6	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R0028 - Toilets - Boys/Girls (1.41 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4378/B001/R0028/Ceiling Structures/Linings/S9	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R0029 - Home Base (86.39 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4378/B001/R0012/Floor Coverings Res/Textile/S6	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R0030 - Home Base (57.35 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R0031 - Home Base Store (5.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0032 - Distribution Board (0.25 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0032/Wall Linings Internal/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R0033 - Personal Effects Storage (7.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0034 - Home Base Store (6.05 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0035 - Home Base (57.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0036 - Home Base (85.99 m2)</b>						
No Asbestos						
<b>B001 - R0037 - Personal Effects Storage (8.03 m2)</b>						
No Asbestos						
<b>B001 - R0038 - Distribution Board (0.17 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0012/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0032/Wall Linings Internal/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R0039 - General Storeroom (3.8 m2)</b>						
No Asbestos						
<b>B001 - R0040 - Staff Toilet (1.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0028/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0042 - Cleaning Distributed Store (2.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
4378/B001/R0020/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>	
<b>B001 - R0043 - Withdrawal Space - 1hb (27.9 m2)</b>						
No Asbestos						
<b>B001 - R0044 - Main Switch Board (5.89 m2)</b>						
Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0044/Electrical Mounting Board/S30					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B001/R0044/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0045 - Toilets - Boys/Girls (3.76 m2)</b>						
No Asbestos						
<b>B001 - R0055 - Personal Effects Storage (8.08 m2)</b>						
No Asbestos						
<b>B001 - R0056 - Plant (0.62 m2)</b>						
No Asbestos						
<b>B001 - R0057 - Covered Outdoor Learning Area (18.64 m2)</b>						
No Asbestos						
<b>B001 - R0058 - External Movement (19.28 m2)</b>						
No Asbestos						
<b>B001 - R0059 - Covered Outdoor Learning Area (14.76 m2)</b>						
No Asbestos						
<b>B001 - R0060 - Covered Outdoor Learning Area (18.55 m2)</b>						
No Asbestos						
<b>B001 - R0061 - External Movement (19.53 m2)</b>						
No Asbestos						
<b>B001 - R0062 - Covered Outdoor Learning Area (15.09 m2)</b>						
No Asbestos						
<b>B001 - R0063 - Disabled Toilet (10.86 m2)</b>						
No Asbestos						
<b>B001 - R0064 - Staff Kitchen (6.03 m2)</b>						
No Asbestos						
<b>B001 - R0065 - Reading Area (172 m2)</b>						
No Asbestos						
<b>B001 - R0066 - General Storeroom (1.42 m2)</b>						
No Asbestos						
<b>B001 - R0067 - General Storeroom (1.43 m2)</b>						
No Asbestos						
<b>B001 - R0068 - Library Office/Workroom (30.1 m2)</b>						
No Asbestos						
<b>B001 - R0069 - Communications Room (7.4 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - General Learning/Library - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Under floor void

**Interior**

**B002 - R0001 - Home Base (57.12 m2)**

Ceiling Structures/Linings Vermiculite  
 4378/B002/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B002 - R0002 - Cleaning Distributed Store (1.77 m2)**

No Asbestos

**B002 - R0003 - Movement (11.45 m2)**

No Asbestos

**B002 - R0004 - Disabled Toilet (5.76 m2)**

Ceiling Structures/Linings Vermiculite  
 4378/B002/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B002 - R0005 - Deputy Principal (12.89 m2)**

No Asbestos

**B002 - R0006 - General Storeroom (1.04 m2)**

No Asbestos

**B002 - R0007 - General Storeroom (4.28 m2)**

No Asbestos

**B002 - R0008 - Principal (19.86 m2)**

No Asbestos

**B002 - R0009 - Movement (13.52 m2)**

No Asbestos

**B002 - R0010 - Sick Bay (9.4 m2)**

No Asbestos

**B002 - R0011 - Interview (12.78 m2)**

No Asbestos

**B002 - R0012 - Clerical Office/Workroom (10.52 m2)**

No Asbestos

**B002 - R0013 - External Movement (1.13 m2)**

No Asbestos

**B002 - R0014 - Movement (19.25 m2)**

No Asbestos

**B002 - R0015 - Entry Vestibule (12.25 m2)**

No Asbestos

**B002 - R0016 - Clerical Office (44.2 m2)**

No Asbestos

**B002 - R0017 - Security Store (9.51 m2)**

Ceiling Structures/Linings Vermiculite  
 4378/B002/R0032/Ceiling Structures/Linings/S3 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles 10m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
 4378/B002/R0029/Floor Coverings Res/Textile/S15 **Chrysotile (white asbestos)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B002/R0017/Wall Linings Internal/S17					Chrysotile (white asbestos)	
<b>B002 - R0018 - Reading Area (76.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0019 - Reading Area (99.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0020 - Library Office/Workroom (9.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0021 - K.L.A. Store (10.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0022 - K.L.A. Store (11.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0023 - Library Office/Workroom (12.91 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0024 - Distribution Board (0.6 m2)</b>						
					Note: No inspection of live electrical installation.	
Wall and ceiling sheets	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4378/B003/R1001/Wall and ceiling sheets/S12					Chrysotile (white asbestos)	
<b>B002 - R0025 - Cleaning Distributed Store (1.75 m2)</b>						
No Asbestos						
<b>B002 - R0026 - Staff Toilet (5.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0027 - Movement (11.32 m2)</b>						
No Asbestos						
<b>B002 - R0029 - Personal Effects Storage (10.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B002/R0029/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)	
<b>B002 - R0030 - Home Base Store (9.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0031 - Home Base (57.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4378/B002/R0032/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B002 - R0032 - Toilets - Girls (50.52 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R0033 - Toilets - Boys (43.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R0034 - Home Base (57.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R0035 - Home Base Store (5.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R0036 - Personal Effects Storage (11.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R0037 - Distribution Board (0.68 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Wall Linings Internal	Flat AC Sheeting 4378/B003/R1001/Wall and ceiling sheets/S12	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Flat AC Sheeting 4378/B003/R1001/Wall and ceiling sheets/S12	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R0038 - Movement (8.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R0039 - Home Base Store (3.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R0040 - External Movement (3.21 m2)</b>						
No Asbestos						
<b>B002 - R0041 - External Movement (24.46 m2)</b>						
No Asbestos						
<b>B002 - R0042 - Stairs (3.39 m2)</b>						
No Asbestos						
<b>B002 - R0043 - Stairs (2.93 m2)</b>						
No Asbestos						
<b>B002 - R0044 - Home Base Store (55.35 m2)</b>						
No Asbestos						
<b>B002 - R0045 - Movement (190.12 m2)</b>						
No Asbestos						
<b>B002 - R1001 - Home Base (57.12 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B002 - R1002 - Staff Toilet (5.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Unable to access internal lining</i>
<b>B002 - R1003 - Staff Room Annexe (29.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B002 - R1004 - Staff Room Annexe (15.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B002 - R1005 - Interview (10.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B002 - R1006 - Movement (4.25 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1007 - General Storeroom (12.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1008 - General Storeroom (12.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1009 - Movement (213.7 m2)</b>						
No Asbestos						
<b>B002 - R1010 - Home Base (57.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B002 - R1011 - Home Base Store (5.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B002 - R1012 - Movement (8.36 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B002 - R1013 - Personal Effects Storage (11.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B002 - R1014 - Home Base Store (5.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1015 - Home Base (55.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B002 - R1016 - Home Base (55.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1017 - Home Base Store (5.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1018 - Personal Effects Storage (11.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1019 - Distribution Board (0.69 m2)</b>						
Wall and ceiling sheets	Flat AC Sheeting 4378/B003/R1001/Wall and ceiling sheets/S12	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B002 - R1020 - Movement (8.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1021 - General Storeroom (4.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1022 - Other - Regional Use (57.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B002 - R1023 - Cleaning Distributed Store (5.87 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1024 - Home Base Store (5.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1025 - Personal Effects Storage (6.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1026 - Home Base (67.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1027 - General Storeroom (16.17 m2)</b>						
Wall Linings Internal	Flat AC Sheeting 4378/B002/R1027/Wall Linings Internal/S18	5m2	West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1028 - Home Base (57.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1029 - Home Base Store (6.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1030 - Personal Effects Storage (7.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1031 - Movement (8.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4378/B002/R0038/Floor Coverings Res/Textile/S16	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B002 - R1032 - Home Base Store (6.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1033 - Home Base (55.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1034 - Home Base (55.45 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite					
	4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B002/R0038/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

**B002 - R1035 - Home Base Store (5.19 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B002 - R1036 - Personal Effects Storage (11.34 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B002/R0038/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

**B002 - R1037 - Movement (8.27 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B002/R0032/Ceiling Structures/Linings/S3					Limited Samples Taken
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B002/R0038/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

**B002 - R1038 - Distribution Board (0.68 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R1001/Wall and ceiling sheets/S12					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R1001/Wall and ceiling sheets/S12					Chrysotile (white asbestos)

**B002 - R1039 - Home Base Store (3.92 m2)**

No Asbestos

**B002 - R1040 - Stairs (6.23 m2)**

No Asbestos

**B002 - R1041 - Stairs (6.13 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B003 - General Learning/Communal Facilities - 1969 - Brick/Block (Brick/Block)**

**Exterior**

No Asbestos

Under floor void

Ceiling Voids - Raked Ceiling      No Asbestos Found

**Interior**

**B003 - R0001 - Sports Store (22.18 m2)**

No Asbestos

**B003 - R0002 - Movement (11.25 m2)**

No Asbestos

**B003 - R0004 - Toilets - Boys (44.51 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B003/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R0004/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

**B003 - R0005 - Toilets - Girls (42.58 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B003/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R0004/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

**B003 - R0015 - Kiln Room (5.66 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B003/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B003 - R0016 - Distribution Board (0.51 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B003 - R0017 - General Storeroom (41.08 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B003/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B003 - R0018 - General Storeroom (42.61 m2)**

Ceiling Structures/Linings	Vermiculite					
	4378/B003/R0004/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R0004/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

**B003 - R0019 - Movement (11.25 m2)**

No Asbestos

**B003 - R0020 - Cleaning Distributed Store (2.69 m2)**

No Asbestos

**B003 - R0021 - General Assistant/Bulk Store (14.65 m2)**

No Asbestos

**B003 - R0022 - External Movement (4.46 m2)**

No Asbestos

**B003 - R0023 - External Movement (3.26 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B003 - R0024 - External Movement (3.26 m2)</b>						
No Asbestos						
<b>B003 - R0025 - Stairs (11.04 m2)</b>						
No Asbestos						
<b>B003 - R0026 - Stairs (5.9 m2)</b>						
No Asbestos						
<b>B003 - R0027 - Movement (26.33 m2)</b>						
No Asbestos						
<b>B003 - R0028 - Communal Space (171.29 m2)</b>						
No Asbestos						
<b>B003 - R0029 - General Storeroom (1.19 m2)</b>						
No Asbestos						
<b>B003 - R0030 - Raised Platform (32.52 m2)</b>						
No Asbestos						
<b>B003 - R0031 - Hall Chair Store (8.05 m2)</b>						
No Asbestos						
<b>B003 - R0032 - Home Base (82.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4378/B002/R0032/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B003 - R0033 - External Movement (27.36 m2)</b>						
No Asbestos						
<b>B003 - R0034 - External Movement (49.8 m2)</b>						
No Asbestos						
<b>B003 - R1001 - Sports Store (8.16 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R1001/Wall and ceiling sheets/S12					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R1001/Wall and ceiling sheets/S12					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1002 - Movement (166.12 m2)</b>						
No Asbestos						
<b>B003 - R1003 - Personal Effects Storage (6.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R1003/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1004 - Home Base Store (8.31 m2)</b>						
No Asbestos						
<b>B003 - R1005 - Home Base (56.64 m2)</b>						
No Asbestos						
<b>B003 - R1006 - Home Base (56.64 m2)</b>						
No Asbestos						
<b>B003 - R1007 - Home Base Store (5.49 m2)</b>						
No Asbestos						
<b>B003 - R1008 - Distribution Board (0.68 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	1Unit	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B003/R1008/Electrical Mounting Board/S26					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1008/Wall Linings Internal/S14					<b>Chrysotile (white asbestos)</b>	
<b>B003 - R1009 - Movement (13.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1003/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B003 - R1010 - Home Base Store (6.52 m2)</b>						
No Asbestos						
<b>B003 - R1011 - Home Base (56.73 m2)</b>						
No Asbestos						
<b>B003 - R1012 - Home Base (56.57 m2)</b>						
No Asbestos						
<b>B003 - R1013 - Home Base Store (8.31 m2)</b>						
No Asbestos						
<b>B003 - R1014 - Personal Effects Storage (6.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1003/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B003 - R1015 - Home Base (56.72 m2)</b>						
No Asbestos						
<b>B003 - R1016 - Home Base Store (5.51 m2)</b>						
No Asbestos						
<b>B003 - R1017 - Distribution Board (0.68 m2)</b>						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1003/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1008/Wall Linings Internal/S14					<b>Chrysotile (white asbestos)</b>	
Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1017/Electrical Mounting Board/S27					<b>Chrysotile (white asbestos)</b>	
<b>B003 - R1018 - Personal Effects Storage (13.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1003/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B003 - R1019 - Home Base Store (6.52 m2)</b>						
No Asbestos						
<b>B003 - R1020 - Home Base (56.72 m2)</b>						
No Asbestos						
<b>B003 - R1021 - General Assistant/Bulk Store (33.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B003/R1003/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B003 - R1022 - Staff Toilet (4.8 m2)</b>						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Unable to locate internal lining</b>						
<b>B003 - R1023 - Staff Toilet (4.78 m2)</b>						
No Asbestos						
<b>B003 - R1024 - Stairs (14.23 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - R1025 - Stairs (5.47 m2)

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B004 - Pupil Facilities/Staff Facilities - 1967 - Brick/Block (Brick/Block)****Exterior**

Under floor voids No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

**Interior****B004 - R0001 - Canteen (32.92 m2)**

No Asbestos

**B004 - R0002 - Canteen Office/Store (3.1 m2)**

No Asbestos

**B004 - R0003 - Staff Toilet (3.06 m2)**

No Asbestos

**B004 - R0004 - Movement (9.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B004/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	

**B004 - R0005 - Staff Toilet (7.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B004/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B004/R0006/Partition Walls (Cubicles)/S21					<b>Chrysotile (white asbestos)</b>	

**B004 - R0006 - Staff Toilet (7.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B004/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B004/R0006/Partition Walls (Cubicles)/S21					<b>Chrysotile (white asbestos)</b>	

**B004 - R0007 - Cleaning Distributed Store (2.4 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4378/B004/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	

**B004 - R0008 - Staff Room (20.96 m2)**

No Asbestos

**B004 - R0009 - Staff Room (91.75 m2)**

No Asbestos

**B004 - R0013 - External Movement (102.8 m2)**

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
4378/B004/R0013/In-fill-panel/S19						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B005 - Pre-School Facilities/Administration - 1967 - Brick/Veneer (Brick/Veneer)

#### Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B005/Gable Verge Lining/S28				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Under floor voids	No Asbestos Found					

#### Interior

##### B005 - R0001 - External Movement (25.61 m2)

No Asbestos

##### B005 - R0002 - Community Clinic (24.99 m2)

No Asbestos

##### B005 - R0003 - Withdrawal - Pre (41.55 m2)

No Asbestos

##### B005 - R0004 - Staff Room Annexe (15.75 m2)

No Asbestos

##### B005 - R0007 - Distribution Board (0.42 m2)

Note: No inspection of live electrical installation.

No Asbestos

##### B005 - R0008 - Kitchen - Pre (8.68 m2)

No Asbestos

##### B005 - R0010 - Toilets - Boys/Girls (4.3 m2)

No Asbestos

##### B005 - R0011 - Entry Vestibule (4.17 m2)

No Asbestos

##### B005 - R0013 - External Movement (12.34 m2)

No Asbestos

##### B005 - R0014 - External Movement (16.33 m2)

No Asbestos

##### B005 - R0015 - Staff Toilet (1.8 m2)

No Asbestos

##### B005 - R0016 - Home Base Store - E (6.75 m2)

No Asbestos

##### B005 - R0017 - Home Base Store - E (2.59 m2)

No Asbestos

##### B005 - R0018 - Cleaning Distributed Store (3.31 m2)

No Asbestos

##### B005 - R0019 - Toilet - E (6.53 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B006 - Pre-School Facilities - 1967 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B006/Gable Verge Lining/S29				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Under floor voids	No Asbestos Found					

**Interior**

**B006 - R0001 - External Movement (58.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4378/B006/R0001/Ceiling Structures/Linings/S22				<b>Chrysotile (white asbestos)</b>	

**B006 - R0002 - Toilets - Boys/Girls - Pre (11.07 m2)**

No Asbestos

**B006 - R0003 - General Storeroom - Pre (3.78 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4378/B006/R0003/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	

**B006 - R0004 - Home Base - Pre (70.2 m2)**

No Asbestos

**B006 - R0005 - Home Base - Pre (70.1 m2)**

No Asbestos

**B006 - R0006 - General Storeroom - Pre (3.78 m2)**

No Asbestos

**B006 - R0007 - Toilets - Boys/Girls - Pre (11.11 m2)**

No Asbestos

**B006 - R0008 - General Storeroom - Pre (16.82 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B007 - Pre-School Facilities - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling      No Asbestos Found

Under floor voids      No Asbestos Found

**Interior**

**B007 - R0001 - General Storeroom - Pre (13.69 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 622 - D15266 - Single Learning Unit - Early Childhood : Placement Date - 30/06/1995

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

#### Interior

##### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

##### R2 - Home Base-E.I.

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

##### R3 - Shower/Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		8 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

4378\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017