


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wyoming Public School (4397)
Region : Hunter/Central Coast
State Electorate : The Entrance
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 29 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 17 - Jun - 2015

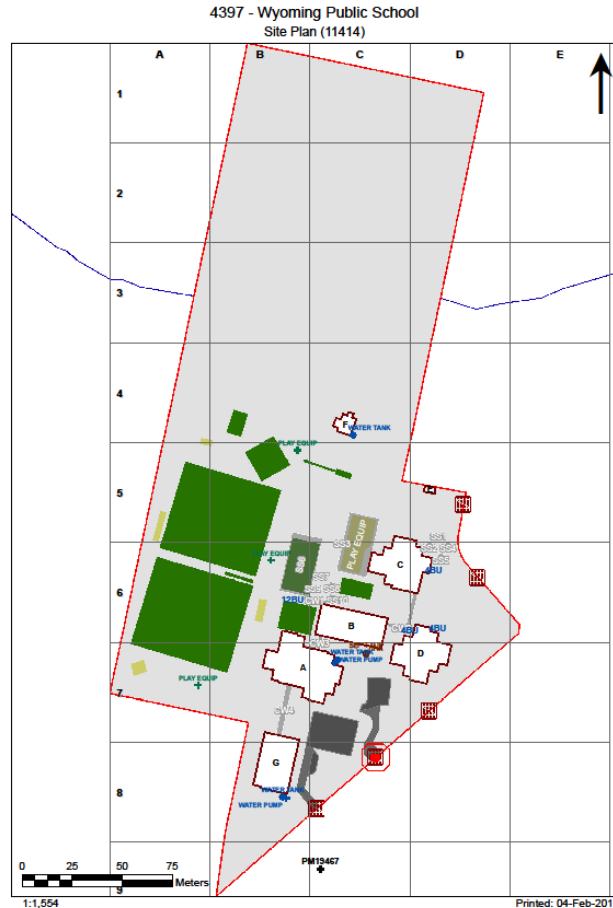

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - Administration/General Learning - 1972 - Brick/Block (Brick/Block)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00A - R0001 - General Storeroom (9.24 m2)

No Asbestos

B00A - R0002 - Kiln Room (0.53 m2)

No Asbestos

B00A - R0003 - Home Base (58.33 m2)

No Asbestos

B00A - R0004 - Movement (13.82 m2)

No Asbestos

B00A - R0005 - General Storeroom (10.63 m2)

No Asbestos

B00A - R0006 - Canteen Office/Store (2.75 m2)

No Asbestos

B00A - R0007 - Canteen (22.1 m2)

No Asbestos

B00A - R0008 - Canteen Office/Store (3.03 m2)

No Asbestos

B00A - R0009 - Movement (28.91 m2)

No Asbestos

B00A - R0010 - Movement (2.64 m2)

No Asbestos

B00A - R0011 - Staff Room (59.62 m2)

No Asbestos

B00A - R0012 - Movement (13.57 m2)

No Asbestos

B00A - R0013 - General Storeroom (11.58 m2)

No Asbestos

B00A - R0014 - Clerical Office (17.86 m2)

No Asbestos

B00A - R0015 - Movement (2.8 m2)

No Asbestos

B00A - R0016 - Entry Vestibule (29.41 m2)

| | | | | | | |
|--|-------------|-----|-------|--------------------|------------------------------------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00A/R0023/Floor Coverings Res/Textile/S2 | | | | | Chrysotile (white asbestos) | |

B00A - R0017 - Principal (16.7 m2)

No Asbestos

B00A - R0018 - Interview (12.89 m2)

No Asbestos

B00A - R0019 - Staff Toilet (3.44 m2)

No Asbestos

B00A - R0020 - Staff Toilet (3.45 m2)

No Asbestos

B00A - R0021 - Cleaning Distributed Store (1.9 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

B00A - R0022 - Deputy Principal (12.26 m2)

No Asbestos

B00A - R0023 - Duplicating Workroom (32.04 m2)

Floor Coverings Res/Textile Vinyl Tiles 33m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00A/R0023/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0024 - General Storeroom (1.3 m2)

Floor Coverings Res/Textile Vinyl Tiles 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00A/R0023/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0025 - General Storeroom (3.99 m2)

No Asbestos

B00A - R0026 - Movement (27.19 m2)

No Asbestos

B00A - R0027 - Toilets - Boys (24.47 m2)

Partition Walls (Cubicles) Compressed AC Sheet 16m2 East, West Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00A/R0027/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

B00A - R0028 - Sports Store (11.63 m2)

No Asbestos

B00A - R0029 - Communal Space (154.56 m2)

No Asbestos

B00A - R0030 - Toilets - Girls (22.06 m2)

Partition Walls (Cubicles) Compressed AC Sheet 16m2 East, West Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00A/R0027/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

B00A - R0031 - Home Base (58.98 m2)

No Asbestos

B00A - R0032 - Garden Store (7.71 m2)

No Asbestos

B00A - R0033 - Movement (4.43 m2)

No Asbestos

B00A - R0034 - Main Switch Board (8.6 m2)

No Asbestos

B00A - R0035 - Movement (8.32 m2)

No Asbestos

B00A - R1001 - Home Base (58.3 m2)

No Asbestos

B00A - R1002 - Cleaning Distributed Store (6.42 m2)

No Asbestos

B00A - R1003 - Toilets - Girls (9.18 m2)

Partition Walls (Cubicles) Compressed AC Sheet 6m2 East, West Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00A/R0027/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

B00A - R1004 - Home Base (56.33 m2)

No Asbestos

B00A - R1005 - Home Base (56.89 m2)

No Asbestos

B00A - R1006 - General Storeroom (6.76 m2)

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--|-----------------------------|--------------------|
| Sample No | | | | | Test Result | |
| B00A - R1007 - Toilets - Boys (9.42 m2) | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 6m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00A/R0027/Partition Walls (Cubicles)/S1 | | | | | Chrysotile (white asbestos) | |
| B00A - R1008 - Home Base (56.49 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1009 - Staff Room Annexe (18.65 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1010 - Home Base (57.35 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1011 - Craft Store (16.96 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00A/R1017/Floor Coverings Res/Textile/S8 | | | | | Chrysotile (white asbestos) | |
| B00A - R1012 - Distribution Board (0.81 m2) | | | | | | |
| | | | | Note: No inspection of live electrical installation. | | |
| No Asbestos | | | | | | |
| B00A - R1013 - Home Base (55.61 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1014 - Home Base (58.17 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1015 - Interview (17.11 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1016 - Home Base (56.97 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1017 - Movement (113.86 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 114m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00A/R1017/Floor Coverings Res/Textile/S8 | | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - Library - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00B - R0001 - Reading Area (226.4 m2)

No Asbestos

B00B - R0002 - K.L.A. Store (13.71 m2)

No Asbestos

B00B - R0003 - Library Office/Workroom (24.14 m2)

No Asbestos

B00B - R0004 - Distribution Board (1.85 m2)

Note: No inspection of live electrical installation.

| | | | | | | |
|--|------------------|-------|-------|--------------------|------------------------------------|--------------------|
| Electrical Mounting Board | Flat AC Sheeting | 6Unit | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00B/R0004/Electrical Mounting Board/S3 | | | | | Chrysotile (white asbestos) | |

B00B - R0005 - Communications Room (43.63 m2)

No Asbestos

B00B - R0006 - General Storeroom (5.22 m2)

No Asbestos

B00B - R0007 - Plant (1.8 m2)

No Asbestos

B00B - R0008 - Toilets - Girls (7.05 m2)

| | | | | | | |
|---|---------------------|-----|--------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 4m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00B/R0008/Partition Walls (Cubicles)/S4 | | | | | Chrysotile (white asbestos) | |

B00B - R0009 - Library Office/Workroom (6.29 m2)

No Asbestos

B00B - R0010 - Movement (155.91 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - General Learning/Pupil Facilities - 1979 - Brick/Block (Brick/Block)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00C - R0001 - Home Base (90.8 m2)

No Asbestos

B00C - R0002 - Toilets - Boys/Girls (3.96 m2)

No Asbestos

B00C - R0003 - Home Base Store (5.59 m2)

No Asbestos

B00C - R0004 - Distribution Board (0.83 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0005 - Personal Effects Storage (7.87 m2)

No Asbestos

B00C - R0006 - Movement (20.97 m2)

No Asbestos

B00C - R0007 - Movement (3.82 m2)

No Asbestos

B00C - R0008 - Toilets - Girls (21.09 m2)

| | | | | | | |
|---|---------------------|------|--------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 10m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00C/R0008/Partition Walls (Cubicles)/S5 | | | | | Chrysotile (white asbestos) | |

B00C - R0009 - Toilets - Boys (21.1 m2)

| | | | | | | |
|---|---------------------|-----|--------------|--------------------|------------------------------------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 6m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00C/R0008/Partition Walls (Cubicles)/S5 | | | | | Chrysotile (white asbestos) | |

B00C - R0010 - Movement (3.24 m2)

No Asbestos

B00C - R0011 - Personal Effects Storage (7.4 m2)

No Asbestos

B00C - R0012 - Cleaning Distributed Store (2.82 m2)

No Asbestos

B00C - R0013 - Home Base Store (6.78 m2)

No Asbestos

B00C - R0014 - Home Base (90.8 m2)

No Asbestos

B00C - R0015 - Toilets - Boys/Girls (3.76 m2)

No Asbestos

B00C - R0016 - Movement (84.33 m2)

No Asbestos

B00C - R0017 - Personal Effects Storage (7.57 m2)

No Asbestos

B00C - R0018 - Home Base (90.8 m2)

No Asbestos

B00C - R0019 - Toilets - Boys/Girls (3.28 m2)

No Asbestos

B00C - R0020 - Home Base Store (5.41 m2)

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning/Pupil Facilities - 1981 - Brick/Block (Brick/Block)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00D - R0001 - Movement (80.2 m2)

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

B00D - R0002 - Movement (6.36 m2)

No Asbestos

B00D - R0003 - Toilets - Girls (20.18 m2)

| | | | | | | |
|---|---------------------|------|--------------|------------------------------------|---------|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 16m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0003/Partition Walls (Cubicles)/S6 | | | | Chrysotile (white asbestos) | | |

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

B00D - R0004 - Practical Activities - 1hb (22.65 m2)

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

B00D - R0005 - Home Base (52.7 m2)

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

B00D - R0006 - General Storeroom (7.04 m2)

No Asbestos

B00D - R0007 - Movement (14.67 m2)

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

B00D - R0008 - Distribution Board (0.69 m2)

Note: No inspection of live electrical installation.

| | | | | | | |
|--|----------------|-------|-------|------------------------------------|---------|--------------------|
| Electrical Backing Board | Resinous Board | 1Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0008/Electrical Backing Board/S14 | | | | Chrysotile (white asbestos) | | |

| | | | | | | |
|--|--|-------|-------|--------------------|---------|--------------------|
| Electrical Backing Board | Encapsulated Insulation material within unit | 1Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Electrical Hazard - Unable to access | | | | | | |

B00D - R0009 - Interview (18.33 m2)

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

| | | | | | | |
|---|---|------|------------|------------------------------------|---------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 19m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0010/Floor Coverings Res/Textile/S11 | | | | Chrysotile (white asbestos) | | |

B00D - R0010 - Movement (25.51 m2)

| | | | | | | |
|---|-------------|--|--|--|------------------------------|--|
| Ceiling Structures/Linings | Vermiculite | 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | Limited Samples Taken | |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> | | | | | | |

| | | | | | | |
|---|---|------|------------|------------------------------------|---------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 26m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0010/Floor Coverings Res/Textile/S11 | | | | Chrysotile (white asbestos) | | |

B00D - R0011 - Movement (5.77 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|---|--------|--------------------|--------------------|---|-----------------------|
| Sample No | | | | | Test Result | |
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0015/Floor Coverings Res/Textile/S7 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| B00D - R0012 - Interview (14.31 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 15m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0010/Floor Coverings Res/Textile/S11 | | | | | Chrysotile (white asbestos) | |
| B00D - R0015 - Practical Activities - 1hb (36.57 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 37m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0015/Floor Coverings Res/Textile/S7 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| B00D - R0016 - Practical Activities - 1hb (22.4 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 23m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0015/Floor Coverings Res/Textile/S7 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| B00D - R0017 - Home Base (52.27 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| B00D - R0018 - Movement (10.85 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| B00D - R0019 - General Storeroom (4.08 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0020 - Cleaning Distributed Store (4.07 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R0021 - Toilets - Boys (22.61 m2) | | | | | | |
| Partition Walls (Cubicles) | Compressed AC Sheet | 10m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0003/Partition Walls (Cubicles)/S6 | | | | | Chrysotile (white asbestos) | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 4397/B00D/R0001/Ceiling Structures/Linings/S12 | | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |
| B00D - R0022 - Toilets-Unisex (10.34 m2) | | | | | | |
| Recently Modified Space | Requires Inspection | | | | | |
| B00D - R1001 - Home Base (64.72 m2) | | | | | | |
| No Asbestos | | | | | | |
| B00D - R1002 - Practical Activities - 1hb (18.27 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 19m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 4397/B00D/R0015/Floor Coverings Res/Textile/S7 | | | | | Chrysotile (white asbestos) | |
| B00D - R1003 - Personal Effects Storage (4.31 m2) | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

B00D - R1004 - Practical Activities - 1hb (22.53 m2)

Floor Coverings Res/Textile Vinyl Tiles 23m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00D/R0015/Floor Coverings Res/Textile/S7 **Chrysotile (white asbestos)**

B00D - R1005 - Home Base (52.91 m2)

No Asbestos

B00D - R1006 - General Storeroom (9.23 m2)

No Asbestos

B00D - R1007 - Withdrawal Space - 1hb (4.42 m2)

No Asbestos

B00D - R1008 - Home Base (64.63 m2)

No Asbestos

B00D - R1009 - Practical Activities - 1hb (18.32 m2)

Floor Coverings Res/Textile Vinyl Tiles 19m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00D/R0015/Floor Coverings Res/Textile/S7 **Chrysotile (white asbestos)**

B00D - R1010 - Distribution Board (0.7 m2) Note: No inspection of live electrical installation.

Electrical Backing Board Resinous Board 1Unit South Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00D/R0008/Electrical Backing Board/S14 **Chrysotile (white asbestos)**

Electrical Backing Board Encapsulated Insulation material within unit 1Unit South Good Condition (1) Low (1) Low Priority (2-3)
Assumed Asbestos - Electrical Hazard - Unable to access

B00D - R1011 - Practical Activities - 1hb (21.88 m2)

Floor Coverings Res/Textile Vinyl Tiles 22m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00D/R0015/Floor Coverings Res/Textile/S7 **Chrysotile (white asbestos)**

B00D - R1012 - Home Base (53.05 m2)

No Asbestos

B00D - R1013 - Toilets - Boys/Girls (10.25 m2)

No Asbestos

B00D - R1014 - Cleaning Distributed Store (4.55 m2)

No Asbestos

B00D - R1015 - Movement (56.91 m2)

Floor Coverings Res/Textile Vinyl Tiles 57m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4397/B00D/R0015/Floor Coverings Res/Textile/S7 **Chrysotile (white asbestos)**

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

| | | | | | | |
|--|--|--|--|--|--|-----------------------------|
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids - Packing to Floor Joists | Flat AC Sheeting | | | | | |
| | 4397/B00E/Underfloor Voids - Packing to Floor Joists/S10 | | | | | No Asbestos Detected |

Interior

B00E - R0001 - Garden Store (14.95 m2)

| | | | | | | |
|-----------------------|---|------|------------|---------------------------------------|------------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 25m2 | Throughout | Poor Condition - Extensive Damage (4) | Medium (2) | High Priority (6-8) |
| | 4397/B00E/R0001/Wall Linings Internal/S13 | | | | | Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B00F - Other-Community Use - 2001 - Steel (Steel)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00F - R0001 - Other-Community Use (53.21 m2)

No Asbestos

B00F - R0002 - Disabled Toilet (3.42 m2)

No Asbestos

B00F - R0003 - Toilets-Unisex (5.1 m2)

No Asbestos

B00F - R0004 - External Movement (11.01 m2)

No Asbestos

B00F - R0005 - External Movement (4.94 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B00G - Communal Facilities/Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00G - R0001 - Communal Space (144.84 m2)

No Asbestos

B00G - R0002 - Movement (6.61 m2)

No Asbestos

B00G - R0003 - Raised Platform (59.89 m2)

No Asbestos

B00G - R0004 - Ramp (12.44 m2)

No Asbestos

B00G - R0005 - Movement (13 m2)

No Asbestos

B00G - R0006 - Chair Storeroom (9.31 m2)

No Asbestos

B00G - R0007 - Communal/Performance Store (9.16 m2)

No Asbestos

B00G - R0008 - Sports Store (13.03 m2)

No Asbestos

B00G - R0009 - Toilet - Lobby (2.54 m2)

No Asbestos

B00G - R0010 - Toilets - Girls (7.15 m2)

No Asbestos

B00G - R0011 - Sound Cupboard (2.05 m2)

No Asbestos

B00G - R0012 - Toilet - Lobby (3.4 m2)

No Asbestos

B00G - R0013 - Toilets - Boys (5.73 m2)

No Asbestos

B00G - R0014 - Cleaning Distributed Store (3.54 m2)

No Asbestos

B00G - R0015 - Cleaning Distributed Store (1.61 m2)

No Asbestos

B00G - R0016 - Main Switch Board (3.31 m2)


No Asbestos

B00G - R0017 - Disabled Shower/Toilet (6.9 m2)

No Asbestos

B00G - R0018 - Covered Outdoor Learning Area (150.85 m2)

No Asbestos

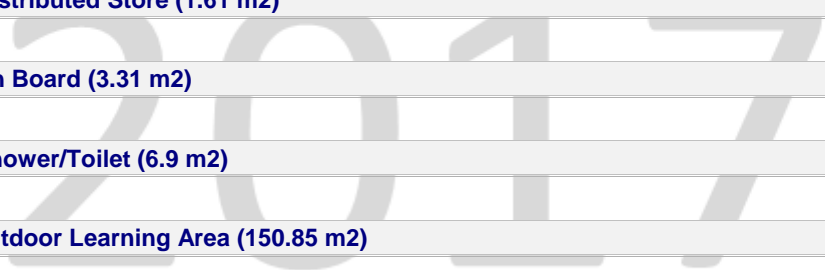

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017