


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wideview Public School (4433)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 12 - Feb - 2008
Reviewed By : Grencap-NAA : 15 - Aug - 2014

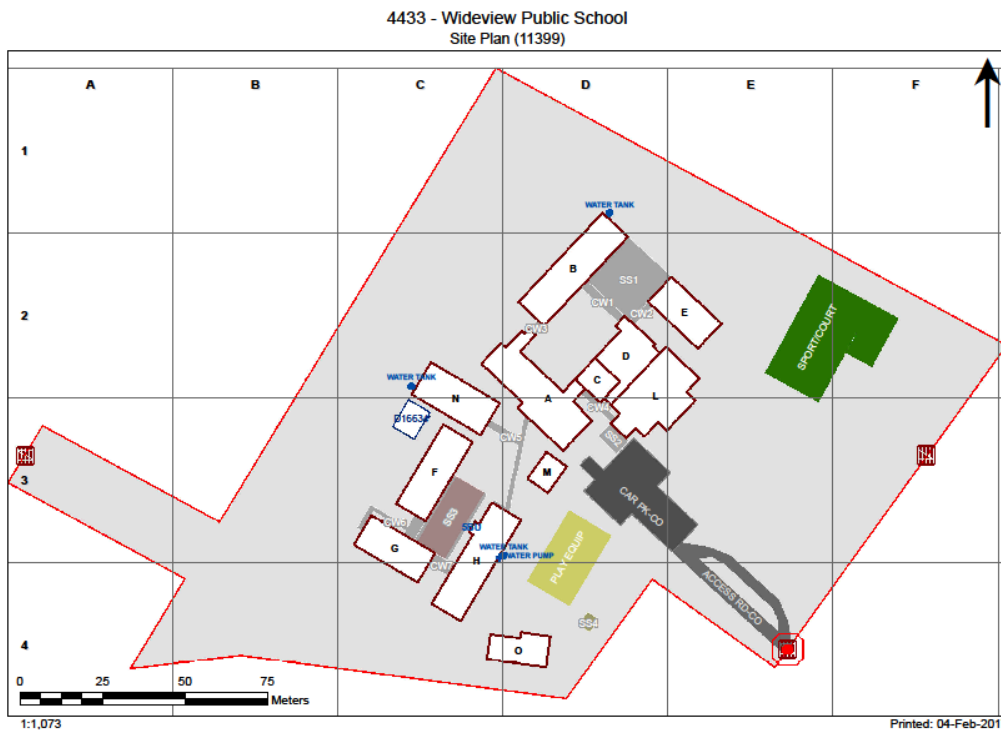

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/R1007/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
In-fill panels below windows	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Wall Cladding/S1				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	60m	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/Gable Verge Lining/S17				Chrysotile (white asbestos)	
Underfloor Voids	Thermecon heaters	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Stored items

Interior**B00A - R0002 - Staff Toilet**

No Asbestos

B00A - R0003 - Staff Toilet

No Asbestos

B00A - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0015 - Movement

In-fill panels below windows	Flat AC Sheeting	14Unit(s)	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/R0015/Panels under windows/S11				Chrysotile (white asbestos)	

B00A - R0016 - External Movement

Infill panels below windows	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/R0015/Panels under windows/S11				Chrysotile (white asbestos)	

B00A - R0017 - Cleaning Distributed Store

No Asbestos

B00A - R0018 - Movement

No Asbestos

B00A - R0019 - Movement

No Asbestos

B00A - R0020 - Stairs

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/R0020/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B00A - R0021 - Stairs

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/R0020/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B00A - R0022 - Movement

No Asbestos

B00A - R0023 - Stairs

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00A/R0020/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B00A - R0024 - Entry Vestibule

No Asbestos

B00A - R0025 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0026 - Sick Bay						
No Asbestos						
B00A - R0027 - Security Store						
No Asbestos						
B00A - R0028 - Staff Room Annexe						
No Asbestos						
B00A - R0029 - Staff Room Annexe						
No Asbestos						
B00A - R0030 - Staff Room						
No Asbestos						
B00A - R0031 - Interview						
No Asbestos						
B00A - R0032 - Duplicating Workroom						
No Asbestos						
B00A - R0033 - Principal						
No Asbestos						
B00A - R0034 - Clerical Office						
No Asbestos						
B00A - R0035 - Clerical Office/Workroom						
No Asbestos						
B00A - R0036 - Clerical Office						
No Asbestos						
B00A - R1007 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00A/R1007/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00A - R1008 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00A/R1007/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00A - R1009 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00A/R1007/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00A - R1010 - Home Base						
No Asbestos						
B00A - R1011 - Home Base Store						
No Asbestos						
B00A - R1012 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R1013 - Practical Activities						
No Asbestos						
B00A - R1014 - Home Base						
No Asbestos						
B00A - R1015 - Practical Activities						
No Asbestos						
B00A - R1016 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R1017 - Home Base Store						
No Asbestos						
B00A - R1018 - Home Base						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1019 - Practical Activities						
No Asbestos						
B00A - R1020 - Home Base Store						
No Asbestos						
B00A - R1021 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R9001 - Movement						
No Asbestos						
B00A - R9002 - P.E. Store						
No Asbestos						
B00A - R9003 - Movement						
No Asbestos						
B00A - R9004 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height restricted						
In-fill panels below windows	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/Wall Cladding/S1					Chrysotile (white asbestos)	
Underfloor Voids	Packing	2m2	Variable positions	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
4433/B00B/Underfloor Voids/S18					Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00A/Gable Verge Lining/S17					Chrysotile (white asbestos)	

Interior**B00B - R0001 - Home Base**

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Home Base Store

No Asbestos

B00B - R0006 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						

B00B - R0007 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						

B00B - R0008 - Home Base Store

No Asbestos

B00B - R0009 - Personal Effects Storage

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Home Base Store

No Asbestos

B00B - R0012 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						

B00B - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00A/R1007/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

B00B - R9001 - Special Programs Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00B/R9002/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00B - R9002 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	56m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00B/R9002/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit						
B00B - R9003 - General Assistant/Bulk Store						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00C - R0001 - Staff Toilet

No Asbestos

B00C - R0002 - Canteen Office/Store

No Asbestos

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Canteen Office/Store

No Asbestos

B00C - R0005 - Canteen

No Asbestos

B00C - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

4433/B00D/R0007/Ceiling Structures/Linings/S23

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1969 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00D - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 4433/B00D/R0001/Partition Walls (Cubicles)/S15					No Asbestos Detected
Cistern covers	Flat AC Sheeting 4433/B00D/R0001/Cistern covers/S22					No Asbestos Detected

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0003 - Disabled Toilet

No Asbestos

B00D - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 4433/B00D/R0001/Partition Walls (Cubicles)/S15					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00D - R0005 - Hall Chair Store

No Asbestos

B00D - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00D/R0007/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00D - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00D/R0007/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1969 - Brick/Veneer (Brick/Veneer)

Exterior

Gable verge lining	Flat AC Sheeting	20m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00E/Gable verge lining/S19					Chrysotile (white asbestos)
In-fill panels below windows	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Wall Cladding/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00E/Eaves Linings/S20					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	2m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4433/B00E/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)
Gable Verge Lining	Adhesive					No Asbestos Detected
	4433/B00E/Gable Verge Lining/S38					

Interior

B00E - R0001 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Personal Effects Storage

No Asbestos

B00E - R0004 - General Storeroom

No Asbestos

B00E - R0005 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					

B00E - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00E/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos)

B00E - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable verge lining	Flat AC Sheeting	30m	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00F/Gable verge lining/S37					Chrysotile (white asbestos)
In-fill panels below windows	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Wall Cladding/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00F/Eaves Linings/S36					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	3m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4433/B00F/Eaves Linings/S36					Chrysotile (white asbestos)

Interior**B00F - R0001 - Home Base**

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed unit					

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Home Base Store

No Asbestos

B00F - R0004 - General Storeroom

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed & live					

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					

B00F - R0007 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					

B00F - R0008 - Home Base Store

No Asbestos

B00F - R0009 - Personal Effects Storage

No Asbestos

B00F - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00F/Eaves Linings/S36					Chrysotile (white asbestos)

B00F - R9001 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00F/R9001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R9002 - Out Of School Hours Care Centre						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00F/R9001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed units					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable verge lining	Flat AC Sheeting 4433/B00G/Gable verge lining/S32					No Asbestos Detected
In-fill panels below windows	Flat AC Sheeting 4433/B00H/Wall Cladding/S1	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 4433/B00G/Eaves Linings/S33					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 4433/B00G/R9001/Ceiling Structures/Linings/S35	2m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior**B00G - R0001 - Movement**

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed & live						

B00G - R0002 - General Storeroom

No Asbestos

B00G - R0003 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting 4433/B00G/R0003/Wall Linings Internal/S34	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4433/B00G/R0003/Wall Linings Internal/S34	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						

B00G - R0005 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						

B00G - R0006 - Home Base Store

No Asbestos

B00G - R0007 - Personal Effects Storage

No Asbestos

B00G - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4433/B00G/Eaves Linings/S33					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R9001 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles 4433/B00G/R9001/Floor Coverings Res/Textile/S7	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4433/B00G/R9001/Ceiling Structures/Linings/S35	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable verge lining	Flat AC Sheeting	30m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Gable verge lining/S27					Chrysotile (white asbestos)
In-fill panels below windows	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Wall Cladding/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Eaves Linings/S26					Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	3m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4433/B00H/Underfloor Voids/S28					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior**B00H - R0001 - Withdrawal Space - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed unit					

B00H - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed unit					

B00H - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00H - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00H - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0005/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00H - R0006 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00H - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00H - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4433/B00H/Eaves Linings/S26					Chrysotile (white asbestos)

B00H - R0009 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0005/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00H - R0010 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00H - R0011 - Interview						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit						
B00H - R0012 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00H - R0013 - Home Base						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed units						
B00H - R0014 - Home Base Store						
No Asbestos						
B00H - R0015 - Personal Effects Storage						
No Asbestos						
B00H - R0016 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
Cistern covers	Flat AC Sheeting					No Asbestos Detected
4433/B00H/R0016/Cistern covers/S31						
B00H - R0017 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00H - R0018 - Cleaning Distributed Store						
No Asbestos						
B00H - R0019 - Main Switch Board						
Electrical Mounting Board	Resinous Board	3Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00H/R0019/Electrical Mounting Board/S29					Chrysotile (white asbestos)	
Electrical conduit tape	Textile					No Asbestos Detected
4433/B00H/R0019/Electrical conduit tape/S30						
B00H - R0020 - P.E. Store						
No Asbestos						
B00H - R0021 - Garden Store						
No Asbestos						
B00H - R0022 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
4433/B00H/R0022/Ceiling Structures/Linings/S2						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Communal Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00L - R0001 - Movement

No Asbestos

B00L - R0002 - Communal Space

No Asbestos

B00L - R0003 - Hall Chair Store

No Asbestos

B00L - R0004 - Movement

No Asbestos

B00L - R0005 - Raised Platform

No Asbestos

B00L - R0006 - Movement

No Asbestos

B00L - R0007 - Plant

No Asbestos

B00L - R0008 - Movement

No Asbestos

B00L - R0009 - Movement

No Asbestos

B00L - R0010 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Other-After School Care - 2008 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found					
Entry Steps	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00M/Entry Steps/S25					Chrysotile (white asbestos)	

Interior

B00M - R0001 - Out Of School Hours Care Centre

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00M/R0004/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	

B00M - R0002 - Out Of School Hours Care Centre

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00M/R0004/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	

B00M - R0003 - Out Of School Hours Care Centre

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00M/R0004/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	

B00M - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00M/R0004/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00N - R0001 - External Movement

No Asbestos

B00N - R0002 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0003 - Toilet - Lobby

No Asbestos

B00N - R0004 - Cleaning Distributed Store

No Asbestos

B00N - R0005 - Toilets-Unisex

No Asbestos

B00N - R0006 - K.L.A. Store

No Asbestos

B00N - R0007 - Communications Room

No Asbestos

B00N - R0008 - Library Office/Workroom

No Asbestos

B00N - R0009 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Other - After School Care - 2006 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - Out Of School Hours Care Centre

No Asbestos

B000 - R0002 - Out Of School Hours Care Centre

No Asbestos

B000 - R0003 - Out Of School Hours Care Centre

No Asbestos

B000 - R0004 - Out Of School Hours Care Centre

No Asbestos

B000 - R0005 - Out Of School Hours Care Centre

No Asbestos

B000 - R0006 - Out Of School Hours Care Centre

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Covered walkway between G and H

Exterior

No Asbestos

Interior

Build+1 - Room+1 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

4433/B00G/R9001/Ceiling Structures/Linings/S35

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+2 - Covered walkway between G & F

Exterior

No Asbestos

Interior

Build+2 - Room+1 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4433/B00F/Eaves Linings/S36					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+3 - Covered walkway between A & B

Exterior

No Asbestos

Interior

Build+3 - Room+1 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

4433/B00A/R1007/Ceiling Structures/Linings/S12

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+4 - Covered walkway between B & D

Exterior

No Asbestos

Interior

Build+4 - Room+1 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

4433/B00D/R0007/Ceiling Structures/Linings/S23

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+5 - Covered walkway between D & E

Exterior

No Asbestos

Interior

Build+5 - Room+1 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

4433/B00C/R0006/Ceiling Structures/Linings/S14

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D16634 - Learning Unit - Standard With P.A.A. : Placement Date - 19/01/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017