


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Winmalee Public School (4436)  
**Region :** Western Sydney  
**State Electorate :** Blue Mountains  
**Local Government Area :** Blue Mountains

**Initial Survey :** Noel Arnold & Associates : 13 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 14 - May - 2015

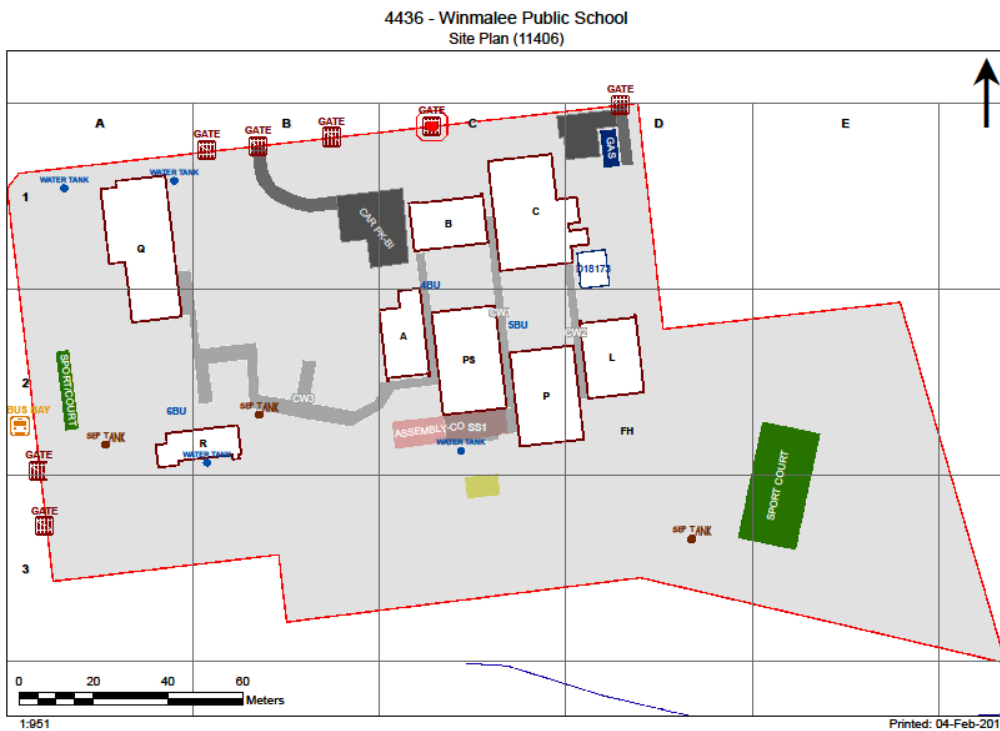

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00A - R0001 - Movement (4.83 m2)**

No Asbestos

**B00A - R0002 - Staff Room (54.92 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0003 - Entry Vestibule (23.27 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0004 - Clerical Office (12.78 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0005 - Sick Bay (12.96 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0006 - Deputy Principal (13 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0007 - Duplicating Workroom (2.76 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0008 - Movement (7.8 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0009 - Principal (21.06 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0010 - General Storeroom (8.24 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0011 - Distribution Board (0.34 m2)**

Note: No inspection of live electrical installation.

In-fill-panel	Flat AC Sheeting	2m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00A/R0011/In-fill-panel/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4436/B00A/R0011/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00A - R0012 - Staff Toilet (3.18 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		4436/B00B/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0013 - Staff Toilet (3.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4436/B00B/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0014 - Duplicating Workroom (12.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4436/B00B/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0015 - Movement (4.83 m2)</b>						
No Asbestos						
<b>B00A - R0016 - Movement (5.09 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Toilets - Boys (7.4 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Toilets - Girls (9.53 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - Administration/Pupil Facilities - 1972 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00B - R0001 - Staff Toilet (2.97 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0015/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
<b>B00B - R0002 - Canteen Office/Store (6.19 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0015/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0011/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
<b>B00B - R0003 - Canteen Office/Store (5.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0015/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0011/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
<b>B00B - R0004 - Canteen (20.95 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0015/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	6m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0015/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
<b>B00B - R0005 - External Movement (75.87 m2)</b>						
No Asbestos						
<b>B00B - R0006 - Community Clinic (10.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R0007 - Community Clinic (9.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R0008 - Staff Toilet (3.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00B/R0015/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
<b>B00B - R0009 - Community Clinic (10.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R0010 - Main Switch Board (7.65 m2)</b>						
Electrical Backing Board	Resinous Board					<b>No Asbestos Detected</b>
	4436/B00B/R0010/Electrical Backing Board/S16					
<b>B00B - R0011 - Staff Room Annexe (13.77 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R0012 - Movement (9.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0013 - Interview (13.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0014 - Staff Toilet (3.17 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 4436/B00B/R0015/Ceiling Structures/Linings/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R0015 - General Storeroom (18.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 4436/B00B/R0015/Ceiling Structures/Linings/S3	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R0016 - Cleaning Distributed Store (3.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0017 - External Stairs (5.11 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00C - R0001 - External Movement (7.98 m2)**

No Asbestos

**B00C - R0002 - Practical Activities - 1hb (22.81 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

**B00C - R0010 - Toilets - Boys (31.63 m2)**

No Asbestos

**B00C - R0012 - External Movement (8.21 m2)**

No Asbestos

**B00C - R0013 - Toilets - Girls (31.57 m2)**

No Asbestos

**B00C - R0014 - General Assistant/Bulk Store (34.64 m2)**

No Asbestos

**B00C - R0015 - General Storeroom (34.58 m2)**

No Asbestos

**B00C - R0018 - Personal Effects Storage (5.42 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0021 - Home Base (63.92 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

**B00C - R0023 - External Movement (7.98 m2)**

No Asbestos

**B00C - R0024 - Stairs (11.06 m2)**

Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0025 - General Storeroom (9.11 m2)</b>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0026 - External Movement (38.27 m2)</b>						
No Asbestos						
<b>B00C - R0027 - Disabled Toilet (15.16 m2)</b>						
No Asbestos						
<b>B00C - R0028 - Movement (4.46 m2)</b>						
No Asbestos						
<b>B00C - R0029 - Lift (2.24 m2)</b>						
No Asbestos						
<b>B00C - R0030 - Movement (19.56 m2)</b>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0031 - Special Programs Room (5.54 m2)</b>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0032 - Special Programs Room (15.95 m2)</b>						
No Asbestos						
<b>B00C - R0033 - Home Base (60.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4436/B00C/R0033/Floor Coverings Res/Textile/S18	61m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0034 - Toilets - Boys/Girls (4.41 m2)</b>						
No Asbestos						
<b>B00C - R0035 - Movement (9.19 m2)</b>						
No Asbestos						
<b>B00C - R0036 - External Movement (10.15 m2)</b>						
No Asbestos						
<b>B00C - R0037 - Sports Store (9.01 m2)</b>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0038 - Stairs (11.1 m2)</b>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0039 - Stairs (5.44 m2)</b>						
No Asbestos						
<b>B00C - R0040 - Toilets - Boys/Girls (1.65 m2)</b>						
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0041 - Handwashing Facilities (2.12 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0042 - Stairs (4.61 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Home Base (58.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1002 - Practical Activities - 1hb (11.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1004 - Personal Effects Storage (9.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1008 - Personal Effects Storage (7.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1009 - Home Base (49.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1010 - Practical Activities - 1hb (9.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1011 - Home Base Store (6.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1012 - Practical Activities - 1hb (10.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R1013 - Home Base (48.91 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1014 - Home Base Store (7.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00C - R1015 - Personal Effects Storage (7.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00C - R1017 - Distribution Board (0.48 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board 4436/B00C/R1017/Electrical Backing Board/S17	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Decorative Coating	Vermiculite 4436/B00C/R0037/Decorative Coating/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1018 - Cleaning Distributed Store (1.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1019 - Cleaning Distributed Store (8.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1020 - Personal Effects Storage (9.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00C - R1021 - Home Base Store (9.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B00B/R0011/Floor Coverings Res/Textile/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00C - R1022 - Home Base (58.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1023 - Practical Activities - 1hb (11.12 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles 12m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
 4436/B00B/R0011/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

**B00C - R1024 - General Storeroom (5.99 m2)**

No Asbestos

**B00C - R1025 - Movement (32.53 m2)**

Decorative Coating Vermiculite  
 4436/B00C/R0037/Decorative Coating/S19 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00C - R1026 - Movement (9.22 m2)**

No Asbestos

**B00C - R1027 - Movement (16.3 m2)**

No Asbestos

**B00C - R1028 - Stairs (5.86 m2)**

No Asbestos

**B00C - R1029 - Stairs (5.81 m2)**

No Asbestos

**B00C - R1030 - Stairs (21.29 m2)**

No Asbestos

**B00C - R1031 - Stairs (21.33 m2)**

No Asbestos

**B00C - R1032 - Home Base Store (6.27 m2)**

Decorative Coating Vermiculite  
 4436/B00C/R0037/Decorative Coating/S19 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Seminar/Study (8.91 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0002 - K.L.A. Store (49.48 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0003 - Reading Area (118.95 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0004 - External Movement (6.31 m2)**

No Asbestos

**B00L - R0005 - Cleaning Distributed Store (2.18 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0006 - Toilets - Boys (2.76 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0007 - Movement (11.98 m2)**

No Asbestos

**B00L - R0008 - Toilets - Girls (2.81 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0009 - Distribution Board (0.48 m2)**

Note: No inspection of live electrical installation.

In-fill-panel	Flat AC Sheeting	2m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3)
4436/B00A/R0011/In-fill-panel/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0010 - Library Office/Workroom (21.53 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4436/B0PS/R9002/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		

**B00L - R0011 - Communications Room (12.3 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00L - R0012 - Library Office/Workroom (9.44 m2)**

Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - R0013 - Seminar/Study (8.67 m2)**

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00L - R0014 - External Movement (6.31 m2)**

No Asbestos

**B00L - R0015 - Stairs (12.48 m2)**

No Asbestos

**B00L - R0016 - Lift (1.54 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - General Learning - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00P - R0001 - External Movement (7.33 m2)**

No Asbestos

**B00P - R0002 - Home Base (50.3 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00P - R0003 - Practical Activities - 1hb (19.17 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B0PS/R9002/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

**B00P - R0004 - Movement (38.21 m2)**

No Asbestos

**B00P - R0005 - Movement (10.72 m2)**

No Asbestos

**B00P - R0006 - Distribution Board (0.88 m2)**

Note: No inspection of live electrical installation.

In-fill-panel	Flat AC Sheeting	2m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00A/R0011/In-fill-panel/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4436/B00P/R0006/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

**B00P - R0007 - Cleaning Distributed Store (0.45 m2)**

In-fill-panel	Flat AC Sheeting	2m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00A/R0011/In-fill-panel/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B0PS/R0008/Wall Linings Internal/S7					Chrysotile (white asbestos)

**B00P - R0008 - Practical Activities - 1hb (18.45 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B0PS/R9002/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

**B00P - R0009 - Home Base (49.82 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00P - R0010 - Withdrawal Space - 1hb (11.09 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00P - R0011 - External Movement (7.64 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00P - R0012 - Home Base (50.12 m2)**

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00P - R0013 - Practical Activities - 1hb (18.6 m2)**

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles 19m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
 4436/B0PS/R9002/Floor Coverings Res/Textile/S5 **Chrysotile (white asbestos)**

**B00P - R0014 - Practical Activities - 1hb (19.14 m2)**

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles 20m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
 4436/B0PS/R9002/Floor Coverings Res/Textile/S5 **Chrysotile (white asbestos)**

**B00P - R0015 - Home Base (49.81 m2)**

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00P - R0016 - Withdrawal Space - 1hb (11 m2)**

Ceiling Structures/Linings Vermiculite  
 4436/B00B/R0011/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00P - R0017 - External Movement (7.34 m2)**

No Asbestos

**B00P - R0018 - External Movement (7.64 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00Q - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00Q - R0001 - Communal Space (200.19 m2)**

No Asbestos

**B00Q - R0002 - Raised Platform (58.15 m2)**

No Asbestos

**B00Q - R0003 - Movement (6.62 m2)**

No Asbestos

**B00Q - R0004 - Movement (16.68 m2)**

No Asbestos

**B00Q - R0005 - Movement (11.37 m2)**

No Asbestos

**B00Q - R0006 - Hall Chair Store (12.75 m2)**

No Asbestos

**B00Q - R0007 - Communal/Performance Store (10.37 m2)**

No Asbestos

**B00Q - R0008 - P.E. Store (16.4 m2)**

No Asbestos

**B00Q - R0009 - Toilets - Girls (7.07 m2)**

No Asbestos

**B00Q - R0010 - Toilet - Lobby (2.45 m2)**

No Asbestos

**B00Q - R0011 - Sound Cupboard (2.11 m2)**

No Asbestos

**B00Q - R0012 - Toilets - Boys (5.58 m2)**

No Asbestos

**B00Q - R0013 - Toilet - Lobby (3.24 m2)**

No Asbestos

**B00Q - R0014 - Cleaning Distributed Store (5.36 m2)**

No Asbestos

**B00Q - R0015 - Distribution Board (3.35 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00Q - R0016 - Disabled Shower/Toilet (6.86 m2)**

No Asbestos

**B00Q - R0017 - Covered Outdoor Learning Area (194.07 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00R - Other-After School Care - 1997 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting 4436/B00R/Eaves Linings/S9					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris 4436/B00R/Underfloor Voids/S10					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 4436/B00R/Wall Cladding/S13					No Asbestos Detected

**Interior****B00R - R0001 - Home Base (41.23 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4436/B00R/R0002/Ceiling Structures/Linings/S11	42m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4436/B00R/R0001/Floor Coverings Res/Textile/S12	42m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

**B00R - R0002 - Clerical Office (11.33 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4436/B00R/R0002/Ceiling Structures/Linings/S11	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4436/B00R/R0001/Floor Coverings Res/Textile/S12	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

**B00R - R0003 - Practical Activities (16.96 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4436/B00R/R0002/Ceiling Structures/Linings/S11	17m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4436/B00R/R0001/Floor Coverings Res/Textile/S12	17m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

**B00R - R0004 - External Movement (2.15 m2)**

No Asbestos

**B00R - R0005 - Home Base (68.94 m2)**

No Asbestos

**B00R - R0006 - External Movement (6.19 m2)**

No Asbestos

**B00R - R0007 - Movement (3.57 m2)**

No Asbestos

**B00R - R0008 - Toilets - Boys (2.03 m2)**

No Asbestos

**B00R - R0009 - Toilets - Girls (2.01 m2)**

No Asbestos

**B00R - R0010 - Toilets-Unisex (5.12 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B0PS - Communal Facilities/General Learning - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B0PS - R0001 - External Movement (2.9 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	4436/B0PS/R0001/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>

**B0PS - R0002 - Communal Space (174.95 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B0PS - R0003 - Plant (5.49 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0PS - R0004 - Hall Chair Store (5.41 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0PS - R0005 - Raised Platform (37.55 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B0PS - R0006 - Movement (7.08 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B0PS - R0007 - Distribution Board (0.69 m2)**

Note: No inspection of live electrical installation.						
In-fill-panel	Flat AC Sheeting	2m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00A/R0011/In-fill-panel/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	2m2	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4436/B0PS/R0008/Wall Linings Internal/S7					<b>Chrysotile (white asbestos)</b>

**B0PS - R0008 - Cleaning Distributed Store (0.36 m2)**

In-fill-panel	Flat AC Sheeting	2m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B00A/R0011/In-fill-panel/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B0PS/R0008/Wall Linings Internal/S7					<b>Chrysotile (white asbestos)</b>

**B0PS - R0009 - Practical Activities - 1hb (19.25 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4436/B0PS/R9002/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B0PS - R0010 - Home Base (48.8 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0PS - R0011 - Withdrawal Space - 1hb (11.26 m2)**

Ceiling Structures/Linings	Vermiculite					
	4436/B00B/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0PS - R0012 - Home Base (49.36 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0PS - R0013 - Practical Activities - 1hb (19.07 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4436/B0PS/R9002/Floor Coverings Res/Textile/S5	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0PS - R0014 - Movement (7.1 m2)</b>						
No Asbestos						
<b>B0PS - R0015 - External Movement (2.9 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4436/B0PS/R0001/Ceiling Structures/Linings/S6					No Asbestos Detected
<b>B0PS - R0016 - Stairs (7.12 m2)</b>						
No Asbestos						
<b>B0PS - R0017 - Stairs (7.01 m2)</b>						
No Asbestos						
<b>B0PS - R1001 - Movement (30.86 m2)</b>						
No Asbestos						
<b>B0PS - R1002 - Practical Activities - 1hb (19.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B0PS/R9002/Floor Coverings Res/Textile/S5	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0PS - R1003 - Home Base (49.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0PS - R1004 - Withdrawal Space - 1hb (11.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0PS - R1005 - Home Base (49.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0PS - R1006 - Practical Activities - 1hb (19.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4436/B00B/R0011/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4436/B0PS/R9002/Floor Coverings Res/Textile/S5	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0PS - R1007 - Movement (16.92 m2)</b>						
No Asbestos						
<b>B0PS - R1008 - Movement (16.92 m2)</b>						
No Asbestos						
<b>B0PS - R9001 - Uniform Shop (16.17 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0PS - R9002 - Cleaning Supplies (7.95 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4436/B0PS/R9002/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0PS - R9003 - Toilets - Girls (28.76 m2)</b>						
No Asbestos						
<b>B0PS - R9004 - External Movement (33.84 m2)</b>						
No Asbestos						
<b>B0PS - R9005 - Toilets - Boys (28.84 m2)</b>						
No Asbestos						
<b>B0PS - R9006 - P.E. Store (25.15 m2)</b>						
No Asbestos						
<b>B0PS - R9007 - Movement (34.79 m2)</b>						
No Asbestos						
<b>B0PS - R9008 - Stairs (6.31 m2)</b>						
No Asbestos						
<b>B0PS - R9009 - Stairs (6.05 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D18173 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 19/03/2012**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017