


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Willmot Public School (4470)  
**Region :** Western Sydney  
**State Electorate :** Londonderry  
**Local Government Area :** Blacktown

**Initial Survey :** Noel Arnold & Associates : 22 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 03 - May - 2015

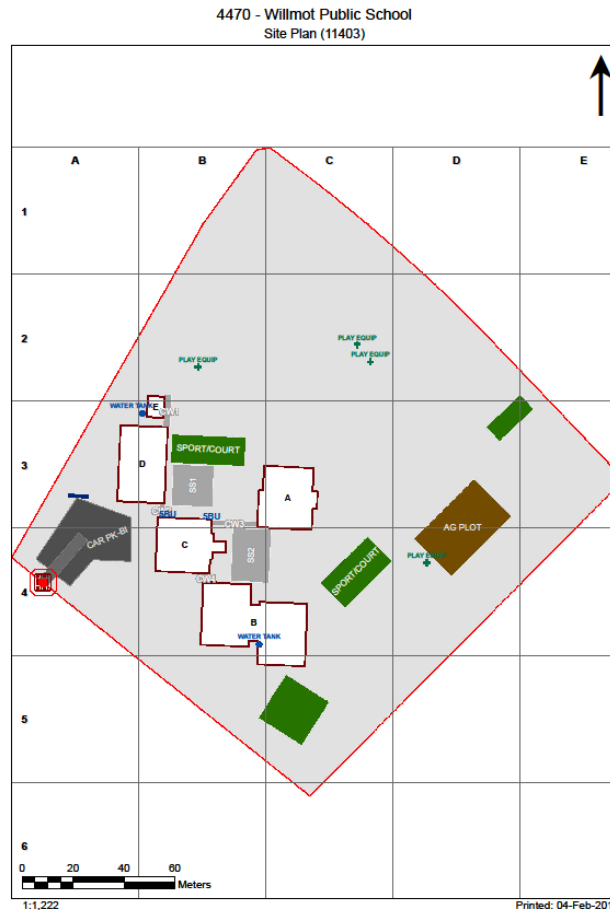

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill Panels under Windows	Compressed AC Sheet	40m2	North & South (Ground & First Floors)	Good Condition (1)	Low (1)	Low Priority (2-3)
4470/B00B/Infill Panels under Windows/S10					<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00A - R0004 - General Storeroom (4.69 m2)**

Kiln	Encapsulated Insulation material within unit					<b>No Asbestos Detected</b>
4470/B00A/R0004/Kiln/S12						

**B00A - R0005 - Home Base (69.15 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4470/B00B/R0015/Ceiling Structures/Linings/S17						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4470/B00C/R0021/Floor Coverings Res/Textile/S16					<b>Chrysotile (white asbestos)</b>	

**B00A - R0006 - Home Base (68.31 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4470/B00B/R0015/Ceiling Structures/Linings/S17						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4470/B00C/R0021/Floor Coverings Res/Textile/S16					<b>Chrysotile (white asbestos)</b>	

**B00A - R0007 - Distribution Board (0.73 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4470/B00B/R0029/Electrical Backing Board/S14					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4470/B00C/R1003/Wall Linings Internal/S13					<b>Chrysotile (white asbestos)</b>	

**B00A - R0008 - Cleaning Distributed Store (3.63 m2)**

No Asbestos

**B00A - R0011 - External Movement (37.16 m2)**

No Asbestos

**B00A - R0013 - External Stairs (11.41 m2)**

No Asbestos

**B00A - R0014 - External Stairs (11.33 m2)**

No Asbestos

**B00A - R0015 - Movement (19.31 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4470/B00B/R0015/Ceiling Structures/Linings/S17						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0016 - Other-Community Use (36.14 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4470/B00B/R0015/Ceiling Structures/Linings/S17						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0017 - Other-Community Use (102.03 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4470/B00B/R0015/Ceiling Structures/Linings/S17						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4470/B00C/R0021/Floor Coverings Res/Textile/S16	103m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0018 - Other-Community Use (23.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0019 - Other-Community Use (12.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4470/B00C/R0021/Floor Coverings Res/Textile/S16	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0020 - External Movement (81.18 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Home Base (68.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4470/B00C/R0021/Floor Coverings Res/Textile/S16	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1002 - External Movement (10.09 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Movement (55.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00A - R1004 - Home Base (69.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4470/B00C/R0021/Floor Coverings Res/Textile/S16	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1005 - Home Base (68.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4470/B00C/R0021/Floor Coverings Res/Textile/S16	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1006 - External Movement (9.42 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Home Base (69.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - R1008 - External Stairs (16.69 m2)**

No Asbestos

**B00A - R1009 - External Stairs (16.7 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning/Pupil Facilities - 1973 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill Panels under Windows	Compressed AC Sheet	80m2	Throughout (Upper and Lower floors)	Good Condition (1)	Low (1)	Low Priority (2-3)
4470/B00B/Infill Panels under Windows/S10				Chrysotile (white asbestos)		

**Interior****B00B - R0001 - Movement (198.35 m2)**

No Asbestos

**B00B - R0002 - General Storeroom (12.35 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0003 - General Storeroom (12.32 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0004 - Toilets - Boys/Girls (3.27 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0005 - Personal Effects Storage (6.85 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0006 - Home Base (79.99 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0007 - Home Base Store (5.4 m2)**

No Asbestos

**B00B - R0008 - Home Base (79.88 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0009 - Home Base Store (4.55 m2)**

No Asbestos

**B00B - R0010 - Toilets - Boys/Girls (14.06 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0011 - Movement (6 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00B - R0012 - Home Base Store (4.49 m2)**

No Asbestos

**B00B - R0013 - Home Base (99.49 m2)**

Ceiling Structures/Linings	Vermiculite	4470/B00B/R0015/Ceiling Structures/Linings/S17				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0014 - Toilets - Boys/Girls (4.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0015 - Movement (82.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0016 - Toilets - Boys/Girls (4.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0017 - Cleaning Supplies (9.56 m2)</b>						
No Asbestos						
<b>B00B - R0018 - Movement (4.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0019 - Security Store (4.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0020 - Home Base Store (7.98 m2)</b>						
No Asbestos						
<b>B00B - R0021 - Toilets - Boys/Girls (6.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0022 - Home Base (97.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0023 - Cleaning Distributed Store (4.8 m2)</b>						
No Asbestos						
<b>B00B - R0024 - General Storeroom (19.69 m2)</b>						
No Asbestos						
<b>B00B - R0025 - Toilets - Boys (54.9 m2)</b>						
No Asbestos						
<b>B00B - R0026 - Toilets - Girls (50.35 m2)</b>						
No Asbestos						
<b>B00B - R0027 - Stairs (12.03 m2)</b>						
No Asbestos						
<b>B00B - R0028 - Stairs (4.97 m2)</b>						
No Asbestos						
<b>B00B - R0029 - Plant (0.48 m2)</b>						
Electrical Backing Board	Resinous Board	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4470/B00B/R0029/Electrical Backing Board/S14					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	East Wall and Doors	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4470/B00C/R1003/Wall Linings Internal/S13					Chrysotile (white asbestos)
<b>B00B - R1001 - Home Base (66.51 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1002 - Cleaning Distributed Store (0.38 m2)</b>						
No Asbestos						
<b>B00B - R1003 - General Storeroom (18.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1004 - Home Base (66.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1005 - Home Base (64.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1006 - Home Base (66.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1007 - Home Base (66.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1008 - Home Base (66.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00B - R1009 - Movement (114.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00B - R1010 - Home Base (66.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00B/R0015/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1011 - Home Base (66.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1012 - Stairs (8.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00B/R0015/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1013 - Stairs (17.57 m2)</b>						
No Asbestos						
<b>B00B - R1014 - Plant (0.36 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4470/B00C/R1003/Wall Linings Internal/S13					Chrysotile (white asbestos)

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/Library - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill Panels under Windows	Flat AC Sheeting					
	4470/B00C/Infill Panels under Windows/S11					<b>No Asbestos Detected</b>

**Interior**

**B00C - R0001 - Movement (20.96 m2)**

No Asbestos

**B00C - R0002 - Staff Room (75.04 m2)**

Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4470/B00C/R0021/Floor Coverings Res/Textile/S16					<b>Chrysotile (white asbestos)</b>

**B00C - R0003 - Staff Kitchen (6.25 m2)**

Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4470/B00C/R0021/Floor Coverings Res/Textile/S16					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Cleaning Distributed Store (2.68 m2)**

No Asbestos

**B00C - R0006 - Distribution Board (0.57 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0007 - Community Clinic (15.87 m2)**

Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4470/B00C/R0021/Floor Coverings Res/Textile/S16					<b>Chrysotile (white asbestos)</b>

**B00C - R0008 - Community Clinic (5.69 m2)**

Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4470/B00C/R0021/Floor Coverings Res/Textile/S16					<b>Chrysotile (white asbestos)</b>

**B00C - R0009 - Staff Toilet (8.12 m2)**

Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00C - R0010 - Staff Toilet (10.93 m2)**

Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					<b>Limited Samples Taken</b>
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00C - R0011 - Staff Toilet (3.24 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00C - R0012 - Deputy Principal (14.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0014 - Principal (16.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0015 - Staff Toilet (2.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00C - R0016 - General Storeroom (1.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0017 - Interview (10.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0018 - Staff Room Annexe (15.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0019 - General Storeroom (10.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0020 - Duplicating Workroom (15.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0021 - Security Store (12.21 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0022 - Movement (92.94 m2)</b>						
No Asbestos						
<b>B00C - R0023 - Stairs (8.62 m2)</b>						
No Asbestos						
<b>B00C - R0024 - Entry Vestibule (50.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0025 - Clerical Office (15.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0026 - Clerical Office (12.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0027 - Movement (14.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4470/B00C/R0021/Floor Coverings Res/Textile/S16	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1001 - Movement (19.42 m2)</b>						
No Asbestos						
<b>B00C - R1002 - Toilets - Girls (4.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00C - R1003 - Distribution Board (0.42 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Wall Linings Internal	Flat AC Sheeting 4470/B00C/R1003/Wall Linings Internal/S13	4m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1004 - Cleaning Distributed Store (1.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R1005 - Toilets - Boys (2.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1006 - Library Office/Workroom (12.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1007 - Library Office/Workroom (12.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1008 - Movement (28.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1009 - Reading Area (185.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1010 - K.L.A. Store (6.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1011 - K.L.A. Store (19.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4470/B00C/R0021/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
<b>B00C - R1012 - Home Base (52.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4470/B00C/R0010/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1013 - Stairs (8.62 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Communal Facilities/Pupil Facilities - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00D - R0001 - Movement (117.36 m2)**

No Asbestos

**B00D - R0002 - Toilets - Boys (54.09 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 4470/B00D/R0002/Partition Walls (Cubicles)/S15	No Asbestos Detected
----------------------------	-----------------------------------------------------------------------	----------------------

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R0003 - Cleaning Distributed Store (0.97 m2)**

No Asbestos

**B00D - R0006 - Sports Store (16.11 m2)**

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R0008 - Distribution Board (0.28 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0009 - Movement (3.61 m2)**

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R0012 - Toilets - Girls (55.26 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 4470/B00D/R0002/Partition Walls (Cubicles)/S15	No Asbestos Detected
----------------------------	-----------------------------------------------------------------------	----------------------

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R0013 - Communal Space (207.28 m2)**

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R0014 - Raised Platform (40.05 m2)**

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R0015 - Disabled Shower/Toilet (8.66 m2)**

No Asbestos

**B00D - R0016 - Plant (2.68 m2)**

Ceiling Structures/Linings	Vermiculite 4470/B00C/R0010/Ceiling Structures/Linings/S18	Limited Samples Taken
----------------------------	---------------------------------------------------------------	-----------------------

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Other-Commercial - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Canteen (26.27 m2)**

No Asbestos

**B00E - R0002 - Canteen Office/Store (9.35 m2)**

No Asbestos

**B00E - R0003 - External Movement (10.54 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017