


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Winston Heights Public School (4471)
Region : Western Sydney
State Electorate : Seven Hills
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 01 - May - 2008
Reviewed By : Greencap-NAA : 22 - Jun - 2015

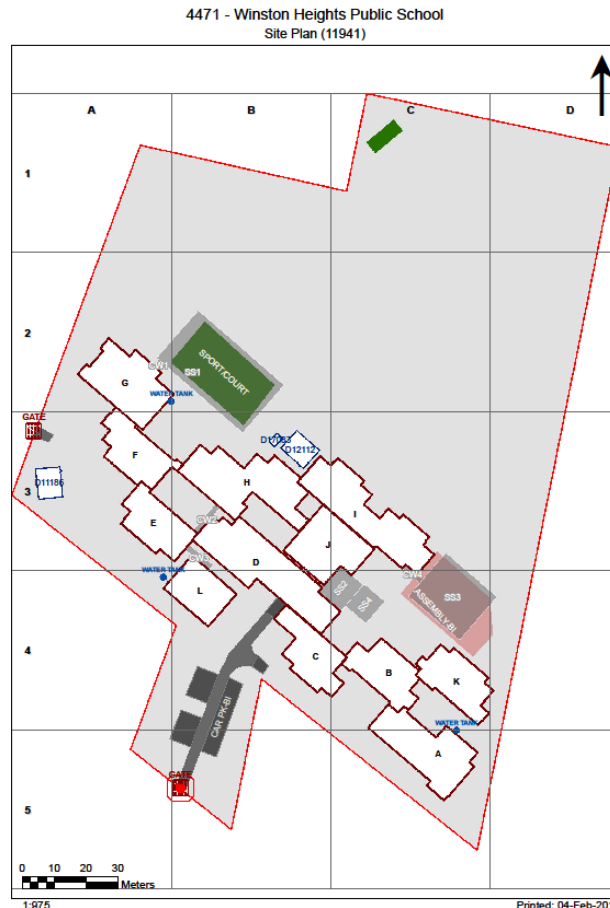

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC behind plywood	12.84m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive pertains to S8					
4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected	

Floor Coverings Res/Textile	Vinyl Sheet					
4471/B00A/R0003/Floor Coverings Res/Textile/S16					No Asbestos Detected	

Floor Coverings Res/Textile	Adhesive pertain to S16					
4471/B00A/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected	

B00A - R0004 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00A - R0005 - Garden Store

No Asbestos

B00A - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive					
4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected	

B00A - R0007 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Withdrawal Space - 1hb

No Asbestos

B00A - R0010 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17.38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive					
4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected	

B00A - R0011 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0012 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00A - R0013 - Movement						
Ceiling Structures/Linings	Flat AC behind plywood	71.23m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00A - R0014 - General Storeroom						
No Asbestos						
B00A - R0015 - General Storeroom						
No Asbestos						
B00A - R0016 - General Storeroom						
No Asbestos						
B00A - R0017 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC behind plywood	24.06m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	41.42m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00B - R0003 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00B - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00C/R0006/Partition Walls (Cubicles)/S5						Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00B - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00B/R0005/Ceiling Structures/Linings/S6						Chrysotile (white asbestos)

Electrical Mounting Board	Resinous Membrane	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	-------------------	-------	-----------	--------------------	---------	--------------------

Assumed Asbestos - Cannot sample - Live.**B00B - R0006 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00C/R0006/Partition Walls (Cubicles)/S5						Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00B - R0007 - Withdrawal Space - 1hb

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0016/Floor Coverings Res/Textile/S2						Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive pertains to S2					
4471/B00C/R0001/Floor Coverings Res/Textile/S13						No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00C - R0001 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
4471/B00D/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive pertains to S2						
4471/B00C/R0001/Floor Coverings Res/Textile/S13					No Asbestos Detected		

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	19.66m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Withdrawal Space - 1hb

No Asbestos

B00C - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00C/R0006/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0006 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00C/R0006/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00C - R0007 - General Assistant/Bulk Store

No Asbestos

B00C - R0008 - Main Switch Board

Wall Linings Internal	Flat AC Sheeting	4m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00C/R0008/Wall Linings Internal/S4					Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Board	2Unit	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Cannot sample - Live						

B00C - R0009 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	72.99m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/Staff Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	124.57m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00D - R0002 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	18.66m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00D - R0003 - Principal

No Asbestos

B00D - R0004 - Community Clinic

No Asbestos

B00D - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0006/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00D - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0006/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00D - R0007 - Staff Room

No Asbestos

B00D - R0008 - Movement

No Asbestos

B00D - R0009 - Movement

No Asbestos

B00D - R0010 - General Storeroom

No Asbestos

B00D - R0011 - Deputy Principal

No Asbestos

B00D - R0012 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	61.12m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00D - R0013 - Movement

No Asbestos

B00D - R0014 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles	9.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

Floor Coverings Res/Textile Adhesive pertains to S2

4471/B00C/R0001/Floor Coverings Res/Textile/S13

No Asbestos Detected

Safe	Encapsulated Insulation material within unit	1Unit	Northwest	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - AC material encased in metal.Thus						

B00D - R0015 - Clerical Office/Workroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0016 - Security Store						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00D/R0016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Safe	Encapsulated Insulation material within unit	2m2	Southwest	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Strong room door. AC material					
Floor Coverings Res/Textile	Adhesive pertains to S2					
	4471/B00C/R0001/Floor Coverings Res/Textile/S13				No Asbestos Detected	
B00D - R0017 - Sick Bay						
No Asbestos						
B00D - R0018 - Entry Vestibule						
No Asbestos						
B00D - R0019 - Principal						
No Asbestos						
B00D - R0020 - General Storeroom						
No Asbestos						
B00D - R0021 - Interview						
No Asbestos						
B00D - R0022 - Canteen						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00D/R0016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00D - R0023 - Canteen Office/Store						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
B00D - R0024 - Canteen Office/Store						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
B00D - R0025 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
B00D - R0026 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Administration - 1978 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting 4471/B00E/Wall Cladding/S1					No Asbestos Detected
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC behind plywood 4471/B00A/R0011/Ceiling Structures/Linings/S7	74.55m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
----------------------------	---	---------	------------	----------------------------	---------	---

B00E - R0002 - Community Clinic

No Asbestos

B00E - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 4471/B00A/R0003/Floor Coverings Res/Textile/S8	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive pertains to S8 4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC behind plywood 4471/B00A/R0011/Ceiling Structures/Linings/S7	26.71m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
----------------------------	---	---------	------------	----------------------------	---------	---

B00E - R0006 - Home Base

No Asbestos

B00E - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 4471/B00A/R0003/Floor Coverings Res/Textile/S8	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive pertains to S8 4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected

B00E - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Membrane	1Unit	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	-------------------	-------	-----------	--------------------	---------	--------------------

Assumed Asbestos - Cannot sample - Live.

B00E - R0009 - Cleaning Distributed Store

No Asbestos

B00E - R0010 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Pupil Facilities - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - General Storeroom

No Asbestos

B00F - R0002 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	25.83m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00F - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive pertains to S2					
4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected	

B00F - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

B00F - R0005 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

B00F - R0006 - Home Base

No Asbestos

B00F - R0007 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	67.16m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00F - R0008 - Home Base

No Asbestos

B00F - R0009 - Music Store

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00D/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive pertains to S2					
4471/B00E/R0003/Floor Coverings Res/Textile/S14					No Asbestos Detected	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	23.17m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00G - R0002 - Communal Space

No Asbestos

B00G - R0003 - Hall Chair Store

No Asbestos

B00G - R0004 - Raised Platform

No Asbestos

B00G - R0005 - Plant

No Asbestos

B00G - R0006 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	18.42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00G - R0007 - P.E. Store

No Asbestos

B00G - R0008 - Hall Chair Store

No Asbestos

B00G - R0009 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00G/R0010/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

B00G - R0010 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00G/R0010/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

Electrical Mounting Board	Resinous Membrane	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	-------------------	-------	-----------	--------------------	---------	--------------------

Assumed Asbestos - Cannot sample - Live.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00H - R0001 - Movement**

Ceiling Structures/Linings	Flat AC behind plywood	58.41m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00H - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
4471/B00I/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive pertains S9					No Asbestos Detected	
4471/B00H/R0002/Floor Coverings Res/Textile/S15							

B00H - R0003 - Home Base

No Asbestos

B00H - R0004 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	19.92m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00H - R0005 - Withdrawal Space - 1hb

No Asbestos

B00H - R0006 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	11.65m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00H - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
4471/B00I/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive pertains S9					No Asbestos Detected	
4471/B00H/R0002/Floor Coverings Res/Textile/S15							

B00H - R0008 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	11.35m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00H - R0009 - Home Base

No Asbestos

B00H - R0010 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00H - R0011 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00H - R0012 - Cleaning Distributed Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00H - R0013 - Movement						
Ceiling Structures/Linings	Flat AC behind plywood	45.84m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00H - R0014 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00H - R0015 - Distribution Board				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00H - R0016 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00H - R0017 - Movement						
Ceiling Structures/Linings	Flat AC behind plywood	17.01m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00H - R0018 - Withdrawal Space - 1hb						
Recently Modified Space	Requires Inspection					
B00H - R0019 - Computer Room						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Pupil Facilities - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B001 - R0001 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
4471/B001/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive pertains to S9					No Asbestos Detected	
4471/B00H/R0002/Floor Coverings Res/Textile/S15							

B001 - R0002 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	93.04m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B001 - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
4471/B001/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive pertains to S9					No Asbestos Detected	
4471/B00H/R0002/Floor Coverings Res/Textile/S15							

B001 - R0004 - Movement

No Asbestos

B001 - R0005 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	17.41m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B001 - R0006 - Home Base

No Asbestos

B001 - R0007 - Withdrawal Space - 1hb

No Asbestos

B001 - R0008 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B001/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B001 - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B001/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Membrane	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Cannot sample - Live.

B001 - R0010 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B001/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	7.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00I - R0011 - Movement						
No Asbestos						
B00I - R0012 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00I - R0013 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00I/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	4471/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00I - R0014 - Withdrawal Space - 1hb						
No Asbestos						
B00I - R0015 - Movement						
Ceiling Structures/Linings	Flat AC behind plywood	18.69m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00I - R0016 - Home Base						
No Asbestos						
B00I - R0017 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00J - R0001 - K.L.A. Store

No Asbestos

B00J - R0002 - K.L.A. Store

No Asbestos

B00J - R0003 - General Storeroom

No Asbestos

B00J - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Membrane	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	-------------------	-------	-----------	--------------------	---------	--------------------

Assumed Asbestos - Cannot sample - live.

B00J - R0005 - Library Office/Workroom

No Asbestos

B00J - R0006 - Library Office/Workroom

No Asbestos

B00J - R0007 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	21.17m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0008 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	8.64m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0009 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	9.72m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0010 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00J - R0011 - Reading Area

No Asbestos

B00J - R0012 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1976 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00K - R0001 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	35.89m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00K - R0002 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	10.41m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00K - R0003 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Membrane	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Cannot sample - live.

B00K - R0004 - Sports Store

No Asbestos

B00K - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0003/Floor Coverings Res/Textile/S8						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive pertains to S8					
4471/B00E/R0003/Floor Coverings Res/Textile/S14						No Asbestos Detected

B00K - R0006 - Movement

No Asbestos

B00K - R0007 - Movement

Ceiling Structures/Linings	Flat AC behind plywood	24.88m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4471/B00A/R0011/Ceiling Structures/Linings/S7						Chrysotile (white asbestos)

B00K - R0008 - Home Base

No Asbestos

B00K - R0009 - Home Base

No Asbestos

B00K - R0010 - Movement

No Asbestos

B00K - R0011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00A/R0003/Floor Coverings Res/Textile/S8						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive pertains to S8					
4471/B00E/R0003/Floor Coverings Res/Textile/S14						No Asbestos Detected

B00K - R0012 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B00I/R0013/Partition Walls (Cubicles)/S11						Chrysotile (white asbestos)

B00K - R0013 - Toilets - Boys

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4471/B001/R0013/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00L - R0001 - Home Base

No Asbestos

B00L - R0002 - Home Base Store

No Asbestos

B00L - R0003 - Practical Activities - 1hb

No Asbestos

B00L - R0004 - Withdrawal Space - 2hb

No Asbestos

B00L - R0005 - Home Base

No Asbestos

B00L - R0006 - Home Base Store

No Asbestos

B00L - R0007 - Practical Activities - 1hb

No Asbestos

B00L - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11186 - Learning Unit - Standard With P.A.A. : Placement Date - 26/11/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12112 - Learning Unit - Standard With P.A.A. : Placement Date - 20/11/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 837 - D17083 - Hcap Shower/Change/Toilet : Placement Date - 1/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

OS 602 - D18200 - Learning Unit - Standard With P.A.A. : Placement Date - 12/10/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017