


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Werrington Public School (4473)
Region : Western Sydney
State Electorate : Londonderry
Local Government Area : Penrith

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Register Issue Date : 10 - Jul - 2017

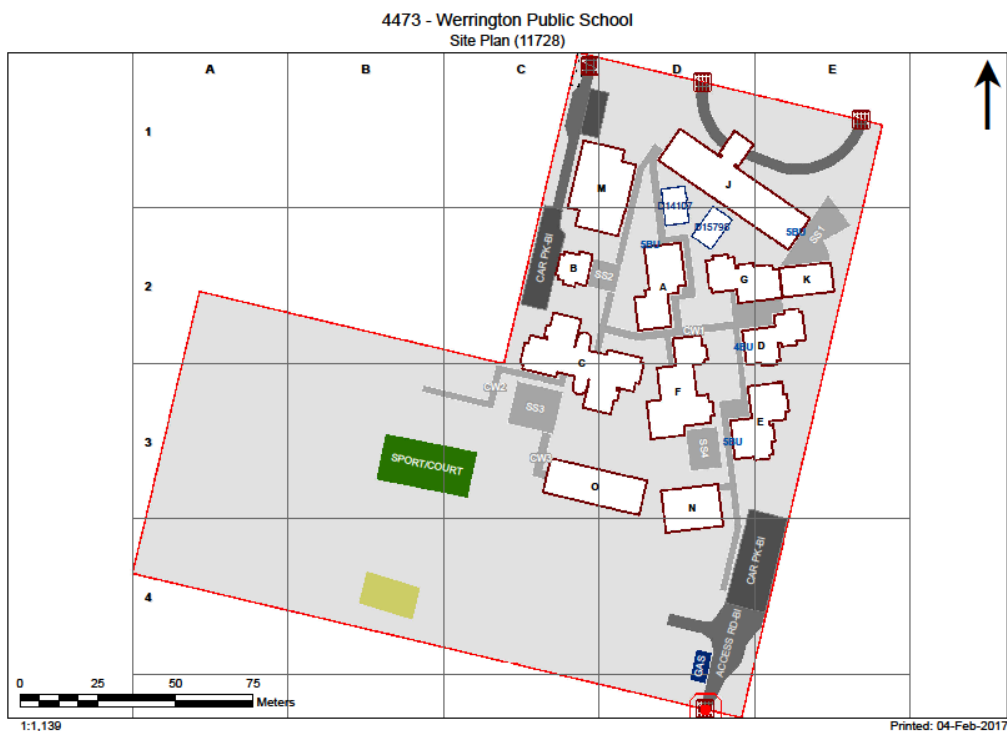

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior**B00A - R0001 - Entry Vestibule (20.06 m2)**

No Asbestos

B00A - R0002 - Clerical Office (18 m2)

No Asbestos

B00A - R0003 - Distribution Board (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0004 - Sick Bay (9.78 m2)

No Asbestos

B00A - R0005 - Staff Toilet (7.31 m2)

No Asbestos

B00A - R0006 - Movement (46.13 m2)

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

B00A - R0007 - Deputy Principal (13.81 m2)

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

B00A - R0008 - Interview (15.58 m2)

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

Floor Coverings Res/Textile	Vinyl Tiles	4m2	At sink	Good Condition (1)	Low (1)	Low Priority (2-3)		
	4473/B00C/R0011/Floor Coverings Res/Textile/S1							Chrysotile (white asbestos)

B00A - R0009 - Cleaning Distributed Store (0.93 m2)

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

B00A - R0010 - Distribution Board (0.61 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

B00A - R0011 - Staff Toilet (2.54 m2)

No Asbestos

B00A - R0012 - Disabled Toilet (6.41 m2)

No Asbestos

B00A - R0013 - Clerical Office/Workroom (15.13 m2)

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

B00A - R0014 - General Storeroom (2.31 m2)

Ceiling Structures/Linings	Vermiculite							
	4473/B00C/R0017/Ceiling Structures/Linings/S3							Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works								

B00A - R0015 - Staff Toilet (2.51 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

Ceiling Structures/Linings Vermiculite
 4473/B00C/R0017/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0016 - Principal (18.94 m2)

Ceiling Structures/Linings Vermiculite
 4473/B00C/R0017/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0017 - Security Store (17.14 m2)

No Asbestos

B00A - R0018 - Duplicating Workroom (32.77 m2)

No Asbestos

B00A - R0019 - Clerical Office/Workroom (14.81 m2)

No Asbestos

B00A - R0020 - Movement (2.47 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Building Services - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00B - R0001 - Canteen (29.29 m2)

No Asbestos

B00B - R0005 - Staff Toilet (1.64 m2)

No Asbestos

B00B - R0006 - Community Clinic (9.62 m2)

No Asbestos

B00B - R0007 - Community Clinic (7.71 m2)

No Asbestos

B00B - R0008 - Security Store (1.77 m2)

No Asbestos

B00B - R0009 - Cleaning Supplies (7.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00E/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00B - R0010 - Movement (6.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0011 - Distribution Board (6.32 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0012 - Cleaning Distributed Store (4.27 m2)

No Asbestos

B00B - R0014 - Movement (3.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0015 - Movement (3.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0016 - Movement (1.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior**B00C - R0001 - Toilets - Girls (18.72 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

B00C - R0002 - Movement (6.14 m2)

No Asbestos

B00C - R0003 - Sports Store (4.62 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00C - R0004 - Distribution Board (1.53 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00C - R0005 - Home Base (73.7 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0006 - Home Base (58 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0007 - Practical Activities - 1hb (11.36 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00C - R0008 - Movement (3.55 m2)

No Asbestos

B00C - R0009 - Movement (6.81 m2)

No Asbestos

B00C - R0010 - Movement (123.42 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0011 - Distribution Board (1.55 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00C - R0012 - Security Store (4.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00C - R0013 - Movement (6.5 m2)

No Asbestos

B00C - R0014 - Toilets - Boys (18.8 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
B00C - R0015 - Garden Store (5.55 m2)						
No Asbestos						
B00C - R0016 - Garden Store (5.98 m2)						
No Asbestos						
B00C - R0017 - Home Base (61.65 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - Movement (6.71 m2)						
No Asbestos						
B00C - R0019 - Practical Activities - 1hb (10.72 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0020 - Home Base (64.05 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0021 - Movement (3.4 m2)						
No Asbestos						
B00C - R0022 - Practical Activities - 1hb (8.49 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0023 - Stairs (11.15 m2)						
No Asbestos						
B00C - R0024 - Stairs (12.22 m2)						
No Asbestos						
B00C - R1001 - Toilets - Girls (19.39 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00C - R1002 - Movement (6.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00C - R1003 - Security Store (4.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1004/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00C - R1004 - Distribution Board (1.9 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1004/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
B00C - R1005 - Home Base (63.22 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1006 - Practical Activities - 1hb (12.07 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1007 - Home Base (65.1 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1008 - Practical Activities - 1hb (8.92 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1009 - Movement (104.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	105m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1009/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	
B00C - R1010 - Cleaning Distributed Store (1.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1009/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1004/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
B00C - R1011 - General Storeroom (4.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1009/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1004/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
B00C - R1012 - Toilets - Boys (19.39 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R0014/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1009/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	
B00C - R1013 - Movement (6.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1009/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	
B00C - R1014 - Home Base (61.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1015 - Practical Activities - 1hb (12.13 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1016 - Home Base (64.81 m2)						
Ceiling Structures/Linings	Vermiculite		4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1017 - Practical Activities - 1hb (7.99 m2)						
Ceiling Structures/Linings	Vermiculite		4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1018 - Stairs (6.83 m2)						
No Asbestos						
B00C - R1019 - Stairs (6.7 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					
Interior						
B00D - R0001 - Home Base (72.06 m2)						
Ceiling Structures/Linings	Vermiculite 4473/B00C/R0017/Ceiling Structures/Linings/S3				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 4473/B00E/R0009/Floor Coverings Res/Textile/S6	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0002 - Personal Effects Storage (0.95 m2)						
Ceiling Structures/Linings	Vermiculite 4473/B00C/R0017/Ceiling Structures/Linings/S3				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Ceiling Structures/Linings	Flat AC Sheeting 4473/B00C/R1009/Ceiling Structures/Linings/S4	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0004 - Movement (4.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4473/B00C/R1009/Ceiling Structures/Linings/S4	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0005 - Home Base (75.95 m2)						
Ceiling Structures/Linings	Vermiculite 4473/B00C/R0017/Ceiling Structures/Linings/S3				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 4473/B00E/R0009/Floor Coverings Res/Textile/S6	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0006 - Movement (4.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4473/B00C/R1009/Ceiling Structures/Linings/S4	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0007 - Personal Effects Storage (5.42 m2)						
Ceiling Structures/Linings	Vermiculite 4473/B00C/R0017/Ceiling Structures/Linings/S3				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 4473/B00E/R0009/Floor Coverings Res/Textile/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0008 - Home Base Store (3.12 m2)						
Ceiling Structures/Linings	Vermiculite 4473/B00C/R0017/Ceiling Structures/Linings/S3				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 4473/B00E/R0009/Floor Coverings Res/Textile/S6	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0009 - Toilets - Girls (10.23 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 4473/B00C/R0014/Partition Walls (Cubicles)/S2	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0010 - Distribution Board (0.54 m2)						
Note: No inspection of live electrical installation.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00D - R0011 - Toilets - Boys (11.16 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	------------	--------------------	---------	--------------------

4473/B00C/R0014/Partition Walls (Cubicles)/S2

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior**B00E - R0001 - Personal Effects Storage (1.34 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00E/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00E - R0002 - Practical Activities - 1hb (18.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00E/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00E - R0003 - Home Base (83.35 m2)

No Asbestos

B00E - R0004 - Toilets - Boys/Girls (3.23 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00E - R0005 - Movement (5.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00E - R0006 - Toilets - Boys/Girls (3.11 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00E - R0007 - Home Base (80.24 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00E - R0008 - Practical Activities - 1hb (18.7 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00E/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00E - R0009 - Home Base Store (4.43 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00E/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00E - R0010 - Distribution Board (0.62 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00E - R0011 - Personal Effects Storage (4.16 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00E - R0012 - Movement (5.5 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00E - R0013 - Movement (4.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00E - R0014 - Cleaning Distributed Store (1.27 m2)						
No Asbestos						
B00E - R0015 - Craft Store (4.18 m2)						
No Asbestos						
B00E - R0016 - Toilets - Girls (10 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
B00E - R0017 - Toilets - Boys (11.31 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - Library/Staff Facilities - 1991 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Requires Inspection					
Interior						
B00F - R0001 - Movement (4.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B00F - R0002 - Staff Toilet (4.18 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0003 - Staff Room Annexe (24.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00F - R0004 - Staff Room (62.89 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00F - R0005 - Staff Toilet (4.15 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0006 - Movement (15.95 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0010 - Library Office/Workroom (8.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0011 - Security Store (16.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0012 - Library Office/Workroom (19.54 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0013 - Cleaning Distributed Store (2.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4473/B00C/R0017/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00F - R0014 - Toilets - Girls (3.71 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0015 - Distribution Board (2.12 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0011/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00F - R0016 - Toilets - Boys (3.63 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0017 - Movement (4.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00F - R0018 - Interview (7.74 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0019 - Reading Area (139.13 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0020 - Special Programs Room (60.01 m2)						
Ceiling Structures/Linings	Vermiculite					
4473/B00C/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - General Learning/Support Unit - 1974 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					
Interior						
B00G - R0001 - Movement (29.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00G - R0002 - Disabled Toilet (11.16 m2)						
No Asbestos						
B00G - R0003 - Toilets - Girls (10.02 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R0014/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
B00G - R0004 - Distribution Board (0.59 m2)						
No Asbestos						
Note: No inspection of live electrical installation.						
B00G - R0005 - Home Base Store - P (3.07 m2)						
Ceiling Structures/Linings	Vermiculite	4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0006 - Personal Effects - P (5.53 m2)						
Ceiling Structures/Linings	Vermiculite	4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0007 - Practical Activities - P - 1hb (14.57 m2)						
Ceiling Structures/Linings	Vermiculite	4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0008 - Home Base - P (59.32 m2)						
Ceiling Structures/Linings	Vermiculite	4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0009 - Home Base (72.25 m2)						
Ceiling Structures/Linings	Vermiculite	4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00E/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00G - R0010 - Personal Effects Storage (1.11 m2)						
Ceiling Structures/Linings	Vermiculite	4473/B00C/R0017/Ceiling Structures/Linings/S3			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0011 - Movement (8.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00G - R0012 - Movement (5.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00G - R0013 - Movement (5.12 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4473/B00C/R1009/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Support Unit - 1976 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior**B00J - R0001 - Home Base - P (66.82 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0002 - Home Base Store - P (7.85 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0003 - Practical Activities - P - 1hb (22.08 m2)

No Asbestos

B00J - R0004 - Movement (16.8 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0005 - Toilet - P (16.85 m2)

No Asbestos

B00J - R0006 - Laundry - P (8.62 m2)

No Asbestos

B00J - R0007 - Cleaning Distributed Store (1.32 m2)

No Asbestos

B00J - R0008 - Toilet - P (16.85 m2)

No Asbestos

B00J - R0009 - Home Base - P (63.44 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0010 - Home Base Store - P (7.54 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0011 - Interview (15.59 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0012 - Wheelchair Store (7.27 m2)

No Asbestos

B00J - R0013 - Movement (11.6 m2)

No Asbestos

B00J - R0014 - Wheelchair Store (7.28 m2)

No Asbestos

B00J - R0015 - Movement (9.63 m2)

No Asbestos

B00J - R0016 - Covered Vehicle Area/Porte Cochere (64.99 m2)

No Asbestos

B00J - R0017 - Cleaning Distributed Store (5.49 m2)

No Asbestos

B00J - R0018 - Community Clinic (33.63 m2)

No Asbestos

B00J - R0019 - Distribution Board (0.36 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0020 - Disabled Toilet (4.3 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00J - R0021 - Staff Toilet (3.05 m2)

No Asbestos

B00J - R0022 - Therapy (43.06 m2)

No Asbestos

B00J - R0023 - Therapy Store (8.57 m2)

No Asbestos

B00J - R0024 - Therapy (38.82 m2)

No Asbestos

B00J - R0025 - Movement (143.64 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Support Unit - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00K - R0001 - Home Base - P (61.85 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00K - R0002 - Home Base Store - P (8.13 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00K - R0003 - Practical Activities - P - 1hb (22.23 m2)

No Asbestos

B00K - R0004 - Toilet - P (12.71 m2)

No Asbestos

B00K - R0005 - Movement (9.18 m2)

No Asbestos

B00K - R0006 - Distribution Board (0.55 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0007 - P.E. Store (24.05 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Communal Facilities/Pupil Facilities - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00M - R0001 - Communal Space (205.8 m2)

No Asbestos

B00M - R0002 - Movement (10.09 m2)

No Asbestos

B00M - R0003 - Raised Platform (50.96 m2)

No Asbestos

B00M - R0004 - Cleaning Distributed Store (6.59 m2)

No Asbestos

B00M - R0005 - Disabled Toilet (4.46 m2)

No Asbestos

B00M - R0006 - Movement (10.88 m2)

No Asbestos

B00M - R0007 - Toilets - Girls (10.37 m2)

No Asbestos

B00M - R0008 - Movement (10.11 m2)

No Asbestos

B00M - R0009 - Shower/Change (2.77 m2)

No Asbestos

B00M - R0010 - Toilets - Boys (9.04 m2)

No Asbestos

B00M - R0011 - Sports Store (17.74 m2)

No Asbestos

B00M - R0012 - Hall Chair Store (11.49 m2)

No Asbestos

B00M - R0013 - General Assistant/Bulk Store (15.17 m2)

No Asbestos

B00M - R0014 - Movement (10.7 m2)

No Asbestos

B00M - R0015 - Staff Kitchen (14.15 m2)

No Asbestos

B00M - R0016 - General Storeroom (0.23 m2)

No Asbestos

B00M - R0017 - Plant (0.32 m2)

No Asbestos

B00M - R0018 - Main Switch Board (7.47 m2)

No Asbestos

B00M - R0019 - Movement (21.89 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00N - R0001 - External Movement (45.93 m2)

No Asbestos

B00N - R0002 - Practical Activities - 1hb (18.94 m2)

No Asbestos

B00N - R0003 - Home Base Store (6.18 m2)

No Asbestos

B00N - R0004 - Home Base (60.13 m2)

No Asbestos

B00N - R0005 - Withdrawal Space - 2hb (11.58 m2)

No Asbestos

B00N - R0006 - Home Base (60.06 m2)

No Asbestos

B00N - R0007 - Home Base Store (6.21 m2)

No Asbestos

B00N - R0008 - Practical Activities - 1hb (19.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - Administration - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior**B000 - R0001 - Movement (56.21 m2)**

No Asbestos

B000 - R0002 - Entry Vestibule (23.14 m2)

No Asbestos

B000 - R0003 - Clerical Office (26.98 m2)

No Asbestos

B000 - R0004 - Duplicating Workroom (23.68 m2)

No Asbestos

B000 - R0005 - Sick Bay (9 m2)

No Asbestos

B000 - R0006 - Sick Bay - Shower/Toilet (5.21 m2)

No Asbestos

B000 - R0007 - Staff Toilet (5.3 m2)

No Asbestos

B000 - R0008 - Cleaning Distributed Store (4.72 m2)

No Asbestos

B000 - R0009 - Main Switch Board (1.39 m2)

No Asbestos

B000 - R0010 - External Movement (6.1 m2)

No Asbestos

B000 - R0011 - Interview (15.64 m2)

No Asbestos

B000 - R0012 - General Storeroom (13.81 m2)

No Asbestos

B000 - R0013 - Staff Room (19.37 m2)

No Asbestos

B000 - R0014 - Staff Room (48.59 m2)

No Asbestos

B000 - R0015 - Staff Toilet (4.85 m2)

No Asbestos

B000 - R0016 - Staff Toilet (4.87 m2)

No Asbestos

B000 - R0017 - Clerical Office (11.94 m2)

No Asbestos

B000 - R0018 - Principal (17.07 m2)

No Asbestos

B000 - R0019 - Interview (12.98 m2)

No Asbestos

B000 - R0020 - External Movement (6.1 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 621 - D14107 - Single Learning Unit - H/Cap : Placement Date - 21/01/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Home Base-I.O.

No Asbestos Found.

R2 - Toilets-Disabled

No Asbestos Found.

R3 - Laundry

No Asbestos Found.

OS 621 - D15798 - Single Learning Unit - H/Cap : Placement Date - 21/01/2016

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2

Interior

R1 - Home Base-I.O.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	77 m2

R2 - Toilets-Disabled

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R3 - Laundry

Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2
---------	---------------	------------------	------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017