


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Widemere Public School (4474)
Region : South Western Sydney
State Electorate : Prospect
Local Government Area : Holroyd

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Jul - 2015

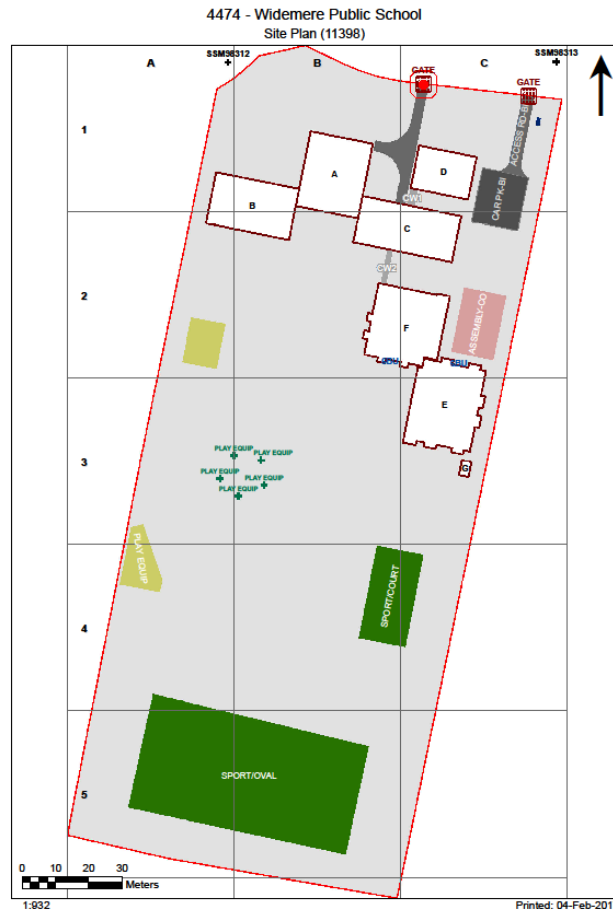

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Support Unit - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00A - R0002 - Practical Activities - 1hb (15.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00A/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	4474/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00A - R0005 - Practical Activities - 1hb (15.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00A/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	4474/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00A - R0007 - External Movement (96.37 m2)

No Asbestos

B00A - R0008 - Home Base (55.14 m2)

No Asbestos

B00A - R0009 - Home Base Store (9.88 m2)

No Asbestos

B00A - R0010 - Home Base Store (9.87 m2)

No Asbestos

B00A - R0011 - Home Base (55.19 m2)

No Asbestos

B00A - R0012 - Home Base (57.03 m2)

No Asbestos

B00A - R0013 - Home Base Store (10.73 m2)

No Asbestos

B00A - R0014 - Home Base Store (10.72 m2)

No Asbestos

B00A - R0015 - Home Base (57.08 m2)

No Asbestos

B00A - R0016 - Distribution Board (0.18 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4474/B00A/R0016/Electrical Backing Board/S30					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Toilets - Girls (17.03 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R0002 - Cleaning Supplies (10.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R0003 - Toilets - Boys (17.07 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R0004 - Toilets - Boys/Girls (3.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R0005 - Practical Activities - 1hb (20.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00B/R0008/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0006 - Home Base (86.27 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00B/R0008/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0007 - Home Base (86.94 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00B/R0008/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0008 - Practical Activities - 1hb (20.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00B/R0008/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0009 - Toilets - Boys/Girls (3.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00B - R0010 - External Movement (99.35 m2)

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0011 - Distribution Board (0.15 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4474/B00A/R0016/Electrical Backing Board/S30					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - Administration/Pupil Facilities - 1972 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00C - R0001 - Main Switch Board (4.58 m2)						
Electrical Backing Board	Resinous Board	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4474/B00C/R0001/Electrical Backing Board/S31					Chrysotile (white asbestos)	
B00C - R0002 - Staff Toilet (3.84 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0003 - Staff Toilet (4.27 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No sample possible - Encapsulated						
B00C - R0004 - General Storeroom (5.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0007/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0021/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00C - R0005 - General Storeroom (12.87 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0006 - Principal (15.48 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0007 - Duplicating Workroom (13.79 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0007/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00C - R0008 - Sick Bay (13.86 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0009 - Movement (32.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0009/Ceiling Structures/Linings/S27					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0010 - Toilets - Girls (15.2 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0011/Partition Walls (Cubicles)/S8				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0011/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
B00C - R0011 - Toilets - Boys (19.32 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0011/Partition Walls (Cubicles)/S8				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0011/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
B00C - R0012 - Staff Toilet (2.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0021/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
B00C - R0013 - Uniform Shop (3.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0021/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
B00C - R0014 - Canteen Office/Store (4.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0007/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0021/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
B00C - R0015 - Canteen (31.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0007/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0021/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
B00C - R0016 - Entry Vestibule (16.66 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00C/R0016/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0017 - Clerical Office (14.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00C/R0016/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0018 - Interview (13.18 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00C/R0016/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0019 - Plant (1.32 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4474/B00C/R0016/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00C/R0007/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)	
B00C - R0020 - Cleaning Distributed Store (0.93 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	
B00C - R0021 - General Storeroom (15.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0007/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4474/B00C/R0021/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00C - R0022 - Movement (22.22 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00C/R0016/Ceiling Structures/Linings/S9					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0023 - External Movement (114.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00C/R0009/Ceiling Structures/Linings/S27					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Staff Facilities/Administration - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Staff Room (98.34 m2)

Ceiling Structures/Linings	Vermiculite					
	4474/B00D/R0001/Ceiling Structures/Linings/S13					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0002 - Staff Toilet (4.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00D/R0002/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit	1Unit	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - unable to sample - Encapsulated						

B00D - R0003 - Movement (13.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00D/R0003/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

B00D - R0004 - Staff Toilet (4.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4474/B00D/R0002/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00D - R0005 - Distribution Board (0.55 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0006 - Community Clinic (15.05 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00D/R0003/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

B00D - R0007 - External Movement (68.61 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - General Learning - 1972 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00E - R0001 - Music Store (14.33 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4474/B00E/R1001/Floor Coverings Res/Textile/S22	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0002 - Home Base (63.8 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0003 - Home Base (63.78 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0004 - Practical Activities - 1hb (13.87 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4474/B00E/R1001/Floor Coverings Res/Textile/S22	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0005 - Home Base (64.47 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0006 - Movement (32.19 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0007 - Disabled Toilet (7.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4474/B00E/R1009/Ceiling Structures/Linings/S24	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0008 - Cleaning Distributed Store (2.93 m2)						
No Asbestos						
B00E - R0009 - Toilets - Girls (8.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4474/B00E/R1009/Ceiling Structures/Linings/S24	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 4474/B00E/R1009/Partition Walls (Cubicles)/S25	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0010 - Distribution Board (0.84 m2)						
No Asbestos						
B00E - R0011 - Security Store (15 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4474/B00E/R1001/Floor Coverings Res/Textile/S22	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0012 - Home Base (64.37 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0013 - Movement (81.03 m2)						
No Asbestos						
B00E - R0014 - General Storeroom (4.81 m2)						
No Asbestos						
B00E - R0015 - Movement (4.2 m2)						
No Asbestos						
B00E - R0016 - Movement (4.2 m2)						
No Asbestos						
B00E - R0017 - Movement (4.2 m2)						
No Asbestos						
B00E - R0018 - Movement (4.2 m2)						
No Asbestos						
B00E - R0019 - Movement (4.2 m2)						
No Asbestos						
B00E - R0020 - Movement (4.2 m2)						
No Asbestos						
B00E - R1001 - Practical Activities - 1hb (14.33 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4474/B00E/R1001/Floor Coverings Res/Textile/S22	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1002 - Home Base (63.8 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1003 - Home Base (64.27 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1004 - Practical Activities - 1hb (13.87 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4474/B00E/R1001/Floor Coverings Res/Textile/S22	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1005 - Home Base (64.47 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1006 - Movement (32.52 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1007 - Toilets - Boys (7.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4474/B00E/R1009/Ceiling Structures/Linings/S24	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 4474/B00E/R1009/Partition Walls (Cubicles)/S25	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1008 - Cleaning Distributed Store (2.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4474/B00E/R1008/Ceiling Structures/Linings/S28	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R1009 - Toilets - Girls (8.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4474/B00E/R1009/Ceiling Structures/Linings/S24	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 4474/B00E/R1009/Partition Walls (Cubicles)/S25	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1010 - Distribution Board (0.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 4474/B00E/R1010/Ceiling Structures/Linings/S23	1m2	All surfaces	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R1011 - Interview (15 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1012 - Home Base (64.37 m2)						
Ceiling Structures/Linings	Vermiculite 4474/B00E/R1012/Ceiling Structures/Linings/S21					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1013 - Movement (75.54 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library/Communal Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - General Storeroom (3.73 m2)

No Asbestos

B00F - R0002 - Movement (58.81 m2)

No Asbestos

B00F - R0003 - Communal Space (235.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4474/B00F/R0003/Floor Coverings Res/Textile/S16					No Asbestos Detected

Ceiling Structures/Linings	Vermiculite					
	4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Infill Panels	Flat AC Sheeting	35m2	South facing, East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00F/R0003/Infill Panels/S17					Chrysotile (white asbestos)

B00F - R0004 - Hall Chair Store (3.92 m2)

No Asbestos

B00F - R0005 - P.E. Store (3.93 m2)

No Asbestos

B00F - R0006 - Cleaning Distributed Store (1.43 m2)

No Asbestos

B00F - R0007 - Toilets - Girls (19.5 m2)

Ceiling Structures/Linings	Vermiculite					
	4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00F/R0007/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)

B00F - R0008 - Sports Store (10.66 m2)

No Asbestos

B00F - R0009 - Toilets - Boys (17.32 m2)

Ceiling Structures/Linings	Vermiculite					
	4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4474/B00F/R0007/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)

B00F - R0010 - Distribution Board (1.82 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0011 - Raised Platform (41.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4474/B00F/R0003/Floor Coverings Res/Textile/S16					No Asbestos Detected

Ceiling Structures/Linings	Vermiculite					
	4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infill Panels	Flat AC Sheeting	2m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00F/R0003/Infill Panels/S17					Chrysotile (white asbestos)	
B00F - R0012 - Movement (13.46 m2)						
No Asbestos						
B00F - R0013 - Movement (2.76 m2)						
No Asbestos						
B00F - R0014 - Movement (2.76 m2)						
No Asbestos						
B00F - R0015 - Movement (2.76 m2)						
No Asbestos						
B00F - R0016 - Movement (2.76 m2)						
No Asbestos						
B00F - R1001 - Movement (60.04 m2)						
No Asbestos						
B00F - R1002 - Library Office/Workroom (20.94 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1003 - Distribution Board (1.65 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4474/B00F/R1003/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	
B00F - R1004 - Toilets - Boys (3.78 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00F/R1005/Ceiling Structures/Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00F - R1005 - Toilets - Girls (3.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00F/R1005/Ceiling Structures/Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00F - R1006 - Cleaning Distributed Store (1.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4474/B00F/R1005/Ceiling Structures/Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00F - R1007 - Movement (14.98 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1011 - Communications Room (12.88 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1012 - Library Office/Workroom (7.99 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00F/R0009/Ceiling Structures/Linings/S19					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1013 - Reading Area (207.84 m2)						
Ceiling Structures/Linings	Vermiculite					
4474/B00F/R1013/Ceiling Structures/Linings/S32					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1014 - Special Programs Room (44.9 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 4474/B00F/R1013/Ceiling Structures/Linings/S32 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R1015 - Seminar/Study (28.16 m2)

Ceiling Structures/Linings Vermiculite
 4474/B00F/R1013/Ceiling Structures/Linings/S32 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Shed - 1972 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4474/B00G/Eaves Linings/S26					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Garden Store (10 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4474_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017