


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wingham Brush Public School (4575)
Region : North Coast
State Electorate : Myall Lakes
Local Government Area : Greater Taree

Initial Survey : Noel Arnold & Associates : 07 - Apr - 2008
Reviewed By : AECOM : 29 - Oct - 2014

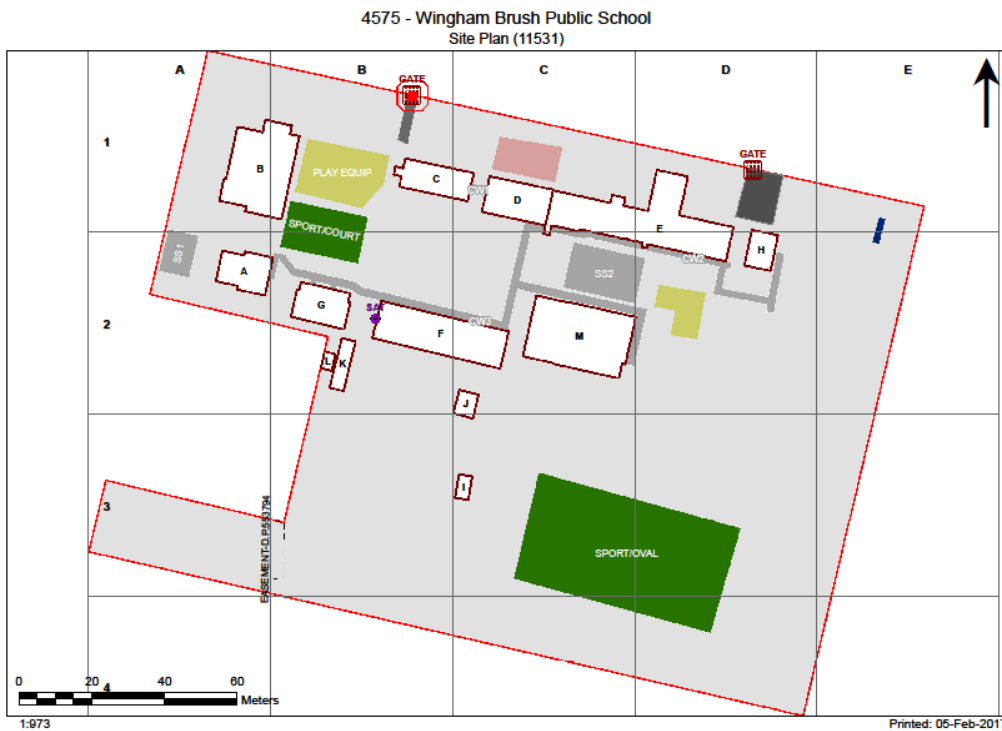

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Pupil Facilities/Staff Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00A/Eaves Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement (15.28 m2)

No Asbestos

B00A - R0002 - Canteen (42.34 m2)

No Asbestos

B00A - R0003 - Canteen Office/Store (2.14 m2)

No Asbestos

B00A - R0004 - Canteen Office/Store (3.47 m2)

No Asbestos

B00A - R0005 - Handwashing Facilities (2.55 m2)

No Asbestos

B00A - R0006 - Staff Toilet (3.86 m2)

No Asbestos

B00A - R0007 - Movement (1.13 m2)

No Asbestos

B00A - R0008 - Movement (9.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4575/B00A/R0008/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00A - R0009 - Cleaning Supplies (6.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4575/B00A/R0008/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00A - R0010 - Staff Toilet (2.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00A/R0011/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0011 - Staff Toilet (3.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00A/R0011/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0012 - Staff Room (17.87 m2)

Wall Linings Internal	Flat AC Sheeting					
	4575/B00A/R0012/Wall Linings Internal/S1					No Asbestos Detected



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1932 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (3-4m)						
Flue pipe	Fibre Cement Pipe	1m	Roof, Northeast	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (4m)						
Ceiling Voids	Flat AC Sheeting 4575/B00B/Ceiling Voids/S23					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement (1.87 m2)**

No Asbestos

B00B - R0002 - Home Base (46.87 m2)

No Asbestos

B00B - R0003 - Practical Activities - 1hb (47.28 m2)

No Asbestos

B00B - R0004 - Home Base (47.55 m2)

No Asbestos

B00B - R0005 - Communal Space (113.85 m2)

No Asbestos

B00B - R0006 - Raised Platform (19.42 m2)

In-fill-panel	Flat AC Sheeting 4575/B00B/R0006/In-fill-panel/S6					No Asbestos Detected
---------------	--	--	--	--	--	-----------------------------

B00B - R0007 - Movement (14.28 m2)

No Asbestos

B00B - R0008 - General Storeroom (8.57 m2)

In-fill-panel	Flat AC Sheeting 4575/B00B/R0008/In-fill-panel/S5	2m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos)						

B00B - R0009 - Movement (10.3 m2)

No Asbestos

B00B - R0010 - Cleaning Distributed Store (5.33 m2)

No Asbestos

B00B - R0011 - Movement (1.44 m2)

No Asbestos

B00B - R0012 - Cleaning Distributed Store (2.85 m2)

No Asbestos

B00B - R0013 - Distribution Board (0.41 m2)

No Asbestos

Note: No inspection of live electrical installation.

B00B - R0014 - Movement (4.99 m2)

No Asbestos

B00B - R0015 - Movement (2.08 m2)

No Asbestos

B00B - R1001 - Home Base (53.8 m2)

No Asbestos

B00B - R1002 - Practical Activities - 1hb (40.15 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1003 - Home Base Store (2.85 m2)						
No Asbestos						
B00B - R1004 - Home Base (48.45 m2)						
No Asbestos						
B00B - R1005 - Movement (4.45 m2)						
No Asbestos						
B00B - R1006 - Movement (57.72 m2)						
No Asbestos						
B00B - R1007 - Outdoor Learning Area (98.8 m2)						
No Asbestos						
B00B - R1008 - Movement (5 m2)						
No Asbestos						
B00B - R1009 - General Storeroom (23.76 m2)						
In-fill-panel	Flat AC Sheeting					
	4575/B00B/R1009/In-fill-panel/S7					No Asbestos Detected
B00B - R1010 - Distribution Board (0.52 m2)					Note: No inspection of live electrical installation.	
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4575/B00C/Eaves Linings/S11					No Asbestos Detected
Eaves Linings	Flat AC Sheeting	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (3-4m)						
Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (3-4m)						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Packing	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Assumed per previous register.						

Interior

B00C - R0001 - Cleaning Distributed Store (3.42 m2)

No Asbestos

B00C - R0002 - Principal (13.63 m2)

No Asbestos

B00C - R0003 - Staff Toilet (2.03 m2)

Wall Linings Internal	Flat AC Sheeting 4575/B00C/R0004/Wall Linings Internal/S12					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00C - R0004 - Movement (3.04 m2)

Wall Linings Internal	Flat AC Sheeting 4575/B00C/R0004/Wall Linings Internal/S12					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00C - R0005 - Staff Shower/Change (2.23 m2)

Wall Linings Internal	Flat AC Sheeting 4575/B00C/R0004/Wall Linings Internal/S12					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00C - R0006 - Sick Bay (5.99 m2)

No Asbestos

B00C - R0009 - Movement (1.71 m2)

No Asbestos

B00C - R0013 - Deputy Principal (12.18 m2)

No Asbestos

B00C - R0014 - Security Store (12.41 m2)

No Asbestos

B00C - R0015 - Main Switch Board (3.96 m2)

No Asbestos

B00C - R0016 - Entry Vestibule (13.35 m2)

No Asbestos

B00C - R0017 - Clerical Office (28.06 m2)

No Asbestos

B00C - R0018 - Clerical/Printing (13.14 m2)

No Asbestos

B00C - R0019 - Movement (13.52 m2)

No Asbestos

B00C - R0020 - No Access (1.47 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Staff Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Not accessible with folding ladder.
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Toilets - Boys/Girls (1.85 m2)

No Asbestos

B00D - R0002 - Movement (1.73 m2)

No Asbestos

B00D - R0003 - Movement (30.36 m2)

No Asbestos

B00D - R0004 - Practical Activities - 1hb (21.96 m2)

No Asbestos

B00D - R0005 - Home Base (51.47 m2)

No Asbestos

B00D - R0006 - Distribution Board (0.76 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0007 - Staff Toilet (2.13 m2)

No Asbestos

B00D - R0008 - Movement (6.32 m2)

No Asbestos

B00D - R0009 - Staff Room Annexe (13.26 m2)

No Asbestos

B00D - R0010 - Staff Room (33.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1870 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Home Base (44.6 m2)

No Asbestos

B00E - R0002 - Practical Activities - 1hb (20.29 m2)

No Asbestos

B00E - R0003 - Movement (12.61 m2)

No Asbestos

B00E - R0004 - Movement (35.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4575/B00E/R0004/Ceiling Structures/Linings/S18					No Asbestos Detected

B00E - R0005 - Home Base (47.73 m2)

No Asbestos

B00E - R0006 - Practical Activities - 1hb (20.43 m2)

No Asbestos

B00E - R0007 - Withdrawal Space - 1hb (26.52 m2)

No Asbestos

B00E - R0008 - General Storeroom (19.7 m2)

No Asbestos

B00E - R0009 - Distribution Board (0.6 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0010 - Cleaning Distributed Store (2.86 m2)

No Asbestos

B00E - R0011 - General Storeroom (14.6 m2)

No Asbestos

B00E - R0012 - Movement (42.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4575/B00F/R0009/Ceiling Structures/Linings/S10					No Asbestos Detected

B00E - R0013 - General Storeroom (11.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	4575/B00E/R0013/Ceiling Structures/Linings/S13					No Asbestos Detected

B00E - R0014 - Movement (1.5 m2)

No Asbestos

B00E - R0015 - Home Base (51.27 m2)

No Asbestos

B00E - R0016 - Practical Activities - 1hb (49.18 m2)

No Asbestos

B00E - R0017 - Movement (5.42 m2)

No Asbestos

B00E - R0018 - General Storeroom (8.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4575/B00E/R0018/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0019 - Movement (33.92 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - R0020 - Home Base (47.65 m2)

No Asbestos

B00E - R0021 - Movement (18.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library/Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible. No access to flat roof.
Underfloor Voids	Non Accessible Area - Area inaccessible, no designated access to underfloor voids.

Interior

B00F - R0001 - Movement (5.71 m2)

Wall Linings Internal	Flat AC Sheeting 4575/B00F/R0008/In-fill-panel/S20	No Asbestos Detected
-----------------------	---	----------------------

B00F - R0002 - Toilets - Boys (30.19 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 4575/B00F/R0003/Partition Walls (Cubicles)/S19	No Asbestos Detected
----------------------------	---	----------------------

B00F - R0003 - Toilets - Girls (38.13 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 4575/B00F/R0003/Partition Walls (Cubicles)/S19	No Asbestos Detected
----------------------------	---	----------------------

B00F - R0004 - Movement (13.05 m2)

Wall Linings Internal	Flat AC Sheeting 4575/B00F/R0008/In-fill-panel/S20	No Asbestos Detected
-----------------------	---	----------------------

B00F - R0005 - Reading Area (133.41 m2)

Ceiling Structures/Linings	Vermiculite 4575/B00F/R0009/Ceiling Structures/Linings/S10	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00F - R0006 - General Storeroom (14.18 m2)

Ceiling Structures/Linings	Vermiculite 4575/B00F/R0009/Ceiling Structures/Linings/S10	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00F - R0007 - Library Office/Workroom (24.1 m2)

Ceiling Structures/Linings	Vermiculite 4575/B00F/R0009/Ceiling Structures/Linings/S10	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00F - R0008 - Movement (34.29 m2)

In-fill-panel	Flat AC Sheeting 4575/B00F/R0008/In-fill-panel/S20	No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4575/B00F/R0008/In-fill-panel/S20	No Asbestos Detected

B00F - R0009 - Special Programs Room (43.6 m2)

Ceiling Structures/Linings	Vermiculite 4575/B00F/R0009/Ceiling Structures/Linings/S10	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00F - R0010 - Cleaning Distributed Store (4 m2)

No Asbestos

B00F - R0011 - Disabled Toilet (4.7 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1933 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00G/Eaves Linings/S8				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Minor fibre cement debris was					

Interior

B00G - R0001 - Home Base (53.29 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00G/R0002/Wall Linings Internal/S9				Chrysotile (white asbestos)	

B00G - R0002 - Home Base (53.29 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00G/R0002/Wall Linings Internal/S9				Chrysotile (white asbestos)	

B00G - R0003 - Movement (30.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00G/Eaves Linings/S8				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-Regional Use - 1933 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00H/R0001/Ceiling Structures/Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible due to fixed ceiling with no designated access.					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Other - Regional Use (17.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00H/R0001/Ceiling Structures/Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0002 - Other - Regional Use (51.97 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00H/R0002/Wall Linings Internal/S16			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00H/R0002/Wall Linings Internal/S17			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Communal Facilities - 1950 - Timber Shed (Timber Shed)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00G/Eaves Linings/S8					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible due to flat roof.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B001 - R0001 - Sports Store (21.86 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00J/Eaves Linings/S22					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00J - R0001 - General Assistant/Bulk Store (30.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4575/B00K/Eaves Linings/S21					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible, no designated access to roof.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00K - R0001 - Drinking Facilities (7.8 m2)

No Asbestos

B00K - R0002 - Canteen Covered Area (15.01 m2)

No Asbestos

B00K - R0003 - Canteen Covered Area (15.01 m2)

No Asbestos

B00K - R0004 - Drinking Facilities (7.42 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 1950 - Metal Shed (Metal Shed)

Exterior

No roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00L - R0001 - General Assistant/Bulk Store (13.42 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00M - R0001 - Communal Space (145.26 m2)

No Asbestos

B00M - R0002 - Raised Platform (60.06 m2)

No Asbestos

B00M - R0003 - Hall Chair Store (9.53 m2)

No Asbestos

B00M - R0004 - Communal/Performance Store (9.44 m2)

No Asbestos

B00M - R0005 - P.E. Store (13.06 m2)

No Asbestos

B00M - R0006 - Toilet - Lobby (2.37 m2)

No Asbestos

B00M - R0007 - Toilets - Girls (7.31 m2)

No Asbestos

B00M - R0008 - Sound Cupboard (2.06 m2)

No Asbestos

B00M - R0009 - Toilet - Lobby (3.3 m2)

No Asbestos

B00M - R0010 - Toilets - Boys (5.71 m2)

No Asbestos

B00M - R0011 - Cleaning Distributed Store (3.51 m2)

No Asbestos

B00M - R0012 - General Storeroom (1.6 m2)

No Asbestos

B00M - R0013 - No Access (3.23 m2)

No Asbestos

B00M - R0014 - Access Shower/Toilet/Change (6.87 m2)

No Asbestos

B00M - R0015 - Covered Outdoor Learning Area (147.66 m2)

No Asbestos

B00M - R0016 - Movement (6.17 m2)

No Asbestos

B00M - R0017 - Movement (12.99 m2)

No Asbestos

B00M - R0018 - Ramp (12.43 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017