


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Westlawn Public School (5238)  
**Region :** North Coast  
**State Electorate :** Clarence  
**Local Government Area :** Clarence Valley

**Initial Survey :** Noel Arnold & Associates : 26 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 08 - Oct - 2015

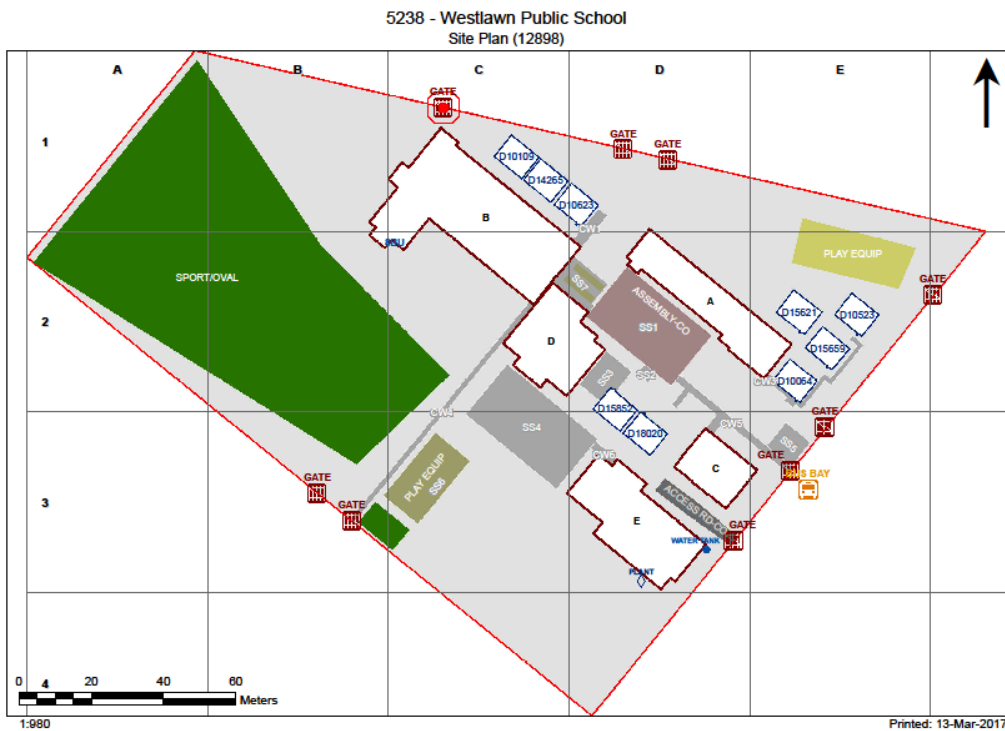

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - General Learning/Administration - 1954 - Brick/Block (Brick/Block)****Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/Eaves Linings/S18					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00A - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0005/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0004 - Sports Store**

No Asbestos

**B00A - R0005 - Music Store**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0005/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0006 - Movement**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	144m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0008/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	20m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0005/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0010 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0010/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B00A - R0011 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0008/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0011/Partition Walls (Cubicles)/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0012 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0008/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00A/R0012/Partition Walls (Cubicles)/S22					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0013 - General Storeroom**

No Asbestos

**B00A - R0014 - General Assistant/Bulk Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R0008/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
<b>B00A - R0015 - General Assistant/Bulk Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R0008/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
<b>B00A - R0016 - Movement</b>						
No Asbestos						
<b>B00A - R0017 - General Storeroom</b>						
No Asbestos						
<b>B00A - R0018 - Toilet - Lobby</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R0018/Ceiling Structures/Linings/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R0019 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R0018/Ceiling Structures/Linings/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1014 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1012/Wall Linings Internal/S2				Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	18m2	Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1012/Wall Linings Internal/S2				Chrysotile (white asbestos)		
<b>B00A - R1015 - Staff Room Annexe</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1012/Wall Linings Internal/S2				Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	34m2	Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1012/Wall Linings Internal/S2				Chrysotile (white asbestos)		
<b>B00A - R1016 - Movement</b>						
No Asbestos						
<b>B00A - R1017 - Practical Activities</b>						
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1017/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1017/Ceiling Structures/Linings/S23				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1018 - Home Base</b>						
Wall Linings Internal	Flat AC Sheeting	90m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1018/Wall Linings Internal/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1018/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1019 - Withdrawal Space - 1hb</b>						
Wall Linings Internal	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1019/Wall Linings Internal/S28				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1019/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1020 - Home Base Store</b>						
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1020/Wall Linings Internal/S30				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1020/Ceiling Structures/Linings/S29				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1021 - Home Base Store</b>						
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1021/Wall Linings Internal/S32				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1021/Ceiling Structures/Linings/S31				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1022 - Movement</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
5238/B00A/R1022/Wall Linings Internal/S34						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1022/Ceiling Structures/Linings/S33				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1023 - Home Base</b>						
Wall Linings Internal	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1023/Wall Linings Internal/S36				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1023/Ceiling Structures/Linings/S35				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1024 - Home Base</b>						
Wall Linings Internal	Flat AC Sheeting	90m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1024/Wall Linings Internal/S38				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1024/Ceiling Structures/Linings/S37				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1025 - Withdrawal Space - 1hb</b>						
Wall Linings Internal	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1025/Wall Linings Internal/S40				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1025/Ceiling Structures/Linings/S39				Chrysotile (white asbestos) , Amosite (brown asbestos)		
<b>B00A - R1026 - Movement</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
5238/B00A/R1026/Wall Linings Internal/S42						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1026/Ceiling Structures/Linings/S41				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1027 - Movement</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
5238/B00A/R1027/Wall Linings Internal/S44						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1027/Ceiling Structures/Linings/S43				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1028 - Home Base Store</b>						
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1028/Wall Linings Internal/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1028/Ceiling Structures/Linings/S45				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1029 - Home Base Store</b>						
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1029/Wall Linings Internal/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00A/R1029/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1030 - Home Base</b>						
No Asbestos						
<b>B00A - R1031 - Practical Activities</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
5238/B00A/R1031/Wall Linings Internal/S9						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities/General Learning - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5238/B00B/Eaves Linings/S19					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00B - R0001 - Toilets - Boys**

No Asbestos

**B00B - R0002 - Cleaning Distributed Store**

No Asbestos

**B00B - R0003 - Movement**

No Asbestos

**B00B - R0004 - Raised Platform**

No Asbestos

**B00B - R0005 - Communal Space**

No Asbestos

**B00B - R0006 - Raised Platform**

No Asbestos

**B00B - R0008 - Hall Chair Store**

No Asbestos

**B00B - R0010 - Staff Toilet**

No Asbestos

**B00B - R0012 - Canteen Office/Store**

No Asbestos

**B00B - R0013 - Staff Toilet**

No Asbestos

**B00B - R0014 - Sports Store**

No Asbestos

**B00B - R0015 - Movement**

No Asbestos

**B00B - R0016 - Movement**

No Asbestos

**B00B - R0017 - Movement**

No Asbestos

**B00B - R0018 - Movement**

No Asbestos

**B00B - R0019 - Movement**

No Asbestos

**B00B - R0020 - Movement**

No Asbestos

**B00B - R0021 - Canteen Covered Area**

Wall Linings Internal	Flat AC Sheeting					
	5238/B00B/R0021/Wall Linings Internal/S10					<b>No Asbestos Detected</b>

**B00B - R0022 - Canteen**

No Asbestos

**B00B - R0023 - Uniform Shop**

Wall Linings Internal	Flat AC Sheeting					
	5238/B00B/R0023/Wall Linings Internal/S11					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0024 - Toilets - Girls</b>						
No Asbestos						
<b>B00B - R0025 - Stairs</b>						
No Asbestos						
<b>B00B - R0026 - Stairs</b>						
No Asbestos						
<b>B00B - R1001 - Home Base Store</b>						
No Asbestos						
<b>B00B - R1002 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00B - R1003 - Home Base</b>						
No Asbestos						
<b>B00B - R1004 - Movement</b>						
No Asbestos						
<b>B00B - R1005 - Movement</b>						
No Asbestos						
<b>B00B - R1006 - Home Base Store</b>						
No Asbestos						
<b>B00B - R1007 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00B - R1008 - Home Base</b>						
No Asbestos						
<b>B00B - R1009 - Home Base</b>						
No Asbestos						
<b>B00B - R1010 - Home Base Store</b>						
No Asbestos						
<b>B00B - R1011 - Home Base Store</b>						
No Asbestos						
<b>B00B - R1012 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00B - R1013 - Home Base</b>						
No Asbestos						
<b>B00B - R1014 - Duplicating Workroom</b>						
No Asbestos						
<b>B00B - R1015 - Sick Bay</b>						
No Asbestos						
<b>B00B - R1016 - Movement</b>						
No Asbestos						
<b>B00B - R1017 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00B - R1018 - Home Base</b>						
No Asbestos						
<b>B00B - R1019 - Home Base</b>						
No Asbestos						
<b>B00B - R1020 - Movement</b>						
No Asbestos						
<b>B00B - R1021 - Deputy Principal</b>						
No Asbestos						
<b>B00B - R1022 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00B - R1023 - General Storeroom</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00B - R1027 - General Storeroom</b>						
No Asbestos						
<b>B00B - R1028 - Entry Vestibule</b>						
No Asbestos						
<b>B00B - R1029 - Clerical Office</b>						
No Asbestos						
<b>B00B - R1030 - No Access</b>						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
5238/B00B/R1030/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1031 - Principal</b>						
No Asbestos						
<b>B00B - R1032 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00B/R1032/Wall Linings Internal/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00B - R1033 - General Storeroom</b>						
No Asbestos						
<b>B00B - R1034 - General Storeroom</b>						
No Asbestos						
<b>B00B - R1035 - Stairs</b>						
No Asbestos						
<b>B00B - R1036 - Stairs</b>						
No Asbestos						
<b>B00B - R1037 - Toilet - Lobby</b>						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00B/R1040/Wall Linings Internal/S47					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1038 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00B/R1040/Wall Linings Internal/S47					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1039 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00B/R1040/Wall Linings Internal/S47					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1040 - Toilet - Lobby</b>						
Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5238/B00B/R1040/Wall Linings Internal/S47					<b>Chrysotile (white asbestos)</b>	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1997 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Movement**

No Asbestos

**B00C - R0002 - Practical Activities - 1hb**

No Asbestos

**B00C - R0003 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0004 - Home Base Store**

No Asbestos

**B00C - R0005 - Outdoor Learning Area**

No Asbestos

**B00C - R0006 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0007 - Outdoor Learning Area**

No Asbestos

**B00C - R0008 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0009 - Practical Activities - 1hb**

No Asbestos

**B00C - R0010 - Home Base Store**

No Asbestos

**B00C - R0011 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 2001 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00D - R0001 - Movement**

No Asbestos

**B00D - R0002 - Communications Room**

No Asbestos

**B00D - R0003 - Seminar/Study**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0005 - Communications Room**

No Asbestos

**B00D - R0006 - Special Programs Store**

No Asbestos

**B00D - R0007 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0008 - K.L.A. Store**

No Asbestos

**B00D - R0009 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0010 - Library Office/Workroom**

No Asbestos

**B00D - R0011 - Sports Store**

No Asbestos

**B00D - R0012 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00E - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior****B00E - R0001 - Communal Space**

No Asbestos

**B00E - R0002 - Raised Platform**

No Asbestos

**B00E - R0003 - Hall Chair Store**

No Asbestos

**B00E - R0004 - Communal/Performance Store**

No Asbestos

**B00E - R0005 - P.E. Store**

No Asbestos

**B00E - R0006 - Toilet - Lobby**

No Asbestos

**B00E - R0007 - Toilets - Girls**

No Asbestos

**B00E - R0008 - Sound Cupboard**

No Asbestos

**B00E - R0009 - Toilet - Lobby**

No Asbestos

**B00E - R0010 - Toilets - Boys**

No Asbestos

**B00E - R0011 - Cleaning Distributed Store**

No Asbestos

**B00E - R0012 - Plant**

No Asbestos

**B00E - R0013 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0014 - Access Shower/Toilet/Change**

No Asbestos

**B00E - R0015 - Covered Outdoor Learning Area**

No Asbestos

**B00E - R0016 - Movement**

No Asbestos

**B00E - R0017 - Movement**

No Asbestos

**B00E - R0018 - Ramp**

No Asbestos

**B00E - R0019 - External Stairs**

No Asbestos

**B00E - R9001 - Other**

No Asbestos

**B00E - R9002 - Plant**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - Added Building**

**Exterior**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D10064 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 3/11/2004**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 601 - D10109 - Learning Unit - Standard/Withdrawal : Placement Date - 29/03/1995**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 603 - D10523 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 22/12/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 601 - D10623 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D14265 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 602 - D15621 - Learning Unit - Standard With P.A.A. : Placement Date - 19/03/2014</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D15659 - Learning Unit - Standard With P.A.A. : Placement Date - 12/08/2009</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D15852 - Learning Unit - Standard With P.A.A. : Placement Date - 26/01/2009</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
<b>R2 - Home Base Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
<b>OS 601 - D18020 - Learning Unit - Standard/Withdrawal : Placement Date - 8/07/2004</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017