


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Woniora Road School (5609)  
**Region :** Sydney  
**State Electorate :** Kogarah  
**Local Government Area :** Kogarah

**Initial Survey :** Noel Arnold & Associates : 17 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 14 - Feb - 2017

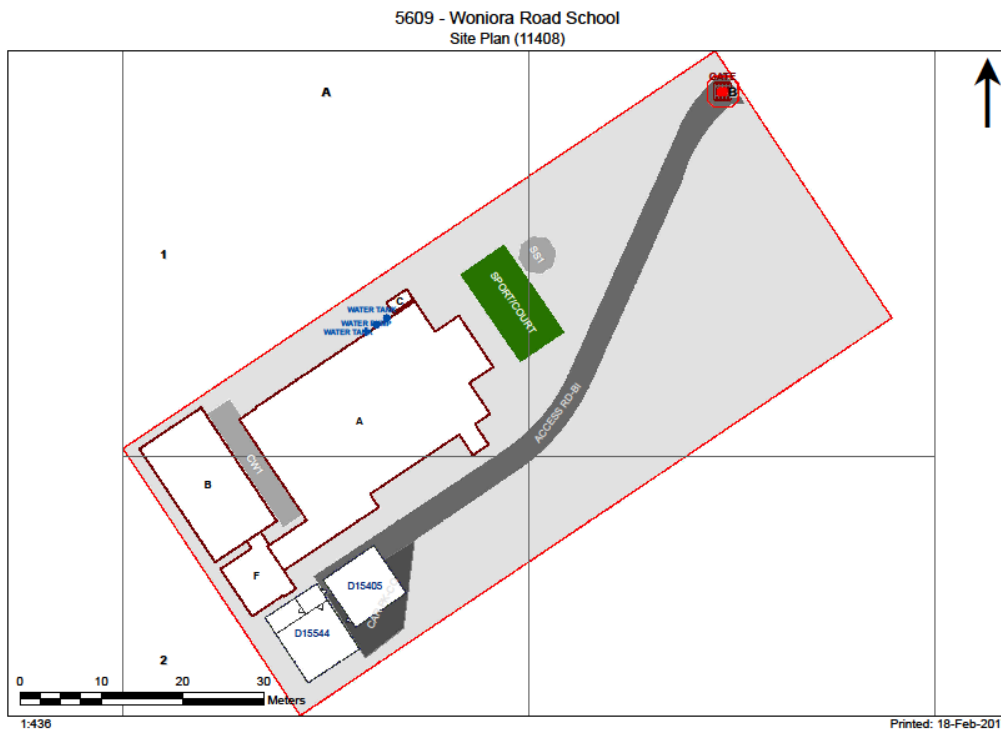

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1906 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00A - R0001 - Staff Room Annexe**

No Asbestos

**B00A - R0002 - Duplicating Workroom**

No Asbestos

**B00A - R0003 - Interview**

No Asbestos

**B00A - R0004 - Movement**

No Asbestos

**B00A - R0007 - Special Programs Room - Type 1**

No Asbestos

**B00A - R0008 - Reading Area**

No Asbestos

**B00A - R0009 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0010 - Special Programs Room**

No Asbestos

**B00A - R0011 - Movement**

No Asbestos

**B00A - R0012 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0013 - Laundry**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0014 - Staff Shower/Change**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0015 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0016 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0017 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0018 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
5609/B00A/R0018/Partition Walls (Cubicles)/S2						
Window In-fill Panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
5609/B00A/R0018/In fill window/S3						

**B00A - R0019 - Special Programs Room - Type 1**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
<b>B00A - R0020 - Food Technology L.S.</b>						
No Asbestos						
<b>B00A - R0021 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
<b>B00A - R0022 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
5609/B00A/R0018/Partition Walls (Cubicles)/S2						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
5609/B00A/R0022/Wall Linings Internal/S5						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
<b>B00A - R0025 - Toilets - Boys/Girls</b>						
No Asbestos						
<b>B00A - R0026 - General Storeroom</b>						
No Asbestos						
<b>B00A - R0027 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
<b>B00A - R0028 - Staff Room</b>						
No Asbestos						
<b>B00A - R0029 - Security Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5609/B00A/R0019/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
<b>B00A - R0030 - Movement</b>						
No Asbestos						
<b>B00A - R0031 - General Learning Space</b>						
No Asbestos						
<b>B00A - R0032 - Movement</b>						
No Asbestos						
<b>B00A - R0033 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00A - R0034 - Cleaning Supplies</b>						
No Asbestos						
<b>B00A - R0035 - Entry Vestibule</b>						
No Asbestos						
<b>B00A - R0036 - Stairs</b>						
No Asbestos						
<b>B00A - R0037 - External Movement</b>						
No Asbestos						
<b>B00A - R9001 - Art Learning Space</b>						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
5609/B00A/R9006/Floor Coverings Res/Textile/S7						
<b>B00A - R9003 - Materials Technology L.S.</b>						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
5609/B00A/R9003/Floor Coverings Res/Textile/S6						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R9004 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	5609/B00A/R9006/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00A - R9005 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	5609/B00A/R9006/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00A - R9006 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	5609/B00A/R9006/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00A - R9007 - Stairs</b>						
No Asbestos						
<b>B00A - R9008 - External Movement</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Communal Facilities - 1973 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5609/B00B/Eaves Linings/S1				<b>Chrysotile (white asbestos)</b>	
Gable Ends	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5609/B00B/Gable Ends/S9				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00B - R0003 - Special Programs Room**

No Asbestos

**B00B - R0004 - Interview**

No Asbestos

**B00B - R0005 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 2007 - Metal Shed (Metal Shed)**

**Exterior**

No Asbestos

**Interior**

**B00C - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Building Services - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00D - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Storage - 2013 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00E - R0001 - General Assistant/Bulk Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 600 - D15405 - Learning Unit - Small : Placement Date - 15/01/2014**

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		8.64 m2

#### Interior

##### R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

**OS 601 - D15544 - Learning Unit - Standard/Withdrawal : Placement Date - 23/11/2010**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Entry

No Asbestos Found.

##### R2 - General Learning Space

No Asbestos Found.

##### R3 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017