


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wairoa School (5631)  
**Region :** Sydney  
**State Electorate :** Vacluse  
**Local Government Area :** Waverley

**Initial Survey :** Noel Arnold & Associates : 06 - Apr - 2008  
**Reviewed By :** AECOM : 26 - May - 2015

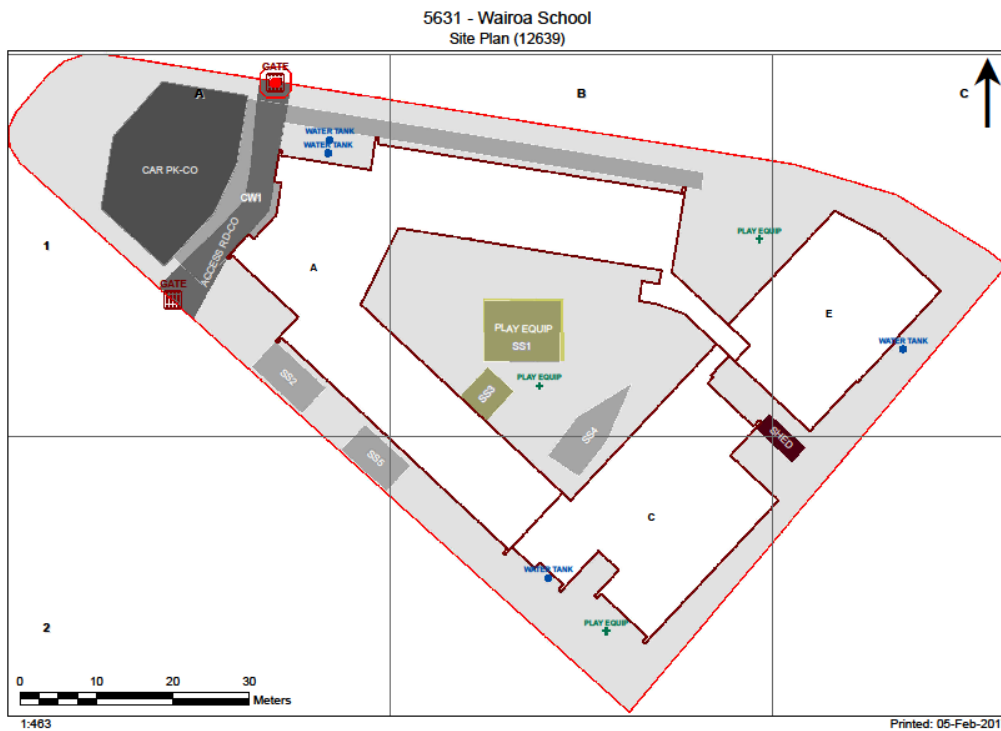

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Support Unit/Administration - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Corrugated AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	5631/B00A/R1016/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Infill panel below window	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	5631/B00A/Underfloor Voids/S15				<b>, Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**Interior****B00A - R0001 - Practical Activities - 1hb (68.49 m2)**

No Asbestos

**B00A - R0002 - General Storeroom (41.26 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	5631/B00A/R0003/Wall Linings Internal/S6					

**B00A - R0003 - Movement (15.78 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	5631/B00A/R0003/Wall Linings Internal/S6					

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	5631/B00A/R0008/Ceiling Structures/Linings/S14					

**B00A - R0004 - Main Switch Board (4.03 m2)**

No Asbestos

**B00A - R0006 - Garden Store (8.54 m2)**

No Asbestos

**B00A - R0007 - General Storeroom (5.61 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	5631/B00A/R0008/Ceiling Structures/Linings/S14					

**B00A - R0008 - Home Base Store (6.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	5631/B00A/R0008/Ceiling Structures/Linings/S14					

**B00A - R0009 - Lift (2.1 m2)**

No Asbestos

**B00A - R0010 - External Movement (45.21 m2)**

No Asbestos

**B00A - R1001 - Home Base - M (57.12 m2)**

Infil panel below window	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R1002 - Home Base Store - M (6.78 m2)**

No Asbestos

**B00A - R1003 - General Storeroom (6.71 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	5631/B00A/R1044/Floor Coverings Res/Textile/S8					

**B00A - R1004 - Home Base - M (56.8 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Infil panel below window	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1011 - Staff Room (57.03 m2)</b>						
Infil panel below window	Flat AC Sheeting	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1012 - Sports Store (7.74 m2)</b>						
No Asbestos						
<b>B00A - R1013 - General Storeroom (6.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
5631/B00A/R1044/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>		
<b>B00A - R1014 - Communications Room (6.46 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Reading Area (57.27 m2)</b>						
Infil panel below window	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1016 - Movement (73.66 m2)</b>						
Infil panel below window	Flat AC Sheeting	51m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Corrugated AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1016/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1017 - Movement (9.2 m2)</b>						
No Asbestos						
<b>B00A - R1018 - Movement (19.61 m2)</b>						
Ceiling Structures/Linings	Corrugated AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1016/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1019 - Principal (18.64 m2)</b>						
Infil panel below window	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1020 - General Storeroom (5.17 m2)</b>						
No Asbestos						
<b>B00A - R1021 - Clerical Office (13.43 m2)</b>						
No Asbestos						
<b>B00A - R1022 - Staff Toilet (5.41 m2)</b>						
No Asbestos						
<b>B00A - R1023 - Entry Vestibule (54.63 m2)</b>						
No Asbestos						
<b>B00A - R1025 - Staff Toilet (5.27 m2)</b>						
No Asbestos						
<b>B00A - R1026 - General Storeroom (0.6 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00A - R1027 - Security Store (7.87 m2)</b>						
No Asbestos						
<b>B00A - R1028 - Interview (9.76 m2)</b>						
Infil panel below window	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1029 - Deputy Principal (18.03 m2)</b>						
Infil panel below window	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1030 - Movement (9.22 m2)</b>						
No Asbestos						
<b>B00A - R1031 - Cleaning Distributed Store (6.79 m2)</b>						
No Asbestos						
<b>B00A - R1032 - Music Store (6.79 m2)</b>						
No Asbestos						
<b>B00A - R1033 - Communal Space (57.05 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
5631/B00A/R1044/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>		
Infil panel below window	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1034 - Communal Space (56.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
5631/B00A/R1044/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>		
Infil panel below window	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1040 - General Storeroom (7.13 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
5631/B00A/R1044/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>		
<b>B00A - R1041 - Home Base Store - S (5.58 m2)</b>						
No Asbestos						
<b>B00A - R1044 - General Storeroom (6.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
5631/B00A/R1044/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>		
<b>B00A - R1045 - Home Base Store - M (6.68 m2)</b>						
No Asbestos						
<b>B00A - R1046 - Practical Activities - M - 1hb (0.81 m2)</b>						
No Asbestos						
<b>B00A - R1047 - Home Base - M (56.38 m2)</b>						
Infil panel below window	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R1048 - Movement (66.62 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infil panel below window	Flat AC Sheeting	51m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1047/Infil panel below window/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	1m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00A/R1048/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R1050 - Practical Activities - P - 1hb (55.45 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
5631/B00A/R1050/Wall Linings Internal/S11				<b>No Asbestos Detected</b>		
<b>B00A - R1051 - Disabled Toilet (3.42 m2)</b>						
No Asbestos						
<b>B00A - R1052 - Disabled Shower/Toilet (29.94 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
5631/B00A/R1053/Wall Linings Internal/S12				<b>No Asbestos Detected</b>		
<b>B00A - R1053 - Laundry - S (7.34 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
5631/B00A/R1053/Wall Linings Internal/S12				<b>No Asbestos Detected</b>		
<b>B00A - R1054 - Disabled Shower/Toilet (35.87 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
5631/B00A/R1053/Wall Linings Internal/S12				<b>No Asbestos Detected</b>		
<b>B00A - R1055 - Disabled Toilet (3.21 m2)</b>						
No Asbestos						
<b>B00A - R1056 - Laundry - S (6.85 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
5631/B00A/R1053/Wall Linings Internal/S12				<b>No Asbestos Detected</b>		
<b>B00A - R1057 - Home Base - M (56.16 m2)</b>						
No Asbestos						
<b>B00A - R1058 - External Movement (40.89 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Support Unit/Staff Facilities - 1968 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	5631/B00C/R1002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00C - R0001 - External Movement (7.8 m2)**

No Asbestos

**B00C - R0002 - Laundry (6.58 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	5631/B00C/R0011/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0003 - Cleaning Distributed Store (5.57 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	5631/B00C/R0011/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0008 - Home Base (60.1 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	5631/B00C/R0011/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0009 - Craft Store (10.18 m2)**

No Asbestos

**B00C - R0010 - Distribution Board (0.23 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0017 - Stairs (5.2 m2)**

No Asbestos

**B00C - R0018 - Chair Store (8.36 m2)**

No Asbestos

**B00C - R0019 - Sports Store (26.57 m2)**

No Asbestos

**B00C - R0024 - Special Programs Room (70.5 m2)**

No Asbestos

**B00C - R0025 - Toilet - P (33.41 m2)**

No Asbestos

**B00C - R0026 - Toilet - P (26.02 m2)**

No Asbestos

**B00C - R0027 - Movement (42.9 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	5631/B00C/R0011/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5631/B00C/R1013/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>

**B00C - R0028 - Reading Area (38.83 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	5631/B00C/R0011/Ceiling Structures/Linings/S3					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0029 - Movement (10.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
5631/B00C/R1013/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
5631/B00C/R0011/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00C - R0030 - Hydrotherapy - Pool (105.96 m2)</b>						
Ceiling Structures/Linings	Compressed AC Sheet	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible - due height</b>						
<b>B00C - R0031 - External Movement (62.52 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Movement (57.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00C/R1013/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1002 - External Movement (27.94 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00C/R1002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1003 - Home Base - M (60.08 m2)</b>						
No Asbestos						
<b>B00C - R1004 - Disabled Shower/Toilet (5.5 m2)</b>						
No Asbestos						
<b>B00C - R1005 - Home Base Store - M (5.34 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00C/R1013/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1006 - Staff Toilet (4.87 m2)</b>						
No Asbestos						
<b>B00C - R1007 - Staff Room Annexe (16.73 m2)</b>						
No Asbestos						
<b>B00C - R1008 - Cleaning Distributed Store (1.54 m2)</b>						
No Asbestos						
<b>B00C - R1009 - Cleaning Supplies (8.61 m2)</b>						
No Asbestos						
<b>B00C - R1010 - Staff Room (39.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00C/R1013/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1011 - Distribution Board (0.21 m2)</b>						
No Asbestos					Note: No inspection of live electrical installation.	
<b>B00C - R1012 - Staff Toilet (4.7 m2)</b>						
No Asbestos						
<b>B00C - R1013 - Home Base Store - M (10.08 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00C/R1013/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1014 - Practical Activities - M - 1hb (6.22 m2)</b>						
No Asbestos						
<b>B00C - R1015 - Home Base - M (52.29 m2)</b>						
No Asbestos						
<b>B00C - R1016 - External Movement (26.44 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5631/B00C/R1002/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1017 - Staff Toilet (4.23 m2)</b>						
No Asbestos						
<b>B00C - R1018 - Stairs (8.74 m2)</b>						
No Asbestos						
<b>B00C - R1019 - External Movement (62.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
5631/B00C/R1019/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00E - Support Unit (M P S) - 2014 - Brick/Veneer (Brick/Veneer)****Exterior**

No Asbestos

**Interior****B00E - R0001 - External Movement (135.59 m2)**

No Asbestos

**B00E - R0002 - Home Base - S (61.62 m2)**

No Asbestos

**B00E - R0003 - Withdrawal - S (8.68 m2)**

No Asbestos

**B00E - R0004 - Withdrawal - S (8.7 m2)**

No Asbestos

**B00E - R0005 - Home Base Store - S (5.53 m2)**

No Asbestos

**B00E - R0006 - Practical Activities - S - 2hb (41.01 m2)**

No Asbestos

**B00E - R0007 - Toilet - S (10.3 m2)**

No Asbestos

**B00E - R0008 - Toilets-Unisex (9.14 m2)**

No Asbestos

**B00E - R0009 - Laundry - S (6.09 m2)**

No Asbestos

**B00E - R0010 - Home Base Store - S (5.61 m2)**

No Asbestos

**B00E - R0011 - Withdrawal - S (8.7 m2)**

No Asbestos

**B00E - R0012 - Withdrawal - S (8.75 m2)**

No Asbestos

**B00E - R0013 - Home Base - S (63.59 m2)**

No Asbestos

**B00E - R0014 - Distribution Board (0.65 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0015 - External Movement (3.11 m2)**

No Asbestos

**B00E - R0016 - External Stairs (10.84 m2)**

No Asbestos

**B00E - R1001 - External Movement (51.36 m2)**

No Asbestos

**B00E - R1002 - Home Base - S (60.89 m2)**

No Asbestos

**B00E - R1003 - Withdrawal - S (17.54 m2)**

No Asbestos

**B00E - R1004 - Home Base Store - S (5.45 m2)**

No Asbestos

**B00E - R1005 - Practical Activities - S - 2hb (47.73 m2)**

No Asbestos

**B00E - R1006 - Toilet - S (10.2 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R1007 - Toilets-Unisex (9.02 m2)</b>						
No Asbestos						
<b>B00E - R1008 - Home Base Store - S (5.47 m2)</b>						
No Asbestos						
<b>B00E - R1009 - Withdrawal - S (17.47 m2)</b>						
No Asbestos						
<b>B00E - R1010 - Home Base - S (63.47 m2)</b>						
No Asbestos						
<b>B00E - R1011 - Distribution Board (0.61 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00E - R1012 - External Movement (4.3 m2)</b>						
No Asbestos						
<b>B00E - R1013 - External Stairs (9.88 m2)</b>						
No Asbestos						

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017