


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Wambalangang Environmental Education Centre (5681)  
**Region :** Western NSW  
**State Electorate :** Dubbo  
**Local Government Area :** Dubbo

**Initial Survey :** Noel Arnold & Associates : 19 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

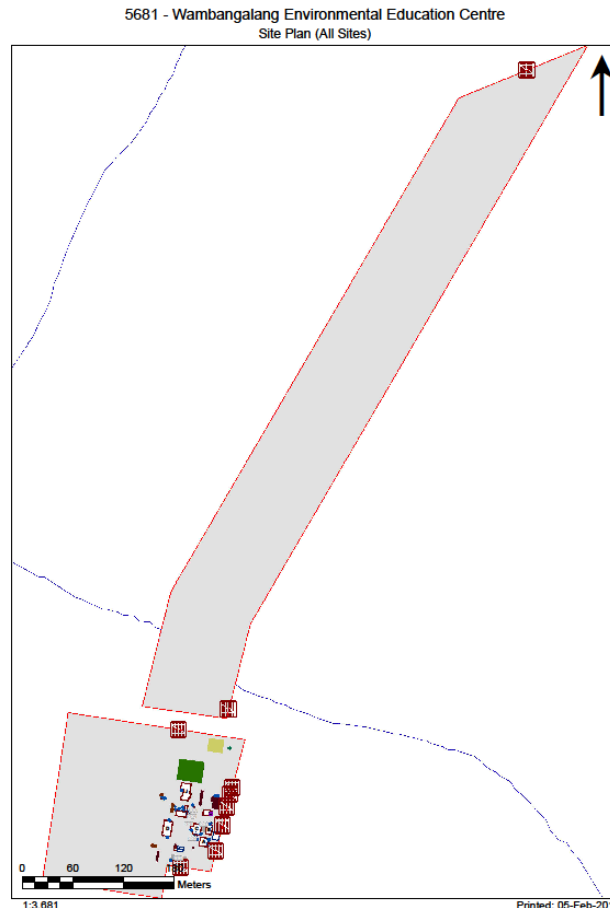

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Dormitory - 1979 - Timber (Timber)**

**Exterior**

Pitched Roof - Flat Ceiling Non Accessible Area

- Height restricted 4m high

Underfloor Voids - Packing to Floor Joists  
No Asbestos Found

**Interior**

**B00A - R0001 - Dormitory**

No Asbestos

**B00A - R0002 - Dormitory**

Wall Linings Internal	Flat AC Sheeting	5m2	West facing, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
5681/B00A/R0002/Wall Linings Internal/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0003 - Dormitory**

No Asbestos

**B00A - R0004 - Dormitory**

No Asbestos

**B00A - R0005 - Movement**

Wall Linings Internal	Flat AC Sheeting	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00A/R0005/Wall Linings Internal/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Dormitory - 1970 - Timber (Timber)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Pitched Roof - Flat Ceiling	Non Accessible Area - No manhole.

**Interior****B00B - R0001 - Dormitory**

No Asbestos

**B00B - R0002 - General Storeroom**

No Asbestos

**B00B - R0003 - Cleaning Supplies**

Wall Linings Internal	Flat AC Sheeting	8m2	North facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00B/R0003/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	

**B00B - R0004 - Movement**

Wall Linings Internal	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00B/R0003/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Dormitory**

Wall Linings Internal	Flat AC Sheeting	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00B/R0003/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Staff Facilities/Pupil Facilities - 1910 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

**Assumed Asbestos - Avoid damage**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
--------------------------------------------	-------------------

Pitched Roof - Flat Ceiling	Non Accessible Area
	- Height restricted 4m

**Interior****B00C - R0001 - Laundry**

No Asbestos

**B00C - R0002 - Residence - Dining Room**

No Asbestos

**B00C - R0003 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	-----	--------------	--------------------	---------	--------------------

5681/B00C/R0003/Floor Coverings Res/Textile/S5

**Chrysotile (white asbestos)**

Floor Coverings Res/Textile	Adhesive
-----------------------------	----------

5681/B00C/R0003/Floor Coverings Res/Textile/S10

**No Asbestos Detected****B00C - R0004 - Residential Pantry**

Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	--------------	--------------------	---------	--------------------

5681/B00C/R0004/Wall Linings Internal/S4

**Chrysotile (white asbestos)****B00C - R0005 - Residential Kitchen**

No Asbestos

**B00C - R0006 - External Movement**

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library/General Learning - 1910 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists      No Asbestos Found

Pitched Roof - Flat Ceiling      Non Accessible Area  
 - Height restricted 4m

**Interior**

**B00D - R0002 - Movement**

No Asbestos

**B00D - R0003 - Dormitory**

No Asbestos

**B00D - R0004 - Reading Area**

No Asbestos

**B00D - R0005 - General Learning Space**

No Asbestos

**B00D - R0008 - Aboriginal Resource Centre**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities/Staff Facilities - 1975 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof Non Accessible Area  
- No manhole

**Interior****B00E - R0002 - Staff Shower**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00E/R0005/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	

**B00E - R0003 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00E/R0005/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	

**B00E - R0004 - Staff Shower**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00E/R0005/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	

**B00E - R0006 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00E/R0005/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	

**B00E - R0007 - Toilets-Disabled**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
5681/B00E/R0005/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	

**B00E - R0008 - Shower/Change**

Recently Modified Space Requires Inspection

**B00E - R0009 - General Storeroom**

Recently Modified Space Requires Inspection

**B00E - R0010 - General Storeroom**

Recently Modified Space Requires Inspection

**B00E - R0011 - Shower/Change**

Recently Modified Space Requires Inspection

**B00E - R0012 - Plant**

Recently Modified Space Requires Inspection

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Communal Facilities - 1910 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting 5681/B00F/Eaves Linings/S11					<b>No Asbestos Detected</b>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00F - R0001 - No Access**

Wall Linings Internal	Flat AC Sheeting 5681/B00F/R0003/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 5681/B00F/R0003/Ceiling Structures/Linings/S8					<b>No Asbestos Detected</b>

**B00F - R0002 - Sports Store**

Non Accessible

**B00F - R0003 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting 5681/B00F/R0003/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 5681/B00F/R0003/Ceiling Structures/Linings/S8					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Staff Facilities - 1975 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 5681/B00G/Eaves Linings/S9	15m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior**

**B00G - R0001 - Staff Room**

No Asbestos

**B00G - R0002 - Staff Room**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Staff Facilities - 2005 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00H - R0001 - Staff Toilet**

No Asbestos

**B00H - R0002 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Staff Facilites - 2005 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B001 - R0001 - Staff Toilet**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Storage - 2000 - Steel (Steel)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00J - R0001 - General Assistant/Bulk Store**

No Asbestos

**B00J - R0002 - Garage/Carport**

No Asbestos

**B00J - R0003 - General Storeroom**

No Asbestos

**B00J - R0004 - General Storeroom**

No Asbestos

**B00J - R0005 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**OS 601 - D13917 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 840 - D14277 - Girls Toilet : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

### Interior

#### R1 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

**OS 841 - D14291 - Boys Toilet : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

### Interior

#### R1 - Toilets-Boys

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**There are no asbestos related file attachment(s) for this school.**

2017