


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woy Woy Public School (7445)
Region : Hunter/Central Coast
State Electorate : Gosford
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : AECOM : 27 - Jun - 2016

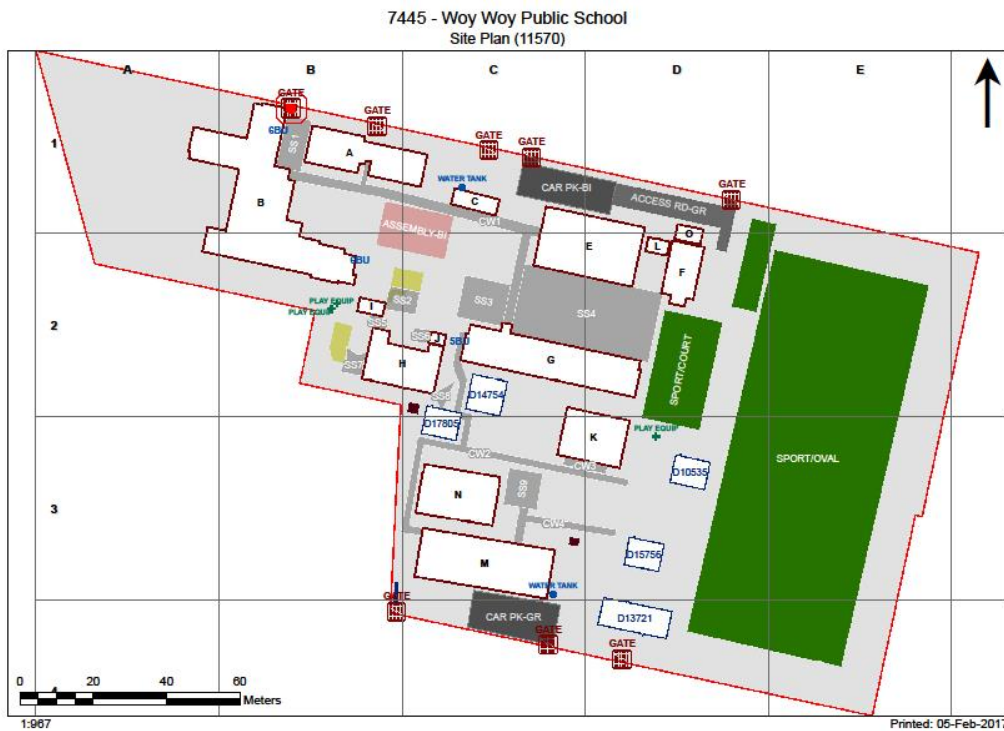

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1954 - Timber (Timber)

Exterior

Eaves Linings	Compressed AC Sheet 7445/B00A/Eaves Linings/S8					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Packing 7445/B00A/Underfloor Voids/S37					No Asbestos Detected

Interior

B00A - R0001 - Deputy Principal

Wall Linings Internal	Compressed AC Sheet 7445/B00A/R0001/Wall Linings Internal/S6					No Asbestos Detected
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00A/R0002/Ceiling Structures/Linings/S5	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Security Store

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00A/R0002/Ceiling Structures/Linings/S5	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Compressed AC Sheet 7445/B00A/R0002/Ceiling Structures/Linings/S5	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0003 - Duplicating Workroom

No Asbestos

B00A - R0004 - Interview

No Asbestos

B00A - R0005 - Principal

No Asbestos

B00A - R0006 - Entry Vestibule

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00A/R0002/Ceiling Structures/Linings/S5	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	--------------	--------------------	---------	---

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Staff Toilet

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00A/R0009/Ceiling Structures/Linings/S4	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

B00A - R0010 - Staff Toilet

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00A/R0009/Ceiling Structures/Linings/S4	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00A - R0011 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0012 - Cleaning Supplies

No Asbestos

B00A - R0013 - Movement

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00A/R0013/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00A - R0014 - Staff Room Annexe

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Compressed AC Sheet	18m2	All surfaces, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Compressed AC Sheet	18m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0015 - Staff Room						
Ceiling Structures/Linings	Compressed AC Sheet	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0016 - Deputy Principal						
Ceiling Structures/Linings	Compressed AC Sheet	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0018 - Clerical Office						
Ceiling Structures/Linings	Compressed AC Sheet	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Compressed AC Sheet	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0018/Wall Linings Internal/S1			Chrysotile (white asbestos)		
B00A - R0019 - General Storeroom						
Ceiling Structures/Linings	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0020 - Sick Bay						
Ceiling Structures/Linings	Compressed AC Sheet	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Compressed AC Sheet					No Asbestos Detected
	7445/B00A/R0020/Wall Linings Internal/S2					
B00A - R0021 - Staff Toilet						
Ceiling Structures/Linings	Compressed AC Sheet	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0022 - Movement						
Ceiling Structures/Linings	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00A/R0002/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Library - 1911 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restrictions 4m BR0008					
Underfloor Voids	Packing 7445/B00B/Underfloor Voids/S40					No Asbestos Detected

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0002/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Compressed AC Sheet 7445/B00B/R0003/Wall Linings Internal/S24	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0003 - Toilets - Boys/Girls

Wall Linings Internal	Compressed AC Sheet 7445/B00B/R0003/Wall Linings Internal/S24	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0002/Ceiling Structures/Linings/S23					No Asbestos Detected

B00B - R0004 - Movement

Wall Linings Internal	Compressed AC Sheet 7445/B00B/R0003/Wall Linings Internal/S24	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0002/Ceiling Structures/Linings/S23					No Asbestos Detected

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Practical Activities - 1hb

No Asbestos

B00B - R0007 - Practical Activities - 1hb

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0014/Ceiling Structures/Linings/S25	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	--------------	--------------------	---------	--

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Movement

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0010/Ceiling Structures/Linings/S26	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00B - R0010 - Movement

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0010/Ceiling Structures/Linings/S26	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00B - R0011 - Kiln Room

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00B/R0010/Ceiling Structures/Linings/S26	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

Redundant panel to floor	Compressed AC Sheet 7445/B00B/R0011/Redundant panel to floor/S27					No Asbestos Detected
--------------------------	---	--	--	--	--	-----------------------------

B00B - R0013 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0014 - Movement						
Ceiling Structures/Linings	Compressed AC Sheet	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7445/B00B/R0014/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	
B00B - R0015 - Special Programs Room						
No Asbestos						
B00B - R0016 - Craft Store						
No Asbestos						
B00B - R0017 - General Storeroom						
No Asbestos						
B00B - R0018 - Home Base						
No Asbestos						
B00B - R0019 - Home Base						
No Asbestos						
B00B - R0020 - Distribution Board				Note: No inspection of live electrical installation.		
Non Accessible						
B00B - R0021 - General Storeroom						
No Asbestos						
B00B - R0022 - Practical Activities - 1hb						
No Asbestos						
B00B - R0023 - Clerical Office						
No Asbestos						
B00B - R0024 - Movement						
No Asbestos						
B00B - R0025 - Movement						
No Asbestos						
B00B - R0026 - Reading Area						
No Asbestos						
B00B - R0027 - Library Office/Workroom						
No Asbestos						
B00B - R0028 - Library Office/Workroom						
No Asbestos						
B00B - R0029 - Reading Area						
No Asbestos						
B00B - R0030 - Cleaning Distributed Store						
No Asbestos						
B00B - R0031 - K.L.A. Store						
No Asbestos						
B00B - R0032 - Movement						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1954 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior

B00C - R0001 - Toilets - Boys

Wall Linings Internal	Compressed AC Sheet 7445/B00C/R0001/Wall Linings Internal/S20					No Asbestos Detected
Wall Linings Internal	Compressed AC Sheet 7445/B00C/R0001/Wall Linings Internal/S21					No Asbestos Detected
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00C/R0001/Wall Linings Internal/S22					No Asbestos Detected

B00C - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 7445/B00C/R0002/Ceiling Structures/Linings/S41					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00C - R0003 - Garden Store

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0004 - Toilets - Girls

Wall Linings Internal	Compressed AC Sheet 7445/B00C/R0001/Wall Linings Internal/S20					No Asbestos Detected
Wall Linings Internal	Compressed AC Sheet 7445/B00C/R0001/Wall Linings Internal/S21					No Asbestos Detected
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00C/R0001/Wall Linings Internal/S22					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Distribution Board Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00E/R0017/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00E - R0002 - Movement

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00E/R0017/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00E - R0003 - Shower/Change

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00E/R0017/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Toilet partitions	Compressed AC Sheet 7445/B00E/R0016/Toilet partitions/S17	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-------------------	--	-----	--------------	--------------------	---------	--

B00E - R0004 - Toilets - Boys

Toilet partitions	Compressed AC Sheet 7445/B00E/R0016/Toilet partitions/S17	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-------------------	--	-----	--------------	--------------------	---------	--

Wall Linings Internal	Compressed AC Sheet 7445/B00E/R0016/Ceiling Structures/Linings/S18					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Disabled Toilet

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00E/R0017/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00E - R0007 - P.E. Store

No Asbestos

B00E - R0008 - Sports Store

No Asbestos

B00E - R0009 - Canteen Office/Store

No Asbestos

B00E - R0010 - Canteen Office/Store

No Asbestos

B00E - R0011 - Canteen

No Asbestos

B00E - R0012 - Communal Space

No Asbestos

B00E - R0013 - Hall Chair Store

No Asbestos

B00E - R0014 - Raised Platform

No Asbestos

B00E - R0015 - Hall Chair Store

No Asbestos

B00E - R0016 - Toilets - Girls

Wall Linings Internal	Compressed AC Sheet 7445/B00E/R0016/Ceiling Structures/Linings/S18					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Toilet partitions	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7445/B00E/R0016/Toilet partitions/S17					Chrysotile (white asbestos)	
Wall Linings Internal	Compressed AC Sheet					
7445/B00E/R0016/Wall Linings Internal/S19					No Asbestos Detected	
B00E - R0017 - Movement						
Ceiling Structures/Linings	Compressed AC Sheet					
7445/B00E/R0017/Ceiling Structures/Linings/S15					No Asbestos Detected	
B00E - R0018 - Shower/Change						
Toilet partitions	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7445/B00E/R0018/Toilet partitions/S16					Chrysotile (white asbestos)	
B00E - R0019 - Plant						
No Asbestos						
B00E - R0020 - Cleaning Distributed Store						
No Asbestos						
B00E - R0021 - Movement						
No Asbestos						
B00E - R0022 - Movement						
Wall cladding	Compressed AC Sheet					
7445/B00E/R0022/Wall cladding/S14					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Other-Community Use - 1959 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - Other-Community Use

No Asbestos

B00F - R0002 - Other-Community Use

No Asbestos

B00F - R0003 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00F/R0005/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	8.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00F/R0005/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0004 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00F/R0005/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	5.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00F/R0005/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0005 - Other-Community Use

Wall Linings Internal	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00F/R0005/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Compressed AC Sheet	75m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7445/B00F/R0005/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Cement flue through ceiling	Fibre Cement Pipe	1Unit(s)	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible Height Restriction					

B00F - R0006 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles	13.81m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	7445/B00F/R0006/Floor Coverings Res/Textile/S39			Chrysotile (white asbestos)		

B00F - R0007 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1954 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible					
Eaves Linings	Compressed AC Sheet 7445/B00G/Eaves Linings/S12	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00G - R0001 - Staff Toilet

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00G/R0001/Wall Linings Internal/S10					No Asbestos Detected
Wall Linings Internal	Compressed AC Sheet 7445/B00G/R0001/Wall Linings Internal/S10					No Asbestos Detected

B00G - R0002 - Home Base

No Asbestos

B00G - R0003 - Practical Activities - 1hb

No Asbestos

B00G - R0004 - Home Base Store

No Asbestos

B00G - R0005 - Practical Activities - 1hb

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0007 - Home Base

No Asbestos

B00G - R0008 - Practical Activities - 1hb

No Asbestos

B00G - R0009 - Home Base Store

No Asbestos

B00G - R0010 - Home Base

Capping to flue through ceiling	Compressed AC Sheet	0.25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction Area inaccessible
---------------------------------	---------------------	--------	--------------	--------------------	---------	--

B00G - R0011 - Practical Activities - 1hb

No Asbestos

B00G - R0012 - Home Base Store

No Asbestos

B00G - R0013 - Home Base

No Asbestos

B00G - R0014 - Practical Activities - 1hb

Ceiling Structures/Linings	Compressed AC Sheet	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	7445/B00G/R0015/Ceiling Structures/Linings/S11					

B00G - R0015 - Movement

Ceiling Structures/Linings	Compressed AC Sheet	95m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	7445/B00G/R0015/Ceiling Structures/Linings/S11					

B00G - R0016 - Distribution Board

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings
Res/Textile

Compressed AC Sheet

7445/B00G/R0016/Floor Coverings Res/Textile/S13

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pre-School Facilities - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Wall Cladding	Compressed AC Sheet 7445/B00H/Wall Cladding/S36					No Asbestos Detected

Interior

B00H - M0001 - Withdrawal - Pre

No Asbestos

B00H - M0002 - Stairs

No Asbestos

B00H - R0001 - Movement

Wall Linings Internal	Compressed AC Sheet 7445/B00H/R0008/Wall Linings Internal/S28	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00H/R0008/Ceiling Structures/Linings/S29	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00H - R0002 - Staff Room - Pre

Floor Coverings Res/Textile	Vinyl Tiles 7445/B00H/R0002/Floor Coverings Res/Textile/S35	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	--------------	--------------------	---------	--

B00H - R0003 - General Storeroom - Pre

No Asbestos

B00H - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0005 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting 7445/B00H/R0008/Wall Linings Internal/S28	13.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	---	--------	------------	--------------------	---------	--

B00H - R0008 - Covered Outdoor Learning Area - Pre

Wall Linings Internal	Compressed AC Sheet 7445/B00H/R0008/Wall Linings Internal/S28	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet 7445/B00H/R0008/Ceiling Structures/Linings/S29	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel	Compressed AC Sheet 7445/B00H/R0008/Infill panel/S30					No Asbestos Detected

B00H - R0009 - Withdrawal - Pre

No Asbestos

B00H - R0010 - General Storeroom - Pre

Ceiling Structures/Linings	Compressed AC Sheet 7445/B00H/R0008/Ceiling Structures/Linings/S29	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	--------------	--------------------	---------	--

B00H - R0011 - Kitchen - Pre

Floor Coverings Res/Textile	Vinyl Tiles 7445/B00H/R0002/Floor Coverings Res/Textile/S35	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00H - R0012 - Staff Room - Pre

Floor Coverings Res/Textile	Vinyl Tiles 7445/B00H/R0002/Floor Coverings Res/Textile/S35	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0013 - Home Base - Pre						
No Asbestos						
B00H - R0014 - Stairs						
No Asbestos						
B00H - R0015 - Covered Outdoor Learning Area - P						
No Asbestos						
B00H - R0016 - Toilets - Boys/Girls - Pre						
Wall Linings Internal	Compressed AC Sheet	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
7445/B00H/R0016/Wall Linings Internal/S32					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Compressed AC Sheet	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7445/B00H/R0008/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00H - R0017 - General Storeroom - Pre						
Wall Linings Internal	Compressed AC Sheet					
7445/B00H/R0017/Wall Linings Internal/S34					No Asbestos Detected	
B00H - R0018 - Staff Toilet						
Wall Linings Internal	Compressed AC Sheet					
7445/B00H/R0018/Wall Linings Internal/S33					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 1991 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B001 - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pre-School Facilities - 2003 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - General Storeroom - Pre

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - Movement

No Asbestos

B00K - R0002 - Practical Activities - 1hb

No Asbestos

B00K - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Practical Activities - 1hb

No Asbestos

B00M - R0002 - Home Base Store

No Asbestos

B00M - R0003 - Home Base

No Asbestos

B00M - R0004 - Withdrawal Space - 2hb

No Asbestos

B00M - R0005 - Practical Activities - 1hb

No Asbestos

B00M - R0006 - Home Base Store

No Asbestos

B00M - R0007 - Home Base

No Asbestos

B00M - R0008 - Practical Activities - 1hb

No Asbestos

B00M - R0009 - Home Base Store

No Asbestos

B00M - R0010 - Home Base

No Asbestos

B00M - R0011 - Withdrawal Space - 2hb

No Asbestos

B00M - R0012 - Practical Activities - 1hb

No Asbestos

B00M - R0013 - Home Base Store

No Asbestos

B00M - R0014 - Home Base

No Asbestos

B00M - R0015 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Practical Activities - M - 1hb

No Asbestos

B00N - R0002 - Home Base Store - M

No Asbestos

B00N - R0003 - Home Base - M

No Asbestos

B00N - R0004 - Withdrawal Space - 2hb

No Asbestos

B00N - R0005 - Practical Activities - M - 1hb

No Asbestos

B00N - R0006 - Home Base Store - M

No Asbestos

B00N - R0007 - Home Base - M

No Asbestos

B00N - R0008 - Laundry - P

No Asbestos

B00N - R0009 - Toilet - M

No Asbestos

B00N - R0010 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Storage - 2014 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - General Assistant/Bulk Store

No Asbestos

B000 - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10535 - Learning Unit - Standard/Withdrawal : Placement Date - 19/01/2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 534 - D13721 - Library/Group Study/Office/A V Store : Placement Date - 7/01/2013

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2
---------	---------------	------------------	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos	14 m2
---------	---------------	------------------	-------

OS 840 - D13991 - Girls Toilet : Placement Date - 9/05/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Toilets-Girls

No Asbestos Found.

NS 120 - D14754 - Learning Unit - Single Primary H/Cap PAA : Placement Date - 28/10/1996

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Exterior

No Asbestos Found.

Interior

R1 - Home Base-I.O.

No Asbestos Found.

R2 - Toilets-Disabled

No Asbestos Found.

R3 - Home Base Store-I.O.

No Asbestos Found.

R4 - Practical Activity Area

No Asbestos Found.

R5 - Entry

No Asbestos Found.

OS 602 - D15756 - Learning Unit - Standard With P.A.A. : Placement Date - 4/01/2010

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 622 - D17805 - Single Learning Unit - Early Childhood : Placement Date - 11/10/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry


End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Home Base-E.I.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Shower/Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	8 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

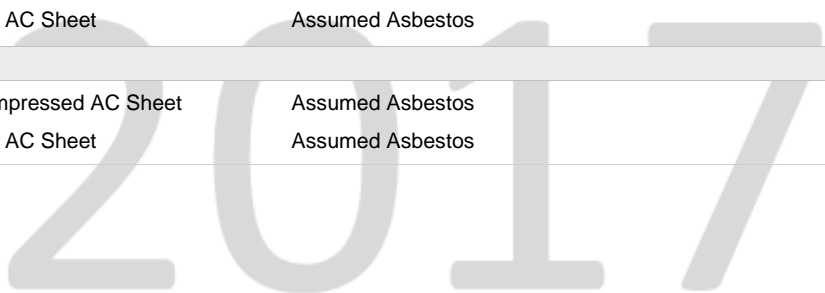

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

7445_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017