


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wagga Wagga High School (8142)
Region : Riverina
State Electorate : Wagga Wagga
Local Government Area : Wagga Wagga

Initial Survey : Noel Arnold & Associates : 18 - Dec - 2009
Reviewed By : Greencap-NAA : 18 - Feb - 2015

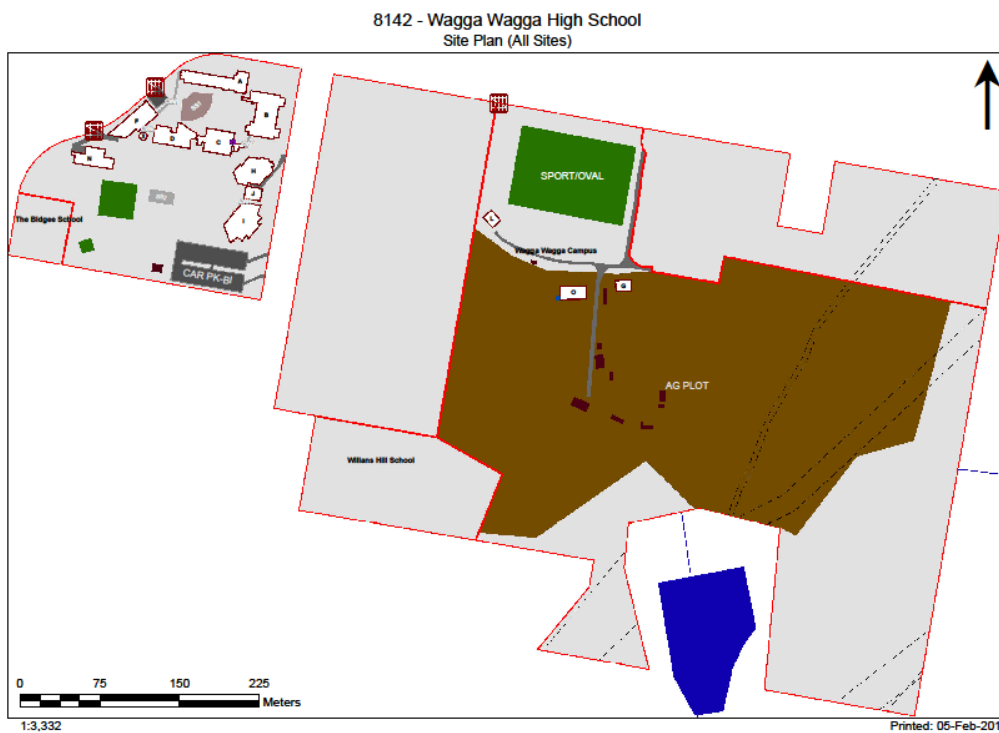

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1961 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/Eaves Linings/S41			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area Assumed Asbestos - Area inaccessible					

Interior

B00A - R0001 - Principal Office (18.65 m2)

No Asbestos

B00A - R0002 - Security Store (4.63 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8142/B00A/R0002/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00A - R0003 - Interview/Office - Type 1 (17.14 m2)

No Asbestos

B00A - R0004 - Leading Teacher (16.93 m2)

No Asbestos

B00A - R0005 - Staff - Toilet (8.6 m2)

No Asbestos

B00A - R0007 - Staff - Toilet (8.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R0007/Ceiling Structures/Linings/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0008 - Staff - Toilet (3.49 m2)

No Asbestos

B00A - R0009 - Movement (11.56 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0055/Floor Coverings Res/Textile/S6			No Asbestos Detected		

B00A - R0023 - Movement (32.33 m2)

No Asbestos

B00A - R0028 - Public Entry (8.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R0007/Ceiling Structures/Linings/S26			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0029 - Administration - Clerical (18.77 m2)

No Asbestos

B00A - R0030 - External Movement (2.26 m2)

No Asbestos

B00A - R0031 - External Movement (2.25 m2)

No Asbestos

B00A - R0033 - General Storeroom (0.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R0033/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0034 - Clinic - Girls (11.73 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0035 - External Movement (1.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1.46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R0007/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0036 - Deputy Principal Office (14.27 m2)						
No Asbestos						
B00A - R0037 - General Storeroom (20.38 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0038 - Duplicating Workroom (39.2 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0039 - General Learning Space (51.09 m2)						
No Asbestos						
B00A - R0040 - General Learning Space (54.52 m2)						
No Asbestos						
B00A - R0041 - General Learning Space (54.81 m2)						
No Asbestos						
B00A - R0042 - Movement (77.19 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0043 - Movement (37.27 m2)						
No Asbestos						
B00A - R0044 - Leading Teacher (11 m2)						
No Asbestos						
B00A - R0045 - Leading Teacher (13.25 m2)						
No Asbestos						
B00A - R0046 - Movement (20.95 m2)						
No Asbestos						
B00A - R0047 - Distribution Board Cupboard (0.87 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0048 - Administration - Clerical (46.72 m2)						
No Asbestos						
B00A - R0049 - Pupil Entry (22.72 m2)						
No Asbestos						
B00A - R0050 - Public Entry (2.09 m2)						
No Asbestos						
B00A - R0051 - Clinic - Boys (11.68 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0052 - General Storeroom (0.96 m2)						
No Asbestos						
B00A - R0053 - Movement (11.16 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0054 - Stairs (16.18 m2)						
No Asbestos						
B00A - R0055 - Stairs (7.74 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0055/Floor Coverings Res/Textile/S6					No Asbestos Detected
B00A - R1001 - Commonroom (143.4 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R1002 - Staff Study (35.82 m2)						
No Asbestos						
B00A - R1003 - Staff - Toilet (5.96 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R1003/Floor Coverings Res/Textile/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R1003/Wall Linings Internal/S9					Chrysotile (white asbestos)
B00A - R1004 - Staff - Toilet (3.52 m2)						
No Asbestos						
B00A - R1005 - Computer Resource (6.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R1005/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00A - R1006 - General Learning Space (53.51 m2)						
No Asbestos						
B00A - R1007 - General Learning Space (53.87 m2)						
No Asbestos						
B00A - R1008 - General Learning Space (53.66 m2)						
No Asbestos						
B00A - R1009 - General Learning Space (53.87 m2)						
No Asbestos						
B00A - R1010 - General Learning Space (55.41 m2)						
No Asbestos						
B00A - R1011 - Movement (147.51 m2)						
No Asbestos						
B00A - R1012 - General Storeroom (4.24 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R1013 - Staff Study (34.69 m2)						
No Asbestos						
B00A - R1014 - Stairs (14.95 m2)						
No Asbestos						
B00A - R1015 - Stairs (15.63 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R0055/Floor Coverings Res/Textile/S6					No Asbestos Detected
B00A - R9011 - Cleaning Store - Distributed (5.87 m2)						
No Asbestos						
B00A - R9012 - Movement (4.38 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00A - R9013 - External Movement (1.82 m2)						
No Asbestos						
B00A - R9014 - Student Canteen (59.47 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R9016/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R9015 - General Storeroom (3.98 m2)						
No Asbestos						
B00A - R9016 - Movement (13.33 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R9016/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R9017 - Office/Store (8.89 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00A/R9016/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00A - R9018 - Staff - Toilet (6.78 m2)						
No Asbestos						
B00A - R9019 - Movement (126.08 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8142/B00A/R9019/Ceiling Structures/Linings/S2					No Asbestos Detected
B00A - R9020 - Stairs (9.9 m2)						
No Asbestos						
B00A - R9021 - Cleaning Store - Distributed (12.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R9022/Ceiling Structures/Linings/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R9022 - Cleaning Store - Distributed (8.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R9022/Ceiling Structures/Linings/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R9023 - Toilets-Girls (52.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R9022/Ceiling Structures/Linings/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R9024 - General Storeroom (13.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R9022/Ceiling Structures/Linings/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R9025 - Toilets-Boys (47.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R9022/Ceiling Structures/Linings/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R9026 - General Storeroom (13.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00A/R9022/Ceiling Structures/Linings/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1917 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 8142/B00B/Wall Cladding/S40					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Computer Resource (20.83 m2)**

No Asbestos

B00B - R0002 - Pupil Entry (6.25 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8142/B00B/R0002/Floor Coverings Res/Textile/S13	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00B - R0003 - General Learning Space (47.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8142/B00B/R0003/Ceiling Structures/Linings/S34	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0004 - General Learning Space (48.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8142/B00B/R0003/Ceiling Structures/Linings/S34	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0005 - Pupil Entry (7.32 m2)

No Asbestos

B00B - R0007 - Staff Study (20.33 m2)

No Asbestos

B00B - R0008 - General Learning Space (47.88 m2)

No Asbestos

B00B - R0009 - General Learning Space (43.75 m2)

No Asbestos

B00B - R0010 - General Learning Space (39.82 m2)

No Asbestos

B00B - R0011 - Toilets-Disabled (7.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8142/B00B/R0003/Ceiling Structures/Linings/S34	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0012 - General Storeroom (20.59 m2)

Wall Linings Internal	Flat AC Sheeting 8142/B00B/R0012/Wall Linings Internal/S14	15m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 8142/B00B/R0003/Ceiling Structures/Linings/S34	20.59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0013 - General Storeroom (21.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8142/B00B/R0003/Ceiling Structures/Linings/S34	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0014 - Toilets-Disabled (12.88 m2)						
No Asbestos						
B00B - R0015 - Special Learning Space (62.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	63m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R0019 - Computer Learning Space (43.5 m2)						
No Asbestos						
B00B - R0020 - General Learning Space (39.45 m2)						
No Asbestos						
B00B - R0021 - General Learning Space (43.48 m2)						
No Asbestos						
B00B - R0022 - General Learning Space (47.47 m2)						
No Asbestos						
B00B - R0023 - Pupil Entry (8.74 m2)						
No Asbestos						
B00B - R0024 - External Movement (36.27 m2)						
No Asbestos						
B00B - R0026 - External Movement (4.42 m2)						
No Asbestos						
B00B - R0027 - Stairs (8.88 m2)						
No Asbestos						
B00B - R0028 - Stairs (13.47 m2)						
No Asbestos						
B00B - R0029 - Stairs (13.48 m2)						
No Asbestos						
B00B - R0030 - External Movement (4.84 m2)						
No Asbestos						
B00B - R0031 - Movement (191.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	192m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Floor Coverings Res/Textile	Vinyl Sheet					
8142/B00B/R0031/Floor Coverings Res/Textile/S12				No Asbestos Detected		
B00B - R0032 - General Learning Space (64.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Wall Linings Internal	Flat AC Sheeting	40.2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0012/Wall Linings Internal/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0033 - Staff Study (21.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R0034 - External Movement (2.97 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	2.97m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R1001 - Staff Study (27.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R1002 - Staff - Toilet (3.65 m2)						
No Asbestos						
B00B - R1003 - Pupil Entry (5.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0002/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00B - R1004 - Staff Study (15.78 m2)						
No Asbestos						
B00B - R1005 - Performance Workspace (81.39 m2)						
No Asbestos						
B00B - R1006 - Pupil Entry (6.78 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0002/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00B - R1007 - Staff Study (35.23 m2)						
No Asbestos						
B00B - R1008 - General Learning Space (47.8 m2)						
No Asbestos						
B00B - R1009 - General Learning Space (43.75 m2)						
No Asbestos						
B00B - R1010 - General Learning Space (40.02 m2)						
No Asbestos						
B00B - R1011 - Pupil Entry (7.12 m2)						
No Asbestos						
B00B - R1012 - Movement (189.63 m2)						
Wall Linings Internal	Flat AC Sheeting	70m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0012/Wall Linings Internal/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1013 - Pupil Entry (8.78 m2)						
No Asbestos						
B00B - R1014 - General Learning Space (46.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R1015 - General Learning Space (41.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R1016 - General Learning Space (45.22 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R1017 - General Learning Space (49.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R1018 - Stairs (8.97 m2)						
No Asbestos						
B00B - R1019 - Stairs (13.7 m2)						
No Asbestos						
B00B - R1020 - Stairs (11.22 m2)						
No Asbestos						
B00B - R1021 - Stairs (8.67 m2)						
No Asbestos						
B00B - R9001 - General Assistants (45.72 m2)						
No Asbestos						
B00B - R9002 - Shower/Change (41.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R0003/Ceiling Structures/Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R9003 - Movement (17.42 m2)						
No Asbestos						
B00B - R9004 - General Learning Space (41.98 m2)						
Ceiling Structures/Linings	Vermiculite					
8142/B00B/R9004/Wall Linings Internal/S11				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R9005 - Sport Equipment Store (34.35 m2)						
No Asbestos						
B00B - R9006 - Toilets-Disabled (3.88 m2)						
No Asbestos						
B00B - R9007 - Shower/Change (39.93 m2)						
Wall Linings Internal	Flat AC Sheeting	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00B/R9007/Wall Linings Internal/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9008 - External Movement (4.09 m2)						
No Asbestos						
B00B - R9009 - Pupil Entry (7.65 m2)						
No Asbestos						
B00B - R9010 - Stairs (4.39 m2)						
No Asbestos						
B00B - R9011 - Stairs (11.64 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Science Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - M2001 - Seminar (39.01 m2)**

No Asbestos

B00C - M2002 - Seminar (70.08 m2)

No Asbestos

B00C - M2003 - Staff Study (16.14 m2)

No Asbestos

B00C - M2004 - Stairs (4.29 m2)

No Asbestos

B00C - M2005 - Stairs (4.68 m2)

No Asbestos

B00C - R0001 - General Learning Space (63.54 m2)

Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0002 - External Movement (3.5 m2)

No Asbestos

B00C - R0005 - Textiles Technology L.S. (66.19 m2)

Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Sheet 8142/B00C/R0006/Floor Coverings Res/Textile/S16	No Asbestos Detected
-----------------------------	--	----------------------

B00C - R0006 - Resource/Project Store (5.88 m2)

Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Sheet 8142/B00C/R0006/Floor Coverings Res/Textile/S16	No Asbestos Detected
-----------------------------	--	----------------------

B00C - R0007 - Materials Store (8.93 m2)

Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles 8142/B00C/R0012/Floor Coverings Res/Textile/S15	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B00C - R0008 - Bulk Store (8.67 m2)

Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles 8142/B00C/R0012/Floor Coverings Res/Textile/S15	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B00C - R0009 - Computer Learning Space (60.32 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8142/B00C/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00C - R0010 - Plant (5.42 m2)						
No Asbestos						
B00C - R0011 - Plant (5.84 m2)						
No Asbestos						
B00C - R0012 - Resources Store (5.81 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8142/B00C/R0012/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0013 - Cleaning Store - Distributed (0.68 m2)						
No Asbestos						
B00C - R0014 - Workshop (67.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8142/B00C/R0012/Floor Coverings Res/Textile/S15	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0015 - General Learning Space (67.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8142/B00C/R0012/Floor Coverings Res/Textile/S15	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0016 - Movement (67.63 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00C - R0017 - External Movement (3.5 m2)						
No Asbestos						
B00C - R0018 - Distribution Board Cupboard (8.17 m2)						
No Asbestos						
B00C - R0019 - General Learning Space (58.23 m2)						
Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0020 - Resources Space (3.58 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8142/B00A/R0051/Floor Coverings Res/Textile/S5					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8142/B00C/R0014/Ceiling Structures/Linings/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0021 - Stairs (16.49 m2)						
No Asbestos						
B00C - R0022 - Stairs (8.61 m2)						
No Asbestos						
B00C - R1001 - Laboratory L.S. (90.93 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00C/R0012/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8142/B00C/R0014/Ceiling Structures/Linings/S35				Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Heat-proof Mat	Compressed AC Sheet					
8142/B00C/R1009/Heat-proof Mat/S17				No Asbestos Detected		
B00C - R1002 - External Movement (3.15 m2)						
No Asbestos						
B00C - R1003 - Laboratory L.S. (91.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00C/R0012/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8142/B00C/R0014/Ceiling Structures/Linings/S35				Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00C - R1006 - Laboratory L.S. (91.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00C/R0012/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8142/B00C/R0014/Ceiling Structures/Linings/S35				Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00C - R1007 - External Movement (26.26 m2)						
No Asbestos						
B00C - R1008 - No Access (1.34 m2)						
No Asbestos						
B00C - R1009 - Laboratory L.S. (91.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00C/R0012/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8142/B00C/R0014/Ceiling Structures/Linings/S35				Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Heat-proof Mat	Compressed AC Sheet					
8142/B00C/R1009/Heat-proof Mat/S17				No Asbestos Detected		
B00C - R1012 - Movement (59.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00C/R0012/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1013 - Stairs (16.49 m2)						
No Asbestos						
B00C - R1014 - Stairs (16.44 m2)						
No Asbestos						
B00C - R1015 - Chemical Store (48.49 m2)						
Ceiling Structures/Linings	Vermiculite					
8142/B00C/R0014/Ceiling Structures/Linings/S35				Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00C - R1016 - Chemical Store (48.42 m2)						
Ceiling Structures/Linings	Vermiculite					
8142/B00C/R0014/Ceiling Structures/Linings/S35				Limited Samples Taken		
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00C - R2001 - Workroom (12.63 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R2002 - Workroom (17.67 m2)						
No Asbestos						
B00C - R2003 - Staff - Toilet (2.99 m2)						
No Asbestos						
B00C - R2004 - Staff - Toilet (3.05 m2)						
No Asbestos						
B00C - R2005 - Seminar (72.12 m2)						
Ceiling Structures/Linings	Vermiculite		8142/B00C/R0014/Ceiling Structures/Linings/S35			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2008 - Cleaning Store - Distributed (4.67 m2)						
No Asbestos						
B00C - R2009 - Seminar (11.61 m2)						
No Asbestos						
B00C - R2010 - Seminar (13.46 m2)						
No Asbestos						
B00C - R2011 - Main Area (328.13 m2)						
Ceiling Structures/Linings	Vermiculite		8142/B00C/R0014/Ceiling Structures/Linings/S35			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2012 - Audio Visual Workroom (28.9 m2)						
Ceiling Structures/Linings	Vermiculite		8142/B00C/R0014/Ceiling Structures/Linings/S35			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2013 - Workroom (11.31 m2)						
Ceiling Structures/Linings	Vermiculite		8142/B00C/R0014/Ceiling Structures/Linings/S35			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2014 - Movement (1.73 m2)						
No Asbestos						
B00C - R2015 - Plant (14.18 m2)						
No Asbestos						
B00C - R2017 - Stairs (16.49 m2)						
No Asbestos						
B00C - R2018 - Stairs (16.44 m2)						
No Asbestos						
B00C - R2019 - Stairs (0.86 m2)						
No Asbestos						
B00C - R2020 - Stairs (0.85 m2)						
No Asbestos						
B00C - R2021 - Seminar (25.26 m2)						
No Asbestos						
B00C - R2022 - Movement (3.24 m2)						
No Asbestos						
B00C - R2023 - Movement (28.27 m2)						
No Asbestos						
B00C - R9003 - Movement (11.64 m2)						
No Asbestos						
B00C - R9004 - External Stairs (5.96 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Art/Music - 1996 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0002 - Toilets-Boys (29.98 m2)

No Asbestos

B00D - R0003 - Distribution Board Cupboard (1.43 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0004 - Materials Technology L.S. (101.74 m2)

Floor Coverings Res/Textile	Vinyl Sheet	8142/B00C/R0006/Floor Coverings Res/Textile/S16	No Asbestos Detected
-----------------------------	-------------	---	-----------------------------

B00D - R0005 - General Storeroom (15.5 m2)

No Asbestos

B00D - R0006 - Computer Learning Space (15.31 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00D - R0007 - Computer Learning Space (79.21 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00D - R0008 - Staff Study (57.03 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00D - R0009 - Cleaning Store - Distributed (4.44 m2)

No Asbestos

B00D - R0010 - Distribution Board Cupboard (0.62 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	.2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8142/B00D/R0010/Electrical Backing Board/S36						Chrysotile (white asbestos)

B00D - R0011 - External Movement (249.91 m2)

No Asbestos

B00D - R0012 - Plant (0.26 m2)

No Asbestos

B00D - R0013 - General Storeroom (10.4 m2)

No Asbestos

B00D - R1002 - Toilets-Girls (31.04 m2)

No Asbestos

B00D - R1003 - Distribution Board Cupboard (0.54 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R1004 - Art Learning Space (60.77 m2)

Floor Coverings Res/Textile	Vinyl Sheet	8142/B00D/R2008/Floor Coverings Res/Textile/S18	No Asbestos Detected
-----------------------------	-------------	---	-----------------------------

B00D - R1005 - Art Learning Space (51.56 m2)

No Asbestos

B00D - R1006 - Kiln Space (9.03 m2)

No Asbestos

B00D - R1007 - Darkroom Space (31.46 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet	8142/B00D/R2008/Floor Coverings Res/Textile/S18			No Asbestos Detected	
B00D - R1008 - Art Learning Space (60.45 m2)						
Floor Coverings Res/Textile	Vinyl Sheet	8142/B00D/R2008/Floor Coverings Res/Textile/S18			No Asbestos Detected	
B00D - R1009 - General Storeroom (7.7 m2)						
No Asbestos						
B00D - R1010 - Movement (6.64 m2)						
No Asbestos						
B00D - R1011 - Distribution Board Cupboard (0.79 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00D - R1012 - Staff - Toilet (4.41 m2)						
No Asbestos						
B00D - R1013 - Staff - Toilet (4.44 m2)						
No Asbestos						
B00D - R1014 - Staff Study (26.81 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R1015 - Cleaning Store - Distributed (4.51 m2)						
No Asbestos						
B00D - R1016 - Resources Space (33.13 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R1017 - General Storeroom (16.72 m2)						
No Asbestos						
B00D - R1018 - Art Outdoor Area (99.3 m2)						
No Asbestos						
B00D - R1019 - External Movement (116.92 m2)						
No Asbestos						
B00D - R1020 - Plant (0.32 m2)						
No Asbestos						
B00D - R2002 - Cleaning Store - Distributed (3.2 m2)						
No Asbestos						
B00D - R2003 - Staff Study (35.81 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R2004 - Laboratory L.S. (93.28 m2)						
Floor Coverings Res/Textile	Vinyl Sheet	8142/B00D/R2008/Floor Coverings Res/Textile/S18			No Asbestos Detected	
Heat-proof Mat	Compressed AC Sheet	8142/B00C/R1009/Heat-proof Mat/S17			No Asbestos Detected	
B00D - R2005 - Preparation (28.79 m2)						
Floor Coverings Res/Textile	Vinyl Sheet	8142/B00D/R2008/Floor Coverings Res/Textile/S18			No Asbestos Detected	
B00D - R2006 - General Storeroom (30.65 m2)						
No Asbestos						
B00D - R2007 - Bulk Store (15.4 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R2008 - Laboratory L.S. (94.19 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00D/R2008/Floor Coverings Res/Textile/S18					No Asbestos Detected
Heat-proof Mat	Compressed AC Sheet					
	8142/B00C/R1009/Heat-proof Mat/S17					No Asbestos Detected
B00D - R2009 - Distribution Board Cupboard (0.77 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00D - R2010 - External Movement (124.63 m2)						
No Asbestos						
B00D - R2011 - Plant (0.38 m2)						
No Asbestos						
B00D - R3002 - General Learning Space (71.62 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3003 - Staff Study (16.58 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3004 - Movement (10.53 m2)						
No Asbestos						
B00D - R3005 - Practice/Seminar (25.26 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3006 - Music Learning Space (62.61 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3007 - Resources (25.78 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3008 - Music Learning Space (80.46 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3009 - Cleaning Store - Distributed (3.12 m2)						
No Asbestos						
B00D - R3010 - Disabled Toilet (5.11 m2)						
No Asbestos						
B00D - R3011 - Music Store (25.19 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3012 - Other (12.63 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3013 - Staff Study (11.4 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00D - R3014 - Distribution Board Cupboard (0.96 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00D - R3015 - External Movement (114.75 m2)						
No Asbestos						
B00D - R3016 - Plant (0.32 m2)						
No Asbestos						
B00D - R9001 - Computer Learning Space (89.35 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1996 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Cleaning Store - Distributed (5.97 m2)

No Asbestos

B00F - R0002 - Movement (3.17 m2)

No Asbestos

B00F - R0003 - Dust Extraction Space (6.89 m2)

No Asbestos

B00F - R0004 - Distribution Board Cupboard (0.91 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0005 - Materials Technology L.S. (98.77 m2)

Floor Coverings Res/Textile	Vinyl Sheet
	8142/B00F/R0005/Floor Coverings Res/Textile/S19

No Asbestos Detected

B00F - R0006 - General Storeroom (11.07 m2)

No Asbestos

B00F - R0007 - Wood Technology Bay (34.65 m2)

Floor Coverings Res/Textile	Vinyl Sheet
	8142/B00F/R0005/Floor Coverings Res/Textile/S19

No Asbestos Detected

B00F - R0008 - Materials Technology L.S. (171.46 m2)

Floor Coverings Res/Textile	Vinyl Sheet
	8142/B00F/R0005/Floor Coverings Res/Textile/S19

No Asbestos Detected

B00F - R0009 - Welding Area (8.83 m2)

No Asbestos

B00F - R0010 - Metal Technology Bay (33.28 m2)

No Asbestos

B00F - R0011 - General Storeroom (2.91 m2)

No Asbestos

B00F - R0012 - Materials Technology L.S. (55.45 m2)

No Asbestos

B00F - R0013 - Welding Area (5.7 m2)

No Asbestos

B00F - R0014 - Welding Area (7.06 m2)

No Asbestos

B00F - R0015 - Materials Store (34.18 m2)

No Asbestos

B00F - R0016 - Distribution Board Cupboard (0.65 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0017 - Materials Store (18.26 m2)

No Asbestos

B00F - R0018 - L.P.G. Store (1.84 m2)

No Asbestos

B00F - R0019 - Plant (2.03 m2)

No Asbestos

B00F - R0020 - External Movement (66.52 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00F - R0021 - External Movement (29.21 m2)

No Asbestos

B00F - R1001 - External Movement (53.29 m2)

No Asbestos

B00F - R1002 - Distribution Board Cupboard (0.59 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R1003 - Food Technology L.S. (35.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R1004 - Food Technology L.S. (74.37 m2)

Floor Coverings Res/Textile

Vinyl Sheet

8142/B00F/R0005/Floor Coverings Res/Textile/S19

No Asbestos Detected

B00F - R1005 - Movement (28.94 m2)

Floor Coverings Res/Textile

Vinyl Sheet

8142/B00F/R0005/Floor Coverings Res/Textile/S19

No Asbestos Detected

B00F - R1010 - Interview/Office - Type 1 (13.27 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R1011 - Movement (0.79 m2)

No Asbestos

B00F - R1013 - Pantry (5.71 m2)

No Asbestos

B00F - R1018 - Food Technology L.S. (99.43 m2)

No Asbestos

B00F - R1019 - Food/Research Space (14.49 m2)

No Asbestos

B00F - R1020 - Laundry (1.1 m2)

No Asbestos

B00F - R1021 - Store - Coolroom (2.87 m2)

No Asbestos

B00F - R1022 - Store - Coolroom (1.39 m2)

No Asbestos

B00F - R1023 - Movement (8.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Agricultural Science - 1960 - Timber (Timber)**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior**B00G - R0001 - External Movement (19.64 m2)**

Floor Coverings Res/Textile	Flat AC Sheeting					
	8142/B00G/R0001/Floor Coverings Res/Textile/S22					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00G/R0001/Wall Linings Internal/S23					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					
	8142/B00G/R0001/Ceiling Structures/Linings/S39					No Asbestos Detected

B00G - R0002 - General Learning Space (52.19 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00G/R0002/Floor Coverings Res/Textile/S24					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8142/B00G/R0003/Wall Linings Internal/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0003 - General Learning Space (52.19 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8142/B00G/R0002/Floor Coverings Res/Textile/S24					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	32m2	All surfaces, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8142/B00G/R0003/Wall Linings Internal/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Cleaning Store - Distributed (5.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8142/B00G/R0001/Ceiling Structures/Linings/S39					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	11m2	All surfaces, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8142/B00G/R0003/Wall Linings Internal/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0005 - Toilets-Unisex (6.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8142/B00G/R0001/Ceiling Structures/Linings/S39					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	21m2	All surfaces, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8142/B00G/R0003/Wall Linings Internal/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Multi Purpose Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling

Underfloor Voids Non Accessible Area
- Area inaccessible

Interior

B00H - R0001 - Toilets-Girls (5.84 m2)

No Asbestos

B00H - R0002 - Public Entry (24.06 m2)

No Asbestos

B00H - R0003 - Student Canteen (15.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8142/B00H/R0003/Floor Coverings Res/Textile/S20						Chrysotile (white asbestos)

B00H - R0006 - Stage (100.03 m2)

No Asbestos

B00H - R0008 - Multi-Purpose Space (447.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting	448m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

B00H - R0010 - Toilets-Boys (7.91 m2)

No Asbestos

B00H - R0011 - External Movement (9.37 m2)

No Asbestos

B00H - R0012 - External Movement (5.35 m2)

No Asbestos

B00H - R0013 - External Movement (4.12 m2)

No Asbestos

B00H - R0014 - External Movement (4.06 m2)

No Asbestos

B00H - R0015 - External Movement (4.86 m2)

No Asbestos

B00H - R9001 - Chair Store (37.18 m2)

No Asbestos

B00H - R9002 - Pupil Entry (2.68 m2)

No Asbestos

B00H - R9003 - Toilets-Girls (5.91 m2)

No Asbestos

B00H - R9004 - Performing Arts Changeroom (10.96 m2)

No Asbestos

B00H - R9005 - Performing Arts Changeroom (10.96 m2)

No Asbestos

B00H - R9006 - Toilets-Boys (5.91 m2)

No Asbestos

B00H - R9007 - Pupil Entry (2.49 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Physical Education - 1996 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00I - R0001 - Chair Store (36.73 m2)**

No Asbestos

B00I - R0002 - Gymnasium (477.96 m2)

No Asbestos

B00I - R0003 - Distribution Board Cupboard (0.67 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0004 - Shower/Change (54.85 m2)

No Asbestos

B00I - R0005 - Disabled Toilet (4.96 m2)

No Asbestos

B00I - R0006 - Shower/Change (55.07 m2)

No Asbestos

B00I - R0007 - Cleaning Store - Distributed (0.52 m2)

No Asbestos

B00I - R0008 - Sport Equipment Store (21.82 m2)

No Asbestos

B00I - R0009 - General Storeroom (38.39 m2)

No Asbestos

B00I - R0010 - Disabled Toilet (5.1 m2)

No Asbestos

B00I - R0011 - Plant (1.81 m2)

No Asbestos

B00I - R0012 - Staff Study (16.09 m2)

Floor Coverings Res/Textile	Vinyl Sheet	
	8142/B00A/R0051/Floor Coverings Res/Textile/S5	No Asbestos Detected

B00I - R0013 - Staff - Toilet (2.85 m2)

No Asbestos

B00I - R0014 - Staff Change (3.48 m2)

No Asbestos

B00I - R0015 - External Movement (14.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	
	8142/B00I/R0019/Ceiling Structures/Linings/S37	No Asbestos Detected

B00I - R0016 - External Movement (15.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	
	8142/B00I/R0019/Ceiling Structures/Linings/S37	No Asbestos Detected

B00I - R0017 - External Movement (50.66 m2)

No Asbestos

B00I - R0018 - Plant (0.34 m2)

No Asbestos

B00I - R0019 - External Movement (10.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	
	8142/B00I/R0019/Ceiling Structures/Linings/S37	No Asbestos Detected

B00I - R0020 - External Movement (10.89 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Flat AC Sheeting
 8142/B001/R0019/Ceiling Structures/Linings/S37

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1996 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - No Access (9.54 m2)

No Asbestos

B00J - R0002 - No Access (14.57 m2)

No Asbestos

B00J - R0003 - Toilets-Girls (22.99 m2)

No Asbestos

B00J - R0004 - Toilets-Boys (22.99 m2)

No Asbestos

B00J - R0005 - Disabled Toilet (4.62 m2)

Floor Coverings Res/Textile	Vinyl Sheet
8142/B00J/R0005/Floor Coverings Res/Textile/S21	

No Asbestos Detected

B00J - R0006 - General Storeroom (15.54 m2)

No Asbestos

B00J - R0007 - External Movement (25.79 m2)

No Asbestos

B00J - R0008 - Cleaning Store - Distributed (3.01 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Awnings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00L/R0001/Ceiling Structures/Linings/S38			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground						

Interior

B00L - R0001 - External Movement (24.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00L/R0001/Ceiling Structures/Linings/S38			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0002 - Access Shower/Toilet/Change (52.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	52.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00L/R0001/Ceiling Structures/Linings/S38			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0003 - Access Shower/Toilet/Change (52.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8142/B00L/R0001/Ceiling Structures/Linings/S38			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Technological & Applied Studies - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling

Underfloor Voids - Slab on Ground

Interior

B00N - R0001 - Welding Area (131.7 m2)

No Asbestos

B00N - R0002 - Materials Store (19.42 m2)

No Asbestos

B00N - R0003 - Project Store - Type 1 (6.98 m2)

No Asbestos

B00N - R0004 - General Learning Space - Type 6 (42.45 m2)

No Asbestos

B00N - R0005 - Project Store - Type 1 (7.08 m2)

No Asbestos

B00N - R0006 - Wood Technology Bay (123.4 m2)

No Asbestos

B00N - R0007 - Materials Store (19.25 m2)

No Asbestos

B00N - R0008 - Dust Extraction Space (7.67 m2)

No Asbestos

B00N - R0009 - External Movement (132.73 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Agricultural Science - 2010 - Steel (Steel)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground

Interior

B000 - R0001 - General Learning Space (50.3 m2)

No Asbestos

B000 - R0002 - Class Tools Storage (16.27 m2)

No Asbestos

B000 - R0003 - Animal Space (143.97 m2)

No Asbestos

B000 - R0004 - Machine Storage (71.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00X - Mechanical Services - 1996 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00X - R0001 - Movement (12.64 m2)

No Asbestos

B00X - R0002 - Lift (3.24 m2)

No Asbestos

B00X - R0003 - Stairs (16.1 m2)

No Asbestos

B00X - R1001 - Movement (12.53 m2)

No Asbestos

B00X - R1002 - Lift (2.7 m2)

No Asbestos

B00X - R1003 - Stairs (16.1 m2)

No Asbestos

B00X - R2001 - Movement (14.45 m2)

No Asbestos

B00X - R2002 - Lift (2.7 m2)

No Asbestos

B00X - R2003 - Stairs (16.1 m2)

No Asbestos

B00X - R3001 - Movement (8.5 m2)

No Asbestos

B00X - R3002 - Lift (2.7 m2)

No Asbestos

B00X - R3003 - Movement (3.3 m2)

No Asbestos

B00X - R3004 - Stairs (16.1 m2)

No Asbestos

B00X - R9001 - Movement (9.43 m2)

No Asbestos

B00X - R9002 - Plant (5.46 m2)

No Asbestos

B00X - R9003 - Lift (2.7 m2)

No Asbestos

B00X - R9004 - Stairs (15.39 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017