


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Willoughby Girls High School (8159)
Region : Northern Sydney
State Electorate : Willoughby
Local Government Area : Willoughby

Initial Survey : Noel Arnold & Associates : 15 - Jan - 2008
Reviewed By : Grencap-NAA : 07 - Oct - 2015

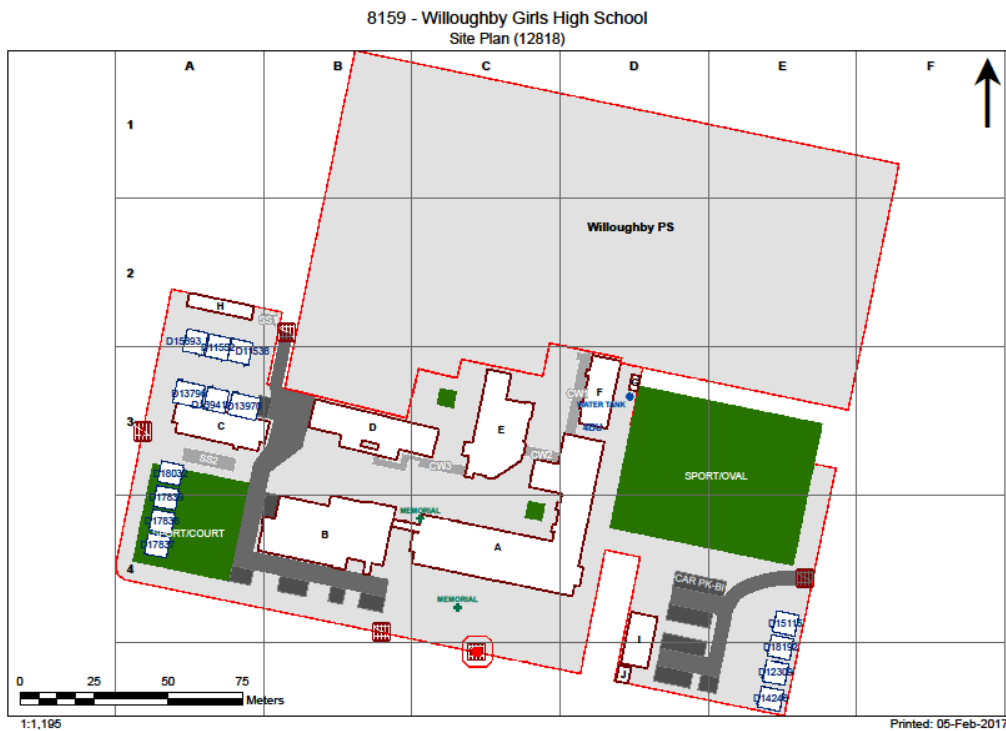

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration/Art - 1934 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					
Gable Ends	Flat AC Sheeting	10m	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8159/B00D/R0016/Gable ends - packer/S33					Chrysotile (white asbestos)

Interior

B00A - R0001 - Materials Technology L.S. (67.29 m2)

No Asbestos

B00A - R0002 - Resources Store (7.22 m2)

No Asbestos

B00A - R0003 - Food Technology L.S. (76.15 m2)

No Asbestos

B00A - R0004 - Kitchen - Type 1 (77.45 m2)

No Asbestos

B00A - R0005 - Staff Study (12.42 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected

B00A - R0007 - Student Waiting (8.72 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00A/R0032/Floor Coverings Res/Textile/S8					No Asbestos Detected

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected

B00A - R0009 - Careers Advisers Office (11.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0011 - External Movement (9.86 m2)

No Asbestos

B00A - R0012 - Staff - Toilet (9.2 m2)

No Asbestos

B00A - R0013 - Main Switch Board Cupboard (1.61 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	14m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8159/B00A/R0013/Wall Linings Internal/S14					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00A - R0014 - General Learning Space (47.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0015 - General Learning Space (47.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0016 - Archive Store (9.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0017 - Cleaning Store - Distributed (7.57 m2)						
No Asbestos						
B00A - R0018 - Deputy Principal Office (19.32 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0019 - Staff - Toilet (6.09 m2)						
No Asbestos						
B00A - R0020 - Principal Office (19.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0021 - Staff - Toilet (6.12 m2)						
No Asbestos						
B00A - R0022 - Secure Storeroom (3.22 m2)						
No Asbestos						
B00A - R0023 - Resources Store (13.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Adhesive to VFT	Adhesive					No Asbestos Detected
	8159/B00A/R0034/Adhesive to brown VFT/S34					
B00A - R0024 - General Learning Space (47.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0025 - General Learning Space (47.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0026 - Interview/Office - Type 1 (10.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0027 - General Learning Space (47.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0029 - Interview/Meeting (47.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0033 - Printing/Photocopying (28.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R0034 - Resources Store (7.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Adhesive to brown VFT	Adhesive 8159/B00A/R0034/Adhesive to brown VFT/S34					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0035 - Interview/Office - Type 1 (10.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8159/B00A/R0034/Floor Coverings Res/Textile/S9	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0036 - Leading Teacher (9.87 m2)						
No Asbestos						
B00A - R0037 - Preparation (13.51 m2)						
No Asbestos						
B00A - R0038 - Staff Study (16.1 m2)						
No Asbestos						
B00A - R0039 - Staff Study (14.34 m2)						
No Asbestos						
B00A - R0040 - Staff - Toilet (4.77 m2)						
No Asbestos						
B00A - R0041 - Staff Study (16.81 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0034/Floor Coverings Res/Textile/S9	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0043 - External Movement (2.04 m2)						
No Asbestos						
B00A - R0044 - External Movement (2.02 m2)						
No Asbestos						
B00A - R0045 - External Movement (1.62 m2)						
No Asbestos						
B00A - R0046 - Movement (7.62 m2)						
No Asbestos						
B00A - R0048 - Movement (20.83 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00B/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0049 - Stairs (13.99 m2)						
No Asbestos						
B00A - R0051 - Stairs (2.08 m2)						
No Asbestos						
B00A - R0052 - Stairs (1.32 m2)						
No Asbestos						
B00A - R0053 - External Movement (12.68 m2)						
No Asbestos						
B00A - R0054 - Stairs (9.48 m2)						
No Asbestos						
B00A - R0055 - Movement (2.61 m2)						
No Asbestos						
B00A - R0056 - Movement (17.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0034/Floor Coverings Res/Textile/S9	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0057 - Movement (48.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0034/Floor Coverings Res/Textile/S9	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00A - R0058 - Movement (12.66 m2)						
No Asbestos						
B00A - R0059 - Clinic - Girls (10.32 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0034/Floor Coverings Res/Textile/S9	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R0032/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00A - R0060 - Toilets-Girls (2.96 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R0060/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0061 - Interview/Office - Type 1 (7.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0062 - Deputy Principal Office (11.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0063 - Administration - Clerical (47.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0064 - Administration - Executive (8.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0065 - Resources Store (5.81 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0066 - Student Waiting (8.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00A - R0067 - Student Waiting (9.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0034/Floor Coverings Res/Textile/S9	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0068 - Movement (181.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0068/Floor Coverings Res/Textile/S26					No Asbestos Detected
Adhesive to beige VFT	Adhesive 8159/B00A/R0068/Adhesive to beige VFT/S27					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0069 - Commonroom (34.32 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00A/R0034/Floor Coverings Res/Textile/S9	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0070 - Staff Kitchen (13.13 m2)						
No Asbestos						
B00A - R0071 - Darkroom Space (2.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8159/B00A/R0034/Floor Coverings Res/Textile/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0072 - Dark Room (11.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8159/B00A/R0034/Floor Coverings Res/Textile/S9	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0073 - Staff - Toilet (2.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8159/B00A/R0034/Floor Coverings Res/Textile/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1001 - Music Learning Space (77.04 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1002 - Design L.S. (68.9 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
floor underlay	Millboard 8159/B00A/R1003/Floor underlay/S21					No Asbestos Detected
B00A - R1003 - Resources Store (9.23 m2)						
Floor underlay	Millboard 8159/B00A/R1003/Floor underlay/S21					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1004 - Design/Technology L.S. (70.15 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1005 - Staff Study (17.99 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1006 - General Learning Space (54.26 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1007 - Resources Store (8.43 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1007/Floor Coverings Res/Textile/S24					No Asbestos Detected
Floor underlay	Millboard 8159/B00A/R1007/Floor underlay/S25					No Asbestos Detected
B00A - R1008 - Study Space (11.77 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1007/Floor Coverings Res/Textile/S24					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Floor underlay	Millboard 8159/B00A/R1007/Floor underlay/S25					No Asbestos Detected
B00A - R1009 - General Learning Space (48.57 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1010 - General Learning Space (48.57 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1011 - General Learning Space (48.5 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1012 - Staff Study (53.24 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1013 - Tea Room (5.29 m2)						
No Asbestos						
B00A - R1014 - Staff - Toilet (7.51 m2)						
Incinerator	Millboard	1m2	South facing, West facing, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R1015 - Computer Learning Space (48.57 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1016 - General Learning Space (48.64 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1017 - Staff Study (21.37 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1018 - General Learning Space (48.72 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1019 - General Learning Space (48.71 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1020 - General Learning Space (48.64 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00A - R1021 - Design/Technology L.S. (74.47 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R0032/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00A - R1022 - Staff Study (30.23 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1023 - Staff - Toilet (8.2 m2)						
No Asbestos						
B00A - R1024 - Resources Store (9.32 m2)						
No Asbestos						
B00A - R1026 - Resources Store (5.22 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected	
B00A - R1027 - Stairs (13.21 m2)						
No Asbestos						
B00A - R1028 - Handwashing Facilities (0.8 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00A/R1002/Floor Coverings Res/Textile/S23					No Asbestos Detected	
B00A - R1029 - Stairs (13.81 m2)						
No Asbestos						
B00A - R1030 - Stairs (14.67 m2)						
No Asbestos						
B00A - R1031 - Student Drinking Facilities (0.95 m2)						
No Asbestos						
B00A - R1032 - Student Drinking Facilities (0.58 m2)						
No Asbestos						
B00A - R1033 - Student Drinking Facilities (0.96 m2)						
No Asbestos						
B00A - R1034 - Movement (223.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	223m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R9001 - Kiln Space (10.5 m2)						
No Asbestos						
B00A - R9002 - Art Learning Space (68.71 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	67m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)	
B00A - R9003 - Resources Store (21.26 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B00A - R9004 - Resources Store (22.98 m2)						
No Asbestos						
B00A - R9005 - Multi Media Workshop (47.83 m2)						
No Asbestos						
B00A - R9006 - Movement (7.28 m2)						
No Asbestos						
B00A - R9007 - Staff Study (19.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R9008 - Staff - Toilet (6.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R9009 - Art Learning Space (47.5 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00A - R9010 - Art Learning Space (50.9 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00A - R9011 - Project Store - Type 1 (17.53 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00A - R9014 - Movement (15.67 m2)

No Asbestos

B00A - R9015 - Cleaning Store - Distributed (7.83 m2)

No Asbestos

B00A - R9016 - External Movement (9.75 m2)

No Asbestos

B00A - R9017 - External Movement (2.76 m2)

No Asbestos

B00A - R9018 - Movement (9.46 m2)

No Asbestos

B00A - R9019 - Workshop (38.86 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00A - R9020 - Stairs (3.63 m2)

No Asbestos

B00A - R9021 - Stairs (2.83 m2)

No Asbestos

B00A - R9022 - External Movement (22.14 m2)

No Asbestos

B00A - R9023 - Toilets-Girls (85.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00A - R9024 - Resources Store (2.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00A/R9011/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Multi Purpose Facilities - 1934 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	200m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior**B00B - R0001 - Movement (24.14 m2)**

No Asbestos

B00B - R0002 - Staff Kitchen (15.86 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00B/R0008/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00B - R0003 - Multi-Purpose Space (404.77 m2)

No Asbestos

B00B - R0005 - Toilets-Boys (16.38 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00B/R1001/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	

B00B - R0009 - Cleaning Store - Distributed (4.21 m2)

No Asbestos

B00B - R0010 - Distribution Board Cupboard (1.07 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0011 - Sport Equipment Store (18.93 m2)

No Asbestos

B00B - R0013 - General Assistants (11.66 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00B/R0008/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00B - R0014 - General Storeroom (5.6 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00B/R0008/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00B - R0015 - Garden Store Room (13.93 m2)

Wall Linings Internal	Flat AC Sheeting	85m2	South-west	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00B/R1001/Wall Linings Internal/S5				Chrysotile (white asbestos)	

B00B - R0016 - External Movement (9.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00B - R0021 - General Storeroom (1.94 m2)

No Asbestos

B00B - R0022 - External Movement (49.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00B - R0023 - Stage (67.47 m2)

No Asbestos

B00B - R0024 - Movement (52.35 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0025 - Stairs (0.24 m2)						
No Asbestos						
B00B - R0026 - Chair Store (48.77 m2)						
No Asbestos						
B00B - R0027 - Plant (3.36 m2)						
No Asbestos						
B00B - R0028 - Uniform Shop (26 m2)						
No Asbestos						
B00B - R0029 - External Movement (18.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8159/B00E/R0011/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00B - R0030 - External Movement (9.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8159/B00E/R0011/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00B - R1002 - Toilets-Girls (20.65 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Wall Linings Internal/S5					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00B - R1003 - Staff Shower (8.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Wall Linings Internal/S5					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00B - R1005 - Stairs (3.22 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00B/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected	
B00B - R1007 - Toilets-Girls (12.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Wall Linings Internal/S5					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
B00B - R1008 - Toilet - Lobby (4.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00B/R1001/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00B - R1009 - Movement (51.4 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1934 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00C - R0001 - Study Space (12.4 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00C/R0004/Floor Coverings Res/Textile/S28	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Adhesive to green VFT	Bituminous material 8159/B00C/R0004/Adhesive to green VFT/S35					No Asbestos Detected

Chrysotile (white asbestos)

B00C - R0002 - Staff Study (52.61 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00C/R0004/Floor Coverings Res/Textile/S28	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Adhesive to green VFT	Bituminous material 8159/B00C/R0004/Adhesive to green VFT/S35					No Asbestos Detected

Chrysotile (white asbestos)

B00C - R0003 - General Learning Space (47.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00C/R0004/Floor Coverings Res/Textile/S28	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Adhesive to green VFT	Bituminous material 8159/B00C/R0004/Adhesive to green VFT/S35					No Asbestos Detected

Chrysotile (white asbestos)

B00C - R0004 - General Learning Space (47.77 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00C/R0004/Floor Coverings Res/Textile/S28	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Adhesive to green VFT	Bituminous material 8159/B00C/R0004/Adhesive to green VFT/S35					No Asbestos Detected

Chrysotile (white asbestos)

B00C - R0005 - General Learning Space (45.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00C/R0004/Floor Coverings Res/Textile/S28	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Adhesive to green VFT	Bituminous material 8159/B00C/R0004/Adhesive to green VFT/S35					No Asbestos Detected

Chrysotile (white asbestos)

B00C - R0006 - Office/Store (9.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8159/B00C/R0004/Floor Coverings Res/Textile/S28	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Adhesive to green VFT	Bituminous material 8159/B00C/R0004/Adhesive to green VFT/S35					No Asbestos Detected

Chrysotile (white asbestos)

B00C - R0007 - Movement (54.19 m2)

Floor Coverings Res/Textile	Vinyl Sheet 8159/B00C/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00C - R0008 - External Movement (1.57 m2)

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Science Learning - 1981 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	250m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Awnings	Flat AC Sheeting	250m2	South-eastern side adjoining to South-west of Block E	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
New Exterior						
Infill panels below windows	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00D/Infill panels below windows/S32				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Laboratory L.S. (101.41 m2)**

Fume Cupboard	Flat AC Sheeting	1Unit	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8159/B00D/R0004/Fume Cupboard/S11				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R0004/Ceiling Structures/Linings/S13				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Fume cupboard flue	Fibre Cement Pipe	3m	West	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction Area inaccessible					
Heat-proof Mat	Flat AC Sheeting					
	8159/B00D/R1001/Heat-proof Mat/S30				No Asbestos Detected	

B00D - R0002 - Apparatus Store (14.53 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R0004/Ceiling Structures/Linings/S13				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0003 - Preparation - Science (24.2 m2)

Fume Cupboard	Flat AC Sheeting	2Unit	North facing, East facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8159/B00D/R0004/Fume Cupboard/S11				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R0004/Ceiling Structures/Linings/S13				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Fume cupboard flue	Fibre Cement Pipe	6m	West	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible Height Restriction					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Heat-proof Mat	Flat AC Sheeting 8159/B00D/R1001/Heat-proof Mat/S30					No Asbestos Detected
B00D - R0004 - Laboratory L.S. (52.36 m2)						
Fume Cupboard	Flat AC Sheeting 8159/B00D/R0004/Fume Cupboard/S11	1Unit	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8159/B00D/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Fume cupboard flue	Fibre Cement Pipe 8159/B00D/R0004/Fume cupboard flue/S36	3m	East	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3) Test Result to be recorded
Heat-proof Mat	Flat AC Sheeting 8159/B00D/R1001/Heat-proof Mat/S30					No Asbestos Detected
B00D - R0005 - Chemical Store (25.71 m2)						
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8159/B00D/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0006 - Preparation - Science (25.56 m2)						
Fume Cupboard	Flat AC Sheeting 8159/B00D/R0004/Fume Cupboard/S11	2Unit	North-east & west facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8159/B00D/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Fume cupboard flue	Fibre Cement Pipe 8159/B00D/R0004/Fume cupboard flue/S36	6m	east & west	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction Area inaccessible
Heat-proof Mat	Flat AC Sheeting 8159/B00D/R1001/Heat-proof Mat/S30					No Asbestos Detected
B00D - R0007 - Laboratory L.S. (101.19 m2)						
Fume Cupboard	Flat AC Sheeting 8159/B00D/R0004/Fume Cupboard/S11	1Unit	North facing, East facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8159/B00D/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Fume cupboard flue	Fibre Cement Pipe 8159/B00D/R0004/Fume cupboard flue/S36	3m	East	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) Assumed Asbestos - Area inaccessible Height Restriction
Heat-proof Mat	Flat AC Sheeting 8159/B00D/R1001/Heat-proof Mat/S30					No Asbestos Detected
B00D - R0008 - Staff - Toilet (4.18 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0009 - Cleaning Store - Distributed (5.27 m2)						
No Asbestos						
B00D - R0010 - Resources Store (8.98 m2)						
Floor Coverings Res/Textile	Vinyl Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00A/R0034/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00D - R0011 - Distribution Board Cupboard (0.41 m2)						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
					Assumed Asbestos - Electrical Hazard	
Electrical Mounting Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
8159/B00D/R0011/Electrical Mounting Board/S31					Chrysotile (white asbestos)	
B00D - R0012 - Movement (47.52 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
8159/B00D/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0013 - External Movement (16.58 m2)						
No Asbestos						
B00D - R0014 - Stairs (5.25 m2)						
No Asbestos						
B00D - R0015 - Stairs (5.17 m2)						
No Asbestos						
B00D - R0016 - External Movement Walkway						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8159/B00E/R0011/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Gable ends - packer	Flat AC Sheeting	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8159/B00D/R0016/Gable ends - packer/S33					Chrysotile (white asbestos)	
B00D - R1001 - Laboratory L.S. (84.31 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Heat-proof Mat	Flat AC Sheeting					
8159/B00D/R1001/Heat-proof Mat/S30					No Asbestos Detected	
B00D - R1002 - Apparatus Store (16.63 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Heat-proof Mat	Flat AC Sheeting					
8159/B00D/R1001/Heat-proof Mat/S30					No Asbestos Detected	
B00D - R1003 - Resources Store (8.53 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1004 - Resources Store (7.11 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1005 - General Learning Space (52.29 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1006 - Resources Store (5.2 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1007 - Resources Store (5.95 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1008 - Staff Study (25.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1009 - Resources Store (6.19 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1010 - Staff Study (28.13 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8159/B00D/R1007/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1011 - Laboratory L.S. (98.28 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00D/R0004/Floor Coverings Res/Textile/S12					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8159/B00D/R1007/Ceiling Structures/Linings/S29			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Heat-proof Mat	Flat AC Sheeting		8159/B00D/R1001/Heat-proof Mat/S30			No Asbestos Detected
B00D - R1012 - Movement (49.06 m2)						
Floor Coverings Res/Textile	Vinyl Sheet		8159/B00D/R0004/Floor Coverings Res/Textile/S12			No Asbestos Detected
Ceiling Structures/Linings	Vermiculite		8159/B00D/R1007/Ceiling Structures/Linings/S29			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1013 - Stairs (13.55 m2)						
No Asbestos						
B00D - R1014 - Stairs (13.33 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Restricted Access - Raked Ceilings					
Eaves Linings	Flat AC Sheeting	200m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Awnings	Flat AC Sheeting	35m2	East side of Block E adjoining North-west of Block A	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction - Restricted Access - Raked Ceilings					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Senior Study (10.72 m2)

No Asbestos

B00E - R0002 - Senior Study (21.86 m2)

No Asbestos

B00E - R0004 - Computer Store (18.97 m2)

No Asbestos

B00E - R0005 - Librarian (9.42 m2)

No Asbestos

B00E - R0006 - Library Administration (19.66 m2)

No Asbestos

B00E - R0007 - Distribution Board Cupboard (0.48 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0008 - Staff - Toilet (1.92 m2)

No Asbestos

B00E - R0009 - Staff - Toilet (2.08 m2)

No Asbestos

B00E - R0011 - External Movement (74.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00E - R0012 - Main Area (80.11 m2)

No Asbestos

B00E - R0013 - Main Entry (18.79 m2)

No Asbestos

B00E - R0014 - Main Area (219.07 m2)

No Asbestos

B00E - R0015 - Covered Area (15.39 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Performance Learning - 1934 - Brick/Block (Brick/Block)

Exterior

Awnings	Flat AC Sheeting	125m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00F - R0001 - Staff Study (26.04 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8159/B00A/R1007/Floor Coverings Res/Textile/S24				No Asbestos Detected	

B00F - R0002 - Staff - Toilet (4.03 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0003 - Staff Study (7.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00F/R0003/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8159/B00F/R0003/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B00F - R0004 - Stage (17.42 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0006 - Music Store (10.19 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0007 - Performance Store (18.12 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0008 - Performance Store (5.15 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0009 - Multi-Purpose Space (112.52 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0011 - External Movement (2.07 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00F - R0012 - External Movement (2.13 m2)

No Asbestos						
-------------	--	--	--	--	--	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Physical Education - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00G - R0001 - Sport Equipment Store (5.78 m2)

No Asbestos

B00G - R0002 - Sport Equipment Store (5.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-After School Care - 1926 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area 8159/B00E/R0011/Ceiling Structures/Linings/S1 - Area inaccessible					Chrysotile (white asbestos)
Eaves Linings	Compressed AC Sheet	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B00E/R0011/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area 8159/B00E/R0011/Ceiling Structures/Linings/S1 - Height Restriction					Chrysotile (white asbestos)

Interior

B00H - R0001 - Out Of School Hours Care Centre (9.4 m2)

Wall Linings Internal	Flat AC Sheeting	2m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	----	------	--------------------	---------	--------------------

Assumed Asbestos - Area inaccessible

B00H - R0002 - Out Of School Hours Care Centre (15.44 m2)

No Asbestos

B00H - R0003 - Out Of School Hours Care Centre (11.36 m2)

No Asbestos

B00H - R0004 - Out Of School Hours Care Centre (4.19 m2)

No Asbestos

B00H - R0005 - Out Of School Hours Care Centre (10.12 m2)

No Asbestos

B00H - R0006 - Out Of School Hours Care Centre (15.23 m2)

No Asbestos

B00H - R0007 - Out Of School Hours Care Centre (11.62 m2)

No Asbestos

B00H - R0008 - Out Of School Hours Care Centre (3.93 m2)

No Asbestos

B00H - R0009 - Out Of School Hours Care Centre (3.3 m2)

No Asbestos

B00H - R0010 - Out Of School Hours Care Centre (1.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8159/B00E/R0011/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Other - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area 8159/B001/R0010/Ceiling Structures/Linings/S19 - Area inaccessible - crawl space					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B001/R0010/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area 8159/B001/R0010/Ceiling Structures/Linings/S19 - Height Restriction					Chrysotile (white asbestos)

Interior

B001 - R0001 - External Movement (6.19 m2)

No Asbestos

B001 - R0002 - Student Change - Type 2 (13.82 m2)

No Asbestos

B001 - R0003 - Movement (9.45 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8159/B001/R0003/Floor Coverings Res/Textile/S15					No Asbestos Detected
Adhesive to grey VFT	Adhesive					
	8159/B001/R0003/Adhesive to grey VFT/S16					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles					
	8159/B001/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
Adhesive to blue VFT	Adhesive					
	8159/B001/R0003/Adhesive to blue VFT/S18					No Asbestos Detected

B001 - R0004 - Student Change - Type 2 (13.67 m2)

No Asbestos

B001 - R0005 - Staff Study (17.66 m2)

No Asbestos

B001 - R0006 - Change (12.77 m2)

No Asbestos

B001 - R0007 - Staff Kitchen (25.47 m2)

No Asbestos

B001 - R0008 - General Storeroom (8.79 m2)

No Asbestos

B001 - R0009 - Toilets-Girls (3.45 m2)

No Asbestos

B001 - R0010 - External Movement (20.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8159/B001/R0010/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)

B001 - R0011 - Toilets-Girls (7.63 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Other - 1950 - Brick Shed (Brick Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00J - R0001 - General Storeroom (18.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 600 - D11538 - Learning Unit - Small : Placement Date - 20/01/2003

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

Interior

R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

OS 600 - D11552 - Learning Unit - Small : Placement Date - 8/02/2005

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

OS 600 - D12309 - Learning Unit - Small : Placement Date - 12/02/2008

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

OS 601 - D13796 - Learning Unit - Standard/Withdrawal : Placement Date - 3/02/1999

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 600 - D13941 - Learning Unit - Small : Placement Date - 19/02/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
OS 601 - D13970 - Learning Unit - Standard/Withdrawal : Placement Date - 13/02/2003						
Exterior						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 600 - D14246 - Learning Unit - Small : Placement Date - 7/02/2008						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
OS 600 - D15115 - Learning Unit - Small : Placement Date - 27/12/2008						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D15893 - Learning Unit - Small : Placement Date - 20/01/2003						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
OS 600 - D17837 - Learning Unit - Small : Placement Date - 21/12/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D17838 - Learning Unit - Small : Placement Date - 21/12/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D17839 - Learning Unit - Small : Placement Date - 21/12/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D18032 - Learning Unit - Small : Placement Date - 21/12/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
OS 600 - D18192 - Learning Unit - Small : Placement Date - 2/04/2008						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8159_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017