


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wee Waa High School (8270)  
**Region :** New England  
**State Electorate :** Barwon  
**Local Government Area :** Narrabri

**Initial Survey :** Noel Arnold & Associates : 15 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - May - 2015

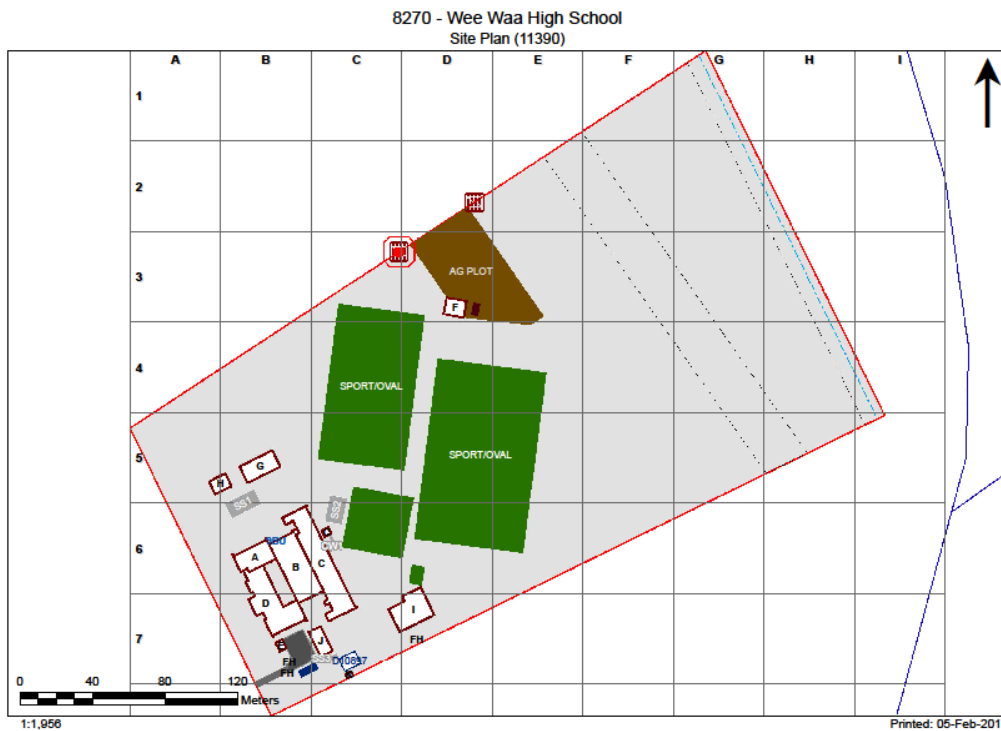

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00A - R0001 - Clinic - Girls (12.24 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								
Floor Coverings Res/Textile	Vinyl Tiles	12.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)			
	8270/B00A/R0001/Floor Coverings Res/Textile/S11								Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	12.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)			
	8270/B00A/R0001/Floor Coverings Res/Textile/S12								Chrysotile (white asbestos)

**B00A - R0002 - Clinic-Toilets (2.97 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0003 - Staff - Toilet (3.54 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0004 - Staff Study (11.1 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0005 - Movement (29.78 m2)**

Ceiling Structures/Linings	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)			
	8270/B00A/R0001/Floor Coverings Res/Textile/S11								Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	29.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)			
	8270/B00A/R0001/Floor Coverings Res/Textile/S12								Chrysotile (white asbestos)

**B00A - R0006 - Administration - Clerical (31.39 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0007 - Duplicating Workroom (28.62 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0008 - Principal Office (22.77 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0009 - Interview/Office - Type 1 (11.66 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

**B00A - R0010 - Deputy Principal Office (18.15 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00A/R0001/Ceiling Structures/Linings/S10								Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>								

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0011 - Movement (32.77 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					No Asbestos Detected
<b>B00A - R1001 - Seminar (15.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1002 - Commonroom (66.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1003 - Staff - Toilet (2.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1004 - Staff - Toilet (2.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1005 - Movement (15.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	15.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Manhole	Flat AC Sheeting					
	8270/B00A/R1005/Manhole/S14					No Asbestos Detected
<b>B00A - R1006 - General Storeroom (13.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	13.98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1007 - Staff Study (30.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
<b>B00A - R1008 - General Storeroom (20.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00A/R0001/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive	20.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8270/B00A/R0001/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1009 - General Storeroom (5.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8270/B00A/R0001/Ceiling Structures/Linings/S10					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8270/B00A/R0001/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1010 - Movement (30.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
8270/B00A/R1010/Ceiling Structures/Linings/S13						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Multi Purpose Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00B - R0001 - Movement (4.21 m2)**

No Asbestos

**B00B - R0002 - Chair Store (7.69 m2)**

No Asbestos

**B00B - R0003 - Multi-Purpose Space (322.71 m2)**

No Asbestos

**B00B - R0004 - General Storeroom (8.06 m2)**

No Asbestos

**B00B - R0005 - Movement (4.21 m2)**

No Asbestos

**B00B - R0006 - Stage (49.09 m2)**

No Asbestos

**B00B - R0007 - Movement (45.25 m2)**

No Asbestos

**B00B - R0008 - Distribution Board Cupboard (1.1 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0009 - Movement (82.41 m2)**

No Asbestos

**B00B - R1001 - Distribution Board Cupboard (1.07 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8270/B00B/R1004/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00B - R1002 - Toilets-Boys (11.4 m2)**

Ceiling Structures/Linings	Vermiculite	8270/B00B/R1002/Ceiling Structures/Linings/S16			
----------------------------	-------------	--	--	--	--

**Limited Samples Taken****Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works****B00B - R1003 - Toilets-Girls (10.89 m2)**

Ceiling Structures/Linings	Vermiculite	8270/B00B/R1002/Ceiling Structures/Linings/S16			
----------------------------	-------------	--	--	--	--

**Limited Samples Taken****Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works****B00B - R1004 - Distribution Board Cupboard (1.08 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8270/B00B/R1004/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00B - R1005 - Movement (46.16 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Various - 1976 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00C - R0001 - Materials Store (17.56 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0002 - Welding Area (4.51 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0003 - Metal Technology L.S. (112.51 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0004 - Cleaning Store - Distributed (4.39 m2)**

No Asbestos

**B00C - R0005 - Distribution Board Cupboard (0.87 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0006 - Staff Shower (7.38 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00C/R1006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

**B00C - R0007 - Movement (7.07 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0008 - Shower/Change (23.35 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0009 - Toilets-Boys (28.35 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0010 - Sport Equipment Store (25.34 m2)**

No Asbestos

**B00C - R0013 - General Storeroom (4.79 m2)**

No Asbestos

**B00C - R0014 - Darkroom Space (6.02 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

**B00C - R0015 - Movement (6.58 m2)**

Ceiling Structures/Linings	Vermiculite								
	8270/B00C/R1008/Ceiling Structures/Linings/S17								Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>									

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0016 - Shower/Change (19.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00C/R0016/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)
<b>B00C - R0017 - Toilets-Girls (21.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00C - R0018 - Art Learning Space (80.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00C - R0019 - Kiln Space (6.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00C - R0020 - Bulk Store (14.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00C - R0021 - Cleaning Store - Distributed (4.39 m2)</b>						
No Asbestos						
<b>B00C - R0022 - Movement (228.48 m2)</b>						
No Asbestos						
<b>B00C - R0024 - Student Canteen (30.73 m2)</b>						
No Asbestos						
<b>B00C - R0025 - Stairs (12.03 m2)</b>						
No Asbestos						
<b>B00C - R0026 - Stairs (11.42 m2)</b>						
No Asbestos						
<b>B00C - R0027 - Toilets-Disabled (11.38 m2)</b>						
No Asbestos						
<b>B00C - R0028 - Lift (3.91 m2)</b>						
Non Accessible						
<b>B00C - R1001 - Design L.S. (86.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	16m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00C/R1006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00C - R1002 - Resource/Project Store (5.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00C/R1006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00C - R1003 - General Storeroom (14.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8270/B00C/R1008/Ceiling Structures/Linings/S17					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00C - R1004 - Staff Study (26.55 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8270/B00C/R1006/Floor Coverings Res/Textile/S2	26.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1005 - Distribution Board Cupboard (0.86 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting 8270/B00C/R1005/Ceiling Structures/Linings/S19	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1006 - Staff Study (24.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8270/B00C/R1006/Floor Coverings Res/Textile/S2	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1007 - Computer Learning Space (51.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1006/Floor Coverings Res/Textile/S2	52m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1008 - General Learning Space (50.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8270/B00C/R1006/Floor Coverings Res/Textile/S2	50.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1009 - General Learning Space (50.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8270/B00C/R1006/Floor Coverings Res/Textile/S2	50.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1010 - General Learning Space (50.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8270/B00C/R1006/Floor Coverings Res/Textile/S2	50.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1011 - General Learning Space (50.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8270/B00C/R1006/Floor Coverings Res/Textile/S2	50.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1012 - General Learning Space (50.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8270/B00C/R1008/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00C - R1013 - Movement (183.92 m2)</b>					No Asbestos	
<b>B00C - R1014 - Stairs (5.75 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00C - R1015 - Stairs (6.05 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Various - 1976 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00D - R0001 - General Learning Space (88.66 m2)**

Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

**B00D - R0002 - Laboratory L.S. (104.53 m2)**

Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

**B00D - R0006 - Cleaning Store - Distributed (3.98 m2)**

No Asbestos

**B00D - R0007 - Main Switchroom (14.03 m2)**

No Asbestos

**B00D - R0008 - Movement (15.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	8270/B00D/R0008/Ceiling Structures/Linings/S21					No Asbestos Detected

**B00D - R0009 - Movement (77.85 m2)**

No Asbestos

**B00D - R0010 - Stairs (10.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	8270/B00D/R0008/Ceiling Structures/Linings/S21					No Asbestos Detected

**B00D - R0011 - Food Technology L.S. (115.5 m2)**

No Asbestos

**B00D - R0012 - Hospitality Space (38.79 m2)**

No Asbestos

**B00D - R0013 - Student Change - Type 2 (7.23 m2)**

No Asbestos

**B00D - R0014 - Student Change - Type 2 (2.88 m2)**

No Asbestos

**B00D - R0015 - Food/Research Space (15.67 m2)**

No Asbestos

**B00D - R0016 - Pantry (8.82 m2)**

No Asbestos

**B00D - R0017 - Laundry (1.45 m2)**

No Asbestos

**B00D - R0018 - Store (7.34 m2)**

No Asbestos

**B00D - R0019 - Store (24.26 m2)**

No Asbestos

**B00D - R1001 - Staff Study (11.63 m2)**

Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R1002 - Main Area (246.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1003 - Librarian (10.82 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1004 - Audio Visual Workroom (17.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1005 - Workroom (25.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1006 - Staff - Toilet (3.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1007 - Staff - Toilet (3.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1008 - Seminar (23.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1009 - Plant (23.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1010 - General Storeroom (12.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
<b>B00D - R1011 - Distribution Board Cupboard (1.04 m2)</b>						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting					
	8270/B00D/R0008/Ceiling Structures/Linings/S21					No Asbestos Detected
<b>B00D - R1012 - Movement (2.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8270/B00A/R0001/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
<b>B00D - R1013 - Cleaning Store - Distributed (2.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8270/B00D/R0001/Ceiling Structures/Linings/S20					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8270/B00A/R0001/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1014 - Movement (8.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8270/B00D/R0008/Ceiling Structures/Linings/S21					<b>No Asbestos Detected</b>	
<b>B00D - R1015 - Movement (77.67 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8270/B00D/R0008/Ceiling Structures/Linings/S21					<b>No Asbestos Detected</b>	
<b>B00D - R1016 - Stairs (13.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8270/B00D/R0001/Ceiling Structures/Linings/S20					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00E - Building Services - 1976 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids                      No Asbestos Found

Underfloor Voids - Slab  
on Ground

**Interior**

**B00E - R0001 - Garden Store Room (15.85 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Agricultural Science - 1976 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground

**Interior**

**B00F - R0001 - Class Tools Storage (8.7 m2)**

No Asbestos

**B00F - R0002 - Movement (8.23 m2)**

No Asbestos

**B00F - R0003 - General Storeroom (9.66 m2)**

No Asbestos

**B00F - R0004 - Machine Storage (28.56 m2)**

No Asbestos

**B00F - R0005 - Machine Storage (36.29 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Multi Purpose Facilities - 2004 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Gymnasium (195.9 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 2004 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00H - R0001 - General Learning Space (44.99 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00H - R0002 - General Storeroom (28.04 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00I - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00I - R0001 - General Learning Space (59.78 m2)**

No Asbestos

**B00I - R0002 - Science Laboratory (59.85 m2)**

No Asbestos

**B00I - R0003 - Preparation (30.95 m2)**

No Asbestos

**B00I - R0004 - Apparatus Store (13.72 m2)**

No Asbestos

**B00I - R0005 - Chemical Store (12.4 m2)**

No Asbestos

**B00I - R0006 - Staff Study (21.04 m2)**

No Asbestos

**B00I - R0007 - Seminar - Type 2 (21.1 m2)**

No Asbestos

**B00I - R0008 - Movement (6.37 m2)**

No Asbestos

**B00I - R0009 - Distribution Board Cupboard (0.64 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00I - R0010 - External Movement (46.32 m2)**

No Asbestos

**B00I - R0011 - Covered Outdoor Space (41.95 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Support Unit (Is) - 2010 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00J - R0001 - General Learning Space (34.28 m2)**

No Asbestos

**B00J - R0002 - Staff Study (33.18 m2)**

No Asbestos

**B00J - R0003 - Store (0.89 m2)**

No Asbestos

**B00J - R0004 - General Learning Space (34.28 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Mechanical Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00K - R0001 - No Access (7.97 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 760 - D10897 - Woodwork/Store : Placement Date - 30/06/1995

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

#### Interior

##### R1 - Woodwork

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

##### R2 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017