


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Whitebridge High School (8390)  
**Region :** Hunter/Central Coast  
**State Electorate :** Charlestown  
**Local Government Area :** Lake Macquarie

**Initial Survey :** Noel Arnold & Associates : 26 - Mar - 2015  
**Reviewed By :** Grencap-NAA : 26 - Mar - 2015

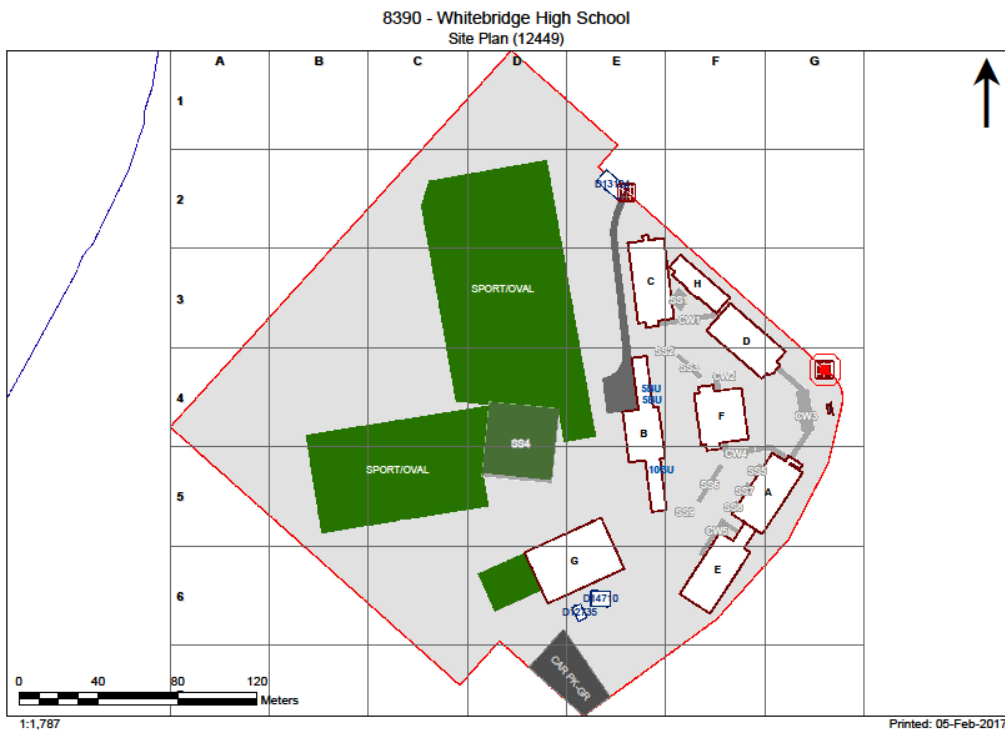

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Technological & Applied Studies - 1963 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 8390/B00D/In-fill-panel/S1	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 8390/B00F/Eaves Linings/S32					<b>No Asbestos Detected</b>
Underfloor Voids	Stored vinyl floor tiles 8390/B00A/R0014/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**Interior****B00A - R0001 - Pantry (6.21 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00A - R0002 - Cleaning Store - Distributed (4.58 m2)**

No Asbestos

**B00A - R0003 - Food Technology L.S. (67.99 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00A - R0004 - Pantry (9.1 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 8390/B00A/R0014/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0005 - General Storeroom (3.11 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 8390/B00A/R0014/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0007 - Food Technology L.S. (66.52 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00A/R0014/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0008 - Seminar/Technology Space (12.61 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00A - R0009 - Laundry (26.3 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00A - R0010 - General Storeroom (26.19 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	8390/B00A/R0014/Floor Coverings Res/Textile/S9				No Asbestos Detected
<b>B00A - R0011 - General Storeroom (6.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0012 - External Movement (3.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0014 - Staff Study (24.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00A/R0014/Floor Coverings Res/Textile/S9				No Asbestos Detected
<b>B00A - R0015 - Laboratory L.S. (93.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0016 - Distribution Board Cupboard (1.07 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R0017 - Darkroom Space (2.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0018 - Preparation (34.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0019 - Laboratory L.S. (88.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0020 - Movement (106.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0021 - Movement (4.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0022 - External Movement (10.34 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Lift (2.09 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Plant (4.34 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Staff - Toilet (1.33 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Toilet - Lobby (3.04 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0027 - Stairs (10.24 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Staff Kitchen (5.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0029 - Pantry (3.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0030 - Staff Study (9.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Hot water service flue pipe	Fibre Cement Pipe	6m	South east corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R0030/Hot water service flue pipe/S10					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00A/R0014/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R0031 - Stairs (9.73 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Store (10.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00A/R0014/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R1003 - General Storeroom (14.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00A/R0014/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R1004 - Control Room (6.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00A/R1009/Floor Coverings Res/Textile/S4					No Asbestos Detected
<b>B00A - R1005 - Stage (25.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1006 - General Learning Space (52.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00A/R0010/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R1006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8390/B00A/R1006/Floor Coverings Res/Textile/S30					No Asbestos Detected
<b>B00A - R1007 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R1006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B00A - R1008 - General Learning Space (67.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R1006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B00A - R1009 - General Storeroom (5.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R1006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B00A - R1010 - General Storeroom (2.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00A - R1011 - General Learning Space (53.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R1006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B00A - R1012 - Staff Study (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00A/R1006/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
<b>B00A - R1013 - Apparatus Store (14.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00A - R1014 - General Storeroom (10.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00A/R0010/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00A/R0014/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00A - R1015 - Distribution Board Cupboard (0.4 m2)</b>					Note: No inspection of live electrical installation.	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>Assumed Asbestos - Electrical Hazard</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8390/B00E/R1002/Ceiling Structures/Linings/S34					<b>Chrysotile (white asbestos)</b>		
<b>B00A - R1016 - General Learning Space (79.38 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
<b>B00A - R1017 - Careers Advisers Office (33.6 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8390/B00A/R0014/Floor Coverings Res/Textile/S9				<b>No Asbestos Detected</b>	
<b>B00A - R1018 - Cleaning Store - Distributed (2.66 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
<b>B00A - R1019 - Movement (110.82 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
<b>B00A - R1020 - Movement (11.65 m2)</b>							
Infill panels	Compressed AC Sheet	8390/B00A/R1020/Infill panels/S11				<b>No Asbestos Detected</b>	
<b>B00A - R1021 - Lift (2.09 m2)</b>							
No Asbestos							
<b>B00A - R1022 - Stairs (12.32 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
<b>B00A - R1023 - Toilet - Lobby (1.74 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
<b>B00A - R1024 - Staff - Toilet (1.67 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							
<b>B00A - R1025 - Stairs (12.38 m2)</b>							
Ceiling Structures/Linings	Vermiculite	8390/B00A/R0010/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00B/Eaves Linings/S26					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00B - R0001 - General Storeroom (9.97 m2)**

No Asbestos

**B00B - R0002 - General Storeroom (9.89 m2)**

No Asbestos

**B00B - R0005 - Movement (17.19 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0006 - Movement (326.38 m2)**

No Asbestos

**B00B - R0008 - General Storeroom (16.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0010 - General Storeroom (3.12 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0011 - Metal Technology Bay (62.8 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0016 - Sport Equipment Store (11.65 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0017 - General Storeroom (1.44 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0018 - Dark Room (12.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0019 - Dark Room (10.99 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0020 - Dark Room (26.66 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8390/B00B/R0011/Ceiling Structures/Linings/S27					

**B00B - R0021 - Student Canteen (51.15 m2)**

No Asbestos

**B00B - R0022 - Pantry (9.24 m2)**

No Asbestos

**B00B - R0023 - Toilet - Lobby (2.91 m2)**

No Asbestos

**B00B - R0024 - Staff - Toilet (1.69 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0025 - Plant (10.9 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8390/B00B/R0011/Ceiling Structures/Linings/S27					<b>No Asbestos Detected</b>
<b>B00B - R0026 - Toilets - Boys (95.11 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8390/B00B/R0011/Ceiling Structures/Linings/S27					<b>No Asbestos Detected</b>
<b>B00B - R0027 - Toilets - Girls (50.76 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8390/B00B/R0011/Ceiling Structures/Linings/S27					<b>No Asbestos Detected</b>
<b>B00B - R0028 - Plant (11.25 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8390/B00B/R0011/Ceiling Structures/Linings/S27					<b>No Asbestos Detected</b>
<b>B00B - R0029 - Toilets - Girls (43.42 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8390/B00B/R0011/Ceiling Structures/Linings/S27					<b>No Asbestos Detected</b>

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Art/Technological & Applied Studies - 1963 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 8390/B00D/In-fill-panel/S1	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 8390/B00F/Eaves Linings/S32					<b>No Asbestos Detected</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00C - R0001 - General Storeroom (7.57 m2)**

No Asbestos

**B00C - R0002 - External Movement (4.64 m2)**

No Asbestos

**B00C - R0003 - Movement (7.14 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0004 - Performing Arts Store (6.1 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0005 - Performance Workspace (54.39 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0006 - Materials Technology L.S. (67.34 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0007 - Materials Store (6.32 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0008 - Materials Store (4.07 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0009 - Materials Store (2.63 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0010 - Materials Technology L.S. (66.44 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0011 - Resources Store (6.31 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00C/R1030/Ceiling Structures/Linings/S24					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00C - R0012 - Resources Store (6.32 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0013 - Art Learning Space (54.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0014 - External Movement (4.76 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Movement (7.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0017 - Staff Study (33.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00C/R0017/Floor Coverings Res/Textile/S25			No Asbestos Detected	
<b>B00C - R0018 - Art Learning Space (67.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0019 - Bulk Store (13.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0020 - Resources Store (13.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0021 - Art Learning Space (66.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0022 - Resources Store (9.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0023 - Cleaning Store - Distributed (3.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0024 - Art Learning Space (67.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0025 - Movement (7.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0026 - Movement (23.2 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0027 - Movement (63.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0028 - Distribution Board Cupboard (0.51 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00C - R0029 - External Movement (6.5 m2)</b>						
No Asbestos						
<b>B00C - R0030 - External Movement (5.98 m2)</b>						
No Asbestos						
<b>B00C - R0031 - Movement (3.74 m2)</b>						
No Asbestos						
<b>B00C - R0032 - Lift (2.22 m2)</b>						
No Asbestos						
<b>B00C - R0033 - Stairs (8.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0034 - Stairs (7.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R0035 - Toilet - Lobby (5.13 m2)</b>						
No Asbestos						
<b>B00C - R0036 - Staff - Toilet (1.36 m2)</b>						
No Asbestos						
<b>B00C - R1002 - Staff Study (33.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1003 - Materials Store (32.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1004 - Wood Technology L.S. (80.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1005 - Materials Store (13.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1006 - Dust Extraction Space (5.94 m2)</b>						
No Asbestos						
<b>B00C - R1007 - Distribution Board Cupboard (0.37 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8390/B00C/R1007/Ceiling Structures/Linings/S23						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Electrical Hazard**

**B00C - R1008 - Materials Store (25.81 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1009 - Wood Technology L.S. (80.87 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1010 - Cleaning Store - Distributed (3.3 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1011 - Materials Store (6.55 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1012 - Design L.S. (54.02 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1013 - Seminar/Technology Space (26.12 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1014 - Design L.S. (53.64 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1015 - Materials Store (12.95 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1016 - Materials Store (19.98 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1017 - Metal Technology L.S. (73.62 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8390/B00C/R1030/Ceiling Structures/Linings/S24					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R1019 - Movement (120.17 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00C - R1020 - Movement (6.55 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00C - R1021 - Movement (5.98 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00C - R1022 - Movement (3.74 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00C - R1024 - Stairs (10.56 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1025 - Stairs (11.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1026 - Welding/Hot Metals Area (3.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1027 - Welding/Hot Metals Area (5 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1028 - Staff - Toilet (1.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1029 - Toilet - Lobby (2.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00C - R1030 - Metal Technology Bay (17.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00C/R1030/Ceiling Structures/Linings/S24			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Computer Learning/General Learning - 1963 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 8390/B00D/In-fill-panel/S1	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 8390/B00F/Eaves Linings/S32					<b>No Asbestos Detected</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00D - R0002 - Deputy Principal Office (15.88 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00D/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>

**B00D - R0003 - Interview/Office - Type 1 (12.15 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00D/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>

**B00D - R0004 - Leading Teacher (11.93 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00D/R0002/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>

**B00D - R0005 - Toilets-Disabled (4.9 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00D - R0006 - Movement (7.51 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00D - R0007 - Clinic - Boys (11.56 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00D - R0008 - Clinic-Waiting (8.16 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00D - R0009 - Leading Teacher (19.24 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0010 - Duplicating Workroom (26.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0011 - Distribution Board Cupboard (0.53 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00D - R0012 - General Storeroom (5.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0013 - Staff - Toilet (3.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0014 - Cleaning Store - Distributed (2.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0015 - Principal Office (19.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0016 - Administration - Clerical (40.25 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Carpet underlay	Fibrous Membrane	8390/B00D/R0017/Carpet underlay/S20				No Asbestos Detected
<b>B00D - R0017 - Movement (78.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Carpet underlay	Fibrous Membrane	8390/B00D/R0017/Carpet underlay/S20				No Asbestos Detected
<b>B00D - R0018 - Pupil Entry (12.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Carpet underlay	Fibrous Membrane	8390/B00D/R0017/Carpet underlay/S20				No Asbestos Detected
<b>B00D - R0019 - Computer Learning Space (53.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0020 - Computer Learning Space (54.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0021 - Computer Resource (5.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0022 - Store (12.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0023 - Computer Learning Space (66.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0024 - Computer Resource (33.82 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0025 - Security Store (18.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	8390/B00D/R0002/Floor Coverings Res/Textile/S21				No Asbestos Detected
<b>B00D - R0026 - Movement (58.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8390/B00D/R0001/Ceiling Structures/Linings/S2				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Carpet underlay	Fibrous Membrane	8390/B00D/R0017/Carpet underlay/S20				No Asbestos Detected
<b>B00D - R0027 - Movement (7.41 m2)</b>						
In-fill-panel	Flat AC Sheeting	10m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  8390/B00D/In-fill-panel/S1 <b>Chrysotile (white asbestos)</b>
<b>B00D - R0028 - Movement (13.2 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Flat AC Sheeting	12m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8390/B00D/In-fill-panel/S1					Chrysotile (white asbestos)	
<b>B00D - R0029 - Stairs (13.45 m2)</b>						
No Asbestos						
<b>B00D - R0030 - Stairs (0.79 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
8390/B00D/R0030/Wall Linings Internal/S19						
<b>B00D - R0031 - Staff - Toilet (1.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00D - R0032 - Toilet - Lobby (2.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00D - R0033 - Movement (2.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00D - R0034 - External Movement (17.38 m2)</b>						
No Asbestos						
<b>B00D - R1001 - General Learning Space (67.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
8390/B00D/R0002/Floor Coverings Res/Textile/S21						
<b>B00D - R1002 - General Storeroom (6.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
8390/B00D/R0002/Floor Coverings Res/Textile/S21						
<b>B00D - R1003 - General Storeroom (6.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
8390/B00D/R0002/Floor Coverings Res/Textile/S21						
<b>B00D - R1004 - General Learning Space (53.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
8390/B00D/R0002/Floor Coverings Res/Textile/S21						
<b>B00D - R1005 - Cleaning Store - Distributed (2.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8390/B00D/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00D - R1006 - General Storeroom (9.68 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00D - R1007 - General Learning Space (67.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00D - R1008 - Staff Study (41.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00D - R1009 - Interview/Office - Type 1 (17.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00D - R1010 - Staff Kitchen (14.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00D - R1012 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00D - R1013 - Interview/Office - Type 1 (30.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00D - R1015 - Movement (108.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00D - R1016 - General Learning Space (90.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8390/B00D/R0002/Floor Coverings Res/Textile/S21					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R1017 - Staff Study (26.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
		8390/B00D/R0002/Floor Coverings Res/Textile/S21				
<b>B00D - R1018 - Staff - Toilet (1.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R1019 - Toilet - Lobby (2.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R1020 - Stairs (11.25 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R1021 - Stairs (20.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R9001 - Maintenance Bulk Store (254.82 m2)</b>						
No Asbestos						
<b>B00D - R9002 - Maintenance Bulk Store (27.16 m2)</b>						
No Asbestos						
<b>B00D - R9003 - Movement (6.73 m2)</b>						
No Asbestos						
<b>B00D - R9004 - Cleaning Store - Distributed (6.88 m2)</b>						
No Asbestos						
<b>B00D - R9005 - External Movement (4.29 m2)</b>						
No Asbestos						
<b>B00D - R9008 - Disabled Toilet (10.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R9009 - Stairs (8.85 m2)</b>						
No Asbestos						
<b>B00D - R9010 - General Assistants (6.68 m2)</b>						
No Asbestos						
<b>B00D - R9011 - General Storeroom (64.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8390/B00D/R0001/Ceiling Structures/Linings/S2				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R9012 - General Storeroom (4.78 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Science Learning - 1963 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 8390/B00D/In-fill-panel/S1	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 8390/B00F/Eaves Linings/S32					<b>No Asbestos Detected</b>
Underfloor Voids	Packing 8390/B00E/Underfloor Voids/S13	4m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Debris	Flat AC Sheeting 8390/B00E/Underfloor Voids/S13	4m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00E - R0001 - Cleaning Store - Distributed (3.24 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00E - R0002 - Garden Store Room (3.76 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00E - R0003 - Distribution Board Cupboard (0.54 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
--------------------------	----------------	-------	-------	--------------------	---------	---

**B00E - R0004 - Movement (5 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00E - R0005 - External Movement (3.98 m2)**

No Asbestos

**B00E - R0006 - General Learning Space (52.85 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0009/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00E - R0007 - General Learning Space (52.85 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0009/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00E - R0008 - General Learning Space (52.85 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0009/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00E - R0009 - Staff Study (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0009/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8390/B00E/R0009/Floor Coverings Res/Textile/S31					No Asbestos Detected
<b>B00E - R0010 - Apparatus Store (26.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8390/B00E/R0010/Floor Coverings Res/Textile/S3	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00E - R0011 - Laboratory L.S. (86.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R0014 - Laboratory L.S. (86.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0009/Floor Coverings Res/Textile/S15	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00E - R0015 - General Learning Space (53.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0009/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00E - R0016 - Movement (95.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R0018 - Cleaning Store - Distributed (6.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R0019 - Distribution Board Cupboard (0.58 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
<b>B00E - R0020 - Cleaning Store - Distributed (4.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R0021 - Distribution Board Cupboard (1.6 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R0022 - Movement (39.48 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R0023 - Stairs (8.94 m2)</b>						
No Asbestos						
<b>B00E - R0024 - Preparation - Science (39.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R0025 - Toilet - Lobby (4.46 m2)</b>						
No Asbestos						
<b>B00E - R0026 - Staff - Toilet (1.67 m2)</b>						
No Asbestos						
<b>B00E - R0027 - Stairs (7.92 m2)</b>						
No Asbestos						
<b>B00E - R1001 - Cleaning Store - Distributed (3.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1002 - Distribution Board Cupboard (1.08 m2)</b>						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
Ceiling Structures/Linings	Flat AC Sheeting 8390/B00E/R1002/Ceiling Structures/Linings/S34	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1003 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1004 - General Learning Space (52.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1005 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1006 - Staff Study (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1007 - Senior Seminar (26.46 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1008 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1009 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1010 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1011 - General Learning Space (52.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1012 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00E/R0010/Floor Coverings Res/Textile/S3	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1013 - Movement (110.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00D/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1015 - Cleaning Store - Distributed (6.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8390/B00E/R9004/Ceiling Structures/Linings/S14					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1016 - Distribution Board Cupboard (0.54 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
<b>B00E - R1017 - Cleaning Store - Distributed (4.35 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R1019 - Movement (36.03 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R1020 - Stairs (13.64 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R1021 - Staff - Toilet (1.69 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R1022 - Toilet - Lobby (4.72 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R1023 - Stairs (16.19 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R9004 - Garden Store Room (25.2 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Electrical Backing Board Resinous Board 1Unit South west Good Condition (1) Low (1) Low Priority (2-3)  
**Assumed Asbestos - Electrical Hazard**

**B00E - R9005 - Staff Study (52.93 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R9006 - General Learning Space (52.04 m2)**

Ceiling Structures/Linings Vermiculite  
 8390/B00E/R9004/Ceiling Structures/Linings/S14 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library/General Learning - 1974 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 8390/B00F/Eaves Linings/S32					No Asbestos Detected
Ceiling Voids - Raked Ceiling	No Asbestos Found 8390/B00F/Barge Boards/S33					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

**Interior****B00F - M1001 - Plant (20.3 m2)**

No Asbestos

**B00F - M1002 - Seminar (14.67 m2)**

No Asbestos

**B00F - M1003 - Seminar (14.67 m2)**

No Asbestos

**B00F - M1004 - Seminar (14.68 m2)**

No Asbestos

**B00F - M1005 - Main Area (130.72 m2)**

No Asbestos

**B00F - M1006 - Plant (20.06 m2)**

No Asbestos

**B00F - M1007 - Stairs (4.64 m2)**

No Asbestos

**B00F - M1008 - Stairs (4.7 m2)**

No Asbestos

**B00F - R0002 - Cleaning Store - Distributed (2.77 m2)**

No Asbestos

**B00F - R0003 - General Learning Space (53.66 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00F/R1001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00F/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00F - R0004 - General Learning Space (53.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8390/B00F/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

Ceiling Structures/Linings	Vermiculite 8390/B00F/R1001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

**B00F - R0005 - General Learning Space (53.66 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00F/R1001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 8390/B00F/R0007/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00F - R0006 - Laboratory L.S. (91.48 m2)**

Ceiling Structures/Linings	Vermiculite 8390/B00F/R1001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0007 - Preparation (47.57 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0008 - Distribution Board Cupboard (1.19 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00F - R0009 - Laboratory L.S. (92.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0010 - External Movement (3.92 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00F/R1014/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>
<b>B00F - R0011 - External Movement (2.8 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00F/R1014/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>
<b>B00F - R0012 - Movement (70.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0013 - Toilets - Girls (16.13 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00F/R0013/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0014 - Toilet - Lobby (2.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0015 - External Movement (54.7 m2)</b>						
No Asbestos						
<b>B00F - R1001 - General Storeroom (8.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R1002 - Workroom (29.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8390/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	8390/B00F/R1001/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R1003 - Librarian (9.93 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1004 - Workroom (20.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles		8390/B00F/R0007/Floor Coverings Res/Textile/S7			No Asbestos Detected
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1005 - Cleaning Store - Distributed (1.61 m2)</b>						
No Asbestos						
<b>B00F - R1006 - Staff - Toilet (2.93 m2)</b>						
No Asbestos						
<b>B00F - R1007 - Staff - Toilet (3.72 m2)</b>						
No Asbestos						
<b>B00F - R1008 - Seminar (15.54 m2)</b>						
No Asbestos						
<b>B00F - R1009 - Seminar (12.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1010 - Audio Visual Workroom (12.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1011 - Seminar (15.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1012 - Distribution Board Cupboard (0.9 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00F - R1013 - External Movement (4.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8390/B00F/R1014/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	
<b>B00F - R1014 - External Movement (4.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8390/B00F/R1014/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	
<b>B00F - R1015 - Main Area (425.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R1016 - Stairs (0.61 m2)</b>						
No Asbestos						
<b>B00F - R1017 - Stairs (0.61 m2)</b>						
No Asbestos						
<b>B00F - R9001 - Kiln Space (25.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R9002 - General Learning Space (53.29 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles		8390/B00F/R0007/Floor Coverings Res/Textile/S7			No Asbestos Detected
-----------------------------	-------------	--	--	--	--	----------------------

**B00F - R9003 - General Learning Space (53.28 m2)**

Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles		8390/B00F/R0007/Floor Coverings Res/Textile/S7			No Asbestos Detected
-----------------------------	-------------	--	--	--	--	----------------------

**B00F - R9004 - General Learning Space (53.65 m2)**

Ceiling Structures/Linings	Vermiculite		8390/B00F/R1001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)		8390/B00F/R0007/Floor Coverings Res/Textile/S7			No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

**B00F - R9005 - Bulk Store (14.5 m2)**

No Asbestos

**B00F - R9006 - Resources Store (21.17 m2)**

No Asbestos

**B00F - R9009 - General Storeroom (6.52 m2)**

No Asbestos

**B00F - R9010 - External Movement (36.36 m2)**

No Asbestos

**B00F - R9011 - General Storeroom (31.59 m2)**

No Asbestos

**B00F - R9012 - General Storeroom (18.04 m2)**

No Asbestos

**B00F - R9013 - General Storeroom (16.27 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Multi Purpose Facilities - 1982 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos - Height Restriction**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
-------------------------------	-------------------	--	--	--	--	--

Underfloor Voids - Slab on Ground	No Asbestos Found					
-----------------------------------	-------------------	--	--	--	--	--

**Interior**

**B00G - M0001 - Performing Arts Store (5.64 m2)**

No Asbestos

**B00G - M0002 - Control Room (5.64 m2)**

No Asbestos

**B00G - R0001 - Multi-Purpose Space (521.67 m2)**

No Asbestos

**B00G - R0002 - Shower/Change (35 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8390/B00G/R0002/Partition Walls (Cubicles)/S6					

**B00G - R0004 - Distribution Board Cupboard (3.24 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0005 - Movement (63.1 m2)**

No Asbestos

**B00G - R0006 - Movement (2.39 m2)**

No Asbestos

**B00G - R0007 - Movement (2.39 m2)**

No Asbestos

**B00G - R0008 - Stage (70.29 m2)**

No Asbestos

**B00G - R0009 - Shower/Change (35 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8390/B00G/R0002/Partition Walls (Cubicles)/S6					

**B00G - R0011 - Cleaning Store - Distributed (3.24 m2)**

No Asbestos

**B00G - R0012 - Staff Kitchen (15.11 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8390/B00G/R0004/Floor Coverings Res/Textile/S5					

Under sink pad	Resinous Membrane					<b>No Asbestos Detected</b>
	8390/B00G/R0012/Under sink pad/S28					

Sink pad adhesive	Adhesive	1Unit	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8390/B00G/R0012/Sink pad adhesive/S29					<b>Chrysotile (white asbestos)</b>

**B00G - R0014 - Sport Equipment Store (12.07 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8390/B00G/R0004/Floor Coverings Res/Textile/S5					

**B00G - R0015 - Staff Study (21 m2)**

No Asbestos

**B00G - R0016 - Chair Store (51.42 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R0017 - External Movement (275.15 m2)</b>						
No Asbestos						
<b>B00G - R0018 - Toilets-Disabled (3.46 m2)</b>						
No Asbestos						
<b>B00G - R0019 - Staff Shower (1.93 m2)</b>						
No Asbestos						
<b>B00G - R0020 - Toilets - Girls (15.13 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
8390/B00G/R0002/Partition Walls (Cubicles)/S6						
<b>B00G - R0021 - Toilet - Lobby (2.85 m2)</b>						
No Asbestos						
<b>B00G - R0022 - Toilet - Lobby (3.05 m2)</b>						
No Asbestos						
<b>B00G - R0023 - Toilets - Boys (15.14 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
8390/B00G/R0002/Partition Walls (Cubicles)/S6						
<b>B00G - R0024 - Staff Change (3.83 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Music - 1995 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Resources (25.76 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00H - R0003 - Music Learning Space (62.29 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00H - R0004 - Practice/Seminar (11.82 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00H - R0005 - Music Learning Space (76.96 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00H - R0007 - External Movement (83.81 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	
	8390/B00H/R0007/Ceiling Structures/Linings/S22	<b>No Asbestos Detected</b>

**B00H - R0008 - Practice/Seminar (13.6 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00H - R0009 - Practice/Seminar (12.2 m2)**

No Asbestos

**B00H - R0010 - Music Store (9.98 m2)**

No Asbestos

**B00H - R0011 - Practice/Seminar (7.73 m2)**

No Asbestos

**B00H - R0012 - Practice/Seminar (7.73 m2)**

No Asbestos

**B00H - R9001 - Sport Equipment Store (41.91 m2)**

No Asbestos

**B00H - R9002 - Sport Equipment Store (5.16 m2)**

No Asbestos

**B00H - R9003 - Sport Equipment Store (76.5 m2)**

No Asbestos

**B00H - R9004 - Sport Equipment Store (13.97 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Building Services - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B001 - R0001 - Plant (7.9 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

### OS 522 - D12735 - Staff Study : Placement Date - 5/03/2002

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Staff Room

No Asbestos Found.

### OS 770 - D13124 - Technics - Metalwork/Heat Area/Store : Placement Date - 26/09/1996

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

#### Interior

##### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

##### R2 - Materials Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

### OS 621 - D13489 - Single Learning Unit - H/Cap : Placement Date - 9/07/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Home Base-I.O.

No Asbestos Found.

##### R2 - Toilets-Disabled

No Asbestos Found.

##### R3 - Laundry

No Asbestos Found.

### OS 601 - D14710 - Learning Unit - Standard/Withdrawal : Placement Date - 12/12/2015

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Entry

No Asbestos Found.

##### R2 - General Learning Space

No Asbestos Found.

##### R3 - Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017