


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wingham High School (8391)  
**Region :** North Coast  
**State Electorate :** Myall Lakes  
**Local Government Area :** Greater Taree

**Initial Survey :** Noel Arnold & Associates : 07 - Apr - 2008  
**Reviewed By :** AECOM : 29 - Oct - 2014

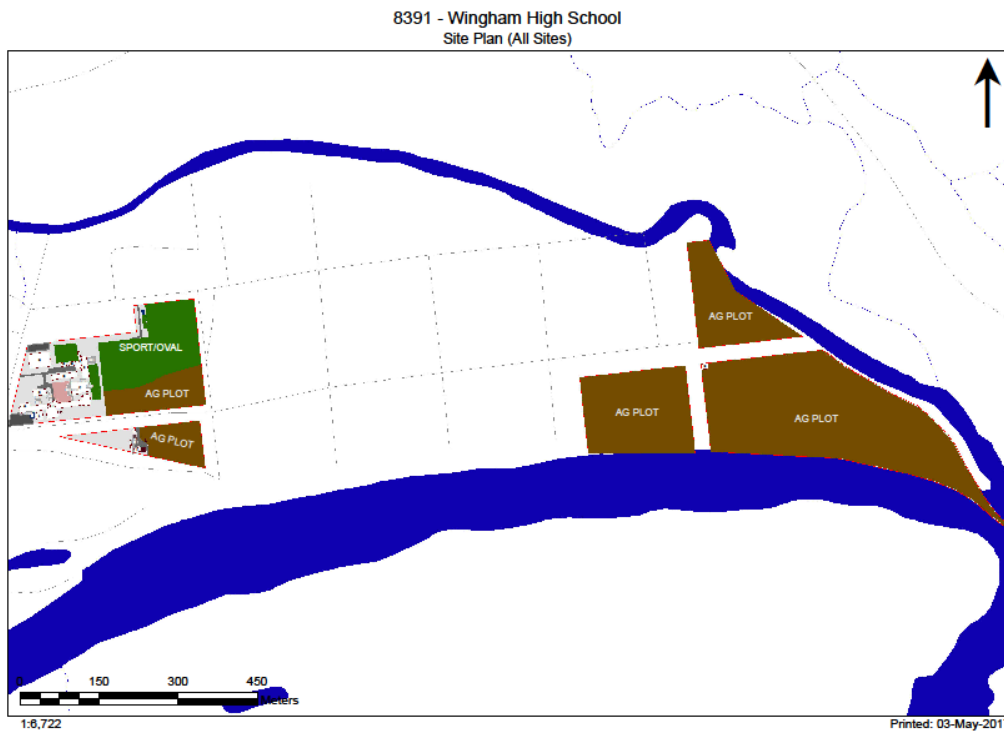

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Various - 1965 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 8391/B00B/In-fill-panel/S1	64m2	Below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Eaves Linings	Flat AC Sheeting 8391/B00A/Wall Cladding/S8	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Assumed Asbestos - Height Restriction (Generally 6-8m)</b>	
Wall Cladding	Flat AC Sheeting 8391/B00A/Wall Cladding/S8					<b>No Asbestos Detected</b>
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible due to flat roof.					
Underfloor Voids	AC Fragments/Debris 8391/B00A/Underfloor Voids/S26					<b>No Asbestos Detected</b>

**Interior****B00A - R0001 - General Learning Space (47.11 m2)**

No Asbestos

**B00A - R0002 - Seminar (13.77 m2)**

In-fill-panel	Flat AC Sheeting 8391/B00A/R0002/In-fill-panel/S9					<b>No Asbestos Detected</b>
---------------	--	--	--	--	--	-----------------------------

**B00A - R0003 - General Learning Space (47.47 m2)**

No Asbestos

**B00A - R0005 - General Storeroom (4.29 m2)**

No Asbestos

**B00A - R0006 - General Storeroom (9.8 m2)**

Ceiling Structures/Linings	Vermiculite 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
In-fill-panel	Compressed AC Sheet 8391/B00A/R0034/In-fill-panel/S6	4m	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**B00A - R0007 - General Learning Space (52.78 m2)**

Ceiling Structures/Linings	Vermiculite 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00A - R0009 - Main Switchroom (6.46 m2)**

Electrical Mounting Board	Encapsulated Insulation material within unit	4Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Assumed Asbestos - Electrical Hazard</b>	

**B00A - R0012 - General Learning Space (53.14 m2)**

Ceiling Structures/Linings	Vermiculite 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00A - R0013 - General Learning Space (53.14 m2)**

Ceiling Structures/Linings	Vermiculite 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00A - R0014 - General Learning Space (53 m2)**

Ceiling Structures/Linings	Vermiculite 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00A - R0018 - Workroom (26.52 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00A - R0019 - Entry (23.08 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Audio Visual Workroom (26.4 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Librarian (10.9 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Main Area (262.01 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Seminar (12.76 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Seminar (12.83 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Apparatus Store (25.99 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0001/Floor Coverings Res/Textile/S14						<b>Chrysotile (white asbestos)</b>
<b>B00A - R0029 - Laboratory L.S. (93.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8391/B00A/R0034/Ceiling Structures/Linings/S5						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R0030 - Growing/Breeding (9.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8391/B00A/R0034/Ceiling Structures/Linings/S5						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0031/Floor Coverings Res/Textile/S7						<b>Chrysotile (white asbestos)</b>
<b>B00A - R0031 - Preparation (29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8391/B00A/R0034/Ceiling Structures/Linings/S5						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0031/Floor Coverings Res/Textile/S7						<b>Chrysotile (white asbestos)</b>
<b>B00A - R0032 - Laboratory L.S. (95.04 m2)</b>						
In-fill-panel	Compressed AC Sheet	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6						<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
8391/B00A/R0034/Ceiling Structures/Linings/S5						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R0033 - Laboratory L.S. (92.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8391/B00A/R0034/Ceiling Structures/Linings/S5						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R0034 - Preparation (27.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8391/B00A/R0034/Ceiling Structures/Linings/S5						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
In-fill-panel	Compressed AC Sheet	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6						<b>Chrysotile (white asbestos)</b>
<b>B00A - R0035 - General Storeroom (6.12 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R0036 - Serviced Learning Space (54.36 m2)**

No Asbestos

**B00A - R0037 - Cleaning Store - Distributed (1.09 m2)**

No Asbestos

**B00A - R0038 - Distribution Board Cupboard (1.3 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0039 - General Learning Space (54.18 m2)**

No Asbestos

**B00A - R0040 - Entry (21.89 m2)**

No Asbestos

**B00A - R0041 - Office/Store (9.85 m2)**

No Asbestos

**B00A - R0042 - Laboratory L.S. (90.67 m2)**

No Asbestos

**B00A - R0043 - Chemical Store (11.76 m2)**

No Asbestos

**B00A - R0044 - General Storeroom (9.9 m2)**

No Asbestos

**B00A - R0045 - Movement (2.9 m2)**

No Asbestos

**B00A - R0047 - Lift (2.23 m2)**

No Asbestos

**B00A - R0050 - Entry (7.73 m2)**

No Asbestos

**B00A - R0051 - Distribution Board Cupboard (2.08 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	NA	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	----	---------------	--------------------	---------	--------------------

**Assumed Asbestos - Fibre cement sheeting present in****B00A - R0052 - Toilet - Lobby (3.4 m2)**

Non Accessible

**B00A - R0053 - Staff - Toilet (6.07 m2)**

Wall Linings Internal	Compressed AC Sheet 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>
-----------------------	--	--	--	--	--	-----------------------------

Window	Putty 8391/B00A/R0062/Window/S28					<b>No Asbestos Detected</b>
--------	-------------------------------------	--	--	--	--	-----------------------------

**B00A - R0054 - Staff - Toilet (5.81 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 8391/B00A/R0002/In-fill-panel/S9					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

Urinal	Bitumastic adhesive	NA	West	Good Condition (1)	Low (1)	Low Priority (2-3)
--------	---------------------	----	------	--------------------	---------	--------------------

**Assumed Asbestos - No access to urinal bitumastic.****B00A - R0055 - Toilet - Lobby (2.09 m2)**

Non Accessible

**B00A - R0056 - Stairs (9.84 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8391/B00A/R0034/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0057 - External Movement (135.4 m2)**

Wall Linings Internal	Flat AC Sheeting 8391/B00A/R0057/Wall Linings Internal/S27					<b>No Asbestos Detected</b>
-----------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Compressed AC Sheet	2m2	above EDB (B00A-R0067)	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00A - R0058 - Movement (17.67 m2)</b>						
No Asbestos						
<b>B00A - R0059 - External Movement (95.61 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8391/B00A/R0034/Ceiling Structures/Linings/S5					No Asbestos Detected	
<b>B00A - R0060 - Movement (12.63 m2)</b>						
No Asbestos						
<b>B00A - R0061 - Stairs (11.73 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8391/B00A/R0034/Ceiling Structures/Linings/S5					No Asbestos Detected	
<b>B00A - R0062 - General Learning Space - Type 11 (32.86 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	NA	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8391/B00D/R0012/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0012/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
Window	Putty					
8391/B00A/R0062/Window/S28					No Asbestos Detected	
<b>B00A - R0063 - Store (2.87 m2)</b>						
Non Accessible						
<b>B00A - R0064 - Staff Study (35.05 m2)</b>						
Window	Putty					
8391/B00A/R0062/Window/S28					No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0031/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
<b>B00A - R0065 - External Movement (14.72 m2)</b>						
No Asbestos						
<b>B00A - R0066 - Store (12.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0031/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
<b>B00A - R0067 - Distribution Board Cupboard (0.72 m2)</b>						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting					
8391/B00A/R0067/Wall Linings Internal/S29					No Asbestos Detected	
<b>B00A - R0068 - Distribution Board Cupboard (0.68 m2)</b>						
Note: No inspection of live electrical installation.						
Non Accessible						
<b>B00A - R0069 - Stairs (12.29 m2)</b>						
Wall Linings Internal	Compressed AC Sheet	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00B/In-fill-panel/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00A - R0070 - External Movement (24.45 m2)</b>						
Window	Putty					
8391/B00A/R0062/Window/S28					No Asbestos Detected	
<b>B00A - R0071 - Commonroom (49.26 m2)</b>						
No Asbestos						
<b>B00A - R1001 - General Learning Space (47.8 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1002 - Seminar (14.9 m2)</b>						
No Asbestos						
<b>B00A - R1003 - General Learning Space (48.14 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Movement (317.13 m2)</b>						
In-fill-panel	Compressed AC Sheet	5m	Adjacent AR0023 & west stairwell	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00A/R0034/In-fill-panel/S6					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8391/B00A/R1004/In-fill-panel/S10					
Ceiling Structures/Linings	Flat AC Sheeting	318m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00A/R1004/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8391/B00A/R1004/Ceiling Structures/Linings/S19					
<b>B00A - R1005 - General Storeroom (9.78 m2)</b>						
In-fill-panel	Compressed AC Sheet	4m	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00A/R0034/In-fill-panel/S6					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1006 - Computer Learning Space (57.46 m2)</b>						
No Asbestos						
<b>B00A - R1007 - General Storeroom (7.57 m2)</b>						
No Asbestos						
<b>B00A - R1008 - Computer Resource (12.71 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Computer Learning Space (52.63 m2)</b>						
No Asbestos						
<b>B00A - R1010 - General Learning Space (53 m2)</b>						
No Asbestos						
<b>B00A - R1011 - General Learning Space (52.78 m2)</b>						
No Asbestos						
<b>B00A - R1012 - Cleaning Store - Distributed (3.25 m2)</b>						
No Asbestos						
<b>B00A - R1013 - General Storeroom (9.12 m2)</b>						
No Asbestos						
<b>B00A - R1014 - General Learning Space (66.02 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Staff Study (25.98 m2)</b>						
No Asbestos						
<b>B00A - R1016 - Commonroom (81.85 m2)</b>						
No Asbestos						
<b>B00A - R1017 - Careers Advisers Office (12.12 m2)</b>						
No Asbestos						
<b>B00A - R1018 - Interview/Office - Type 1 (13.57 m2)</b>						
No Asbestos						
<b>B00A - R1019 - Senior Study (52.35 m2)</b>						
No Asbestos						
<b>B00A - R1020 - Computer Resource (18.83 m2)</b>						
No Asbestos						
<b>B00A - R1021 - General Storeroom (26.24 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R1022 - Staff - Toilet (9.08 m2)</b>						
In-fill-panel	Compressed AC Sheet	2m	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00A - R1023 - Cleaning Store - Distributed (2.01 m2)</b>						
No Asbestos						
<b>B00A - R1024 - Staff - Toilet (10.81 m2)</b>						
In-fill-panel	Compressed AC Sheet	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00A - R1025 - General Learning Space (53.37 m2)</b>						
No Asbestos						
<b>B00A - R1026 - General Learning Space (52.78 m2)</b>						
No Asbestos						
<b>B00A - R1027 - Practice/Seminar (26.35 m2)</b>						
No Asbestos						
<b>B00A - R1028 - Performing Arts Store (12.81 m2)</b>						
No Asbestos						
<b>B00A - R1029 - Seminar (14.59 m2)</b>						
In-fill-panel	Compressed AC Sheet	4m	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00A - R1030 - General Learning Space (52.78 m2)</b>						
No Asbestos						
<b>B00A - R1031 - Materials Technology L.S. (64.71 m2)</b>						
No Asbestos						
<b>B00A - R1032 - Staff Study (39.23 m2)</b>						
No Asbestos						
<b>B00A - R1033 - Laundry (8.78 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
8391/B00A/R1033/Wall Linings Internal/S12					No Asbestos Detected	
<b>B00A - R1034 - General Storeroom (17.92 m2)</b>						
No Asbestos						
<b>B00A - R1035 - Cleaning Store - Distributed (1.06 m2)</b>						
No Asbestos						
<b>B00A - R1036 - General Storeroom (0.54 m2)</b>						
No Asbestos						
<b>B00A - R1038 - T.A.S. Entry/Display (6.69 m2)</b>						
No Asbestos						
<b>B00A - R1039 - Food/Research Space (12.45 m2)</b>						
No Asbestos						
<b>B00A - R1040 - Pantry (19.41 m2)</b>						
No Asbestos						
<b>B00A - R1041 - Food Technology L.S. (109.22 m2)</b>						
No Asbestos						
<b>B00A - R1042 - Distribution Board Cupboard (0.68 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R1044 - Stairs (18.52 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Ceiling Structures/Linings	Flat AC Sheeting					
	8391/B00A/R0034/Ceiling Structures/Linings/S5					No Asbestos Detected
<b>B00A - R1045 - Stairs (15.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8391/B00A/R0034/Ceiling Structures/Linings/S5					No Asbestos Detected
<b>B00A - R1046 - Stairs (17.09 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8391/B00A/R0034/Ceiling Structures/Linings/S5					No Asbestos Detected
<b>B00A - R1047 - Kitchen - Type 1 (100.17 m2)</b>						
No Asbestos						
<b>B00A - R1048 - Pantry (7.24 m2)</b>						
No Asbestos						
<b>B00A - R1049 - Distribution Board Cupboard (0.42 m2)</b>						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00A - Room+1 - Staffroom extension</b>						
In-fill-panel	Compressed AC Sheet	2m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00A/R0034/In-fill-panel/S6					Chrysotile (white asbestos)

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Various - 1965 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting	64m2	Below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00B/In-fill-panel/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction (6-8m)</b>					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible due to fixed ceiling in flat roof.					

**Interior****B00B - R0001 - Main Switchroom (5.86 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	8391/B00B/R0001/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>

**B00B - R0002 - Materials Store (16.51 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0003 - Seminar/Technology Space (9.45 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0004 - Materials Store (7.13 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0005 - Distribution Board Cupboard (2.76 m2)**

No Asbestos	Note: No inspection of live electrical installation.					
-------------	--	--	--	--	--	--

**B00B - R0006 - Materials Technology L.S. (79.57 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0007 - Workshop Area (85.65 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0008 - Office/Store (9.52 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0009 - Welding Area (15.64 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0010 - Materials Store (15.08 m2)**

Ceiling Structures/Linings	Vermiculite					
	8391/B00B/R0004/Ceiling Structures/Linings/S21					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00B - R0011 - Resources Store (4.9 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8391/B00B/R0004/Ceiling Structures/Linings/S21			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0012 - Darkroom Space (25.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8391/B00B/R0004/Ceiling Structures/Linings/S21			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0013 - Staff Study (26.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8391/B00B/R0004/Ceiling Structures/Linings/S21			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0014 - Resources Store (17.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8391/B00B/R0004/Ceiling Structures/Linings/S21			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0015 - External Movement (109.93 m2)</b>						
No Asbestos						
<b>B00B - R0016 - Darkroom Space (4.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8391/B00B/R0004/Ceiling Structures/Linings/S21			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0017 - External Stairs (9.26 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		8391/B00B/R0001/Ceiling Structures/Linings/S20			No Asbestos Detected
<b>B00B - R0018 - External Stairs (8.78 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		8391/B00B/R0001/Ceiling Structures/Linings/S20			No Asbestos Detected
<b>B00B - R0019 - Plant (3.77 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Staff - Toilet (6.59 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00C/R0016/Partition Walls (Cubicles)/S3						Chrysotile (white asbestos)
<b>B00B - R1002 - Music Store (5.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0031/Floor Coverings Res/Textile/S7						Chrysotile (white asbestos)
<b>B00B - R1003 - Music Learning Space (65.47 m2)</b>						
No Asbestos						
<b>B00B - R1004 - Practice/Seminar (26.06 m2)</b>						
No Asbestos						
<b>B00B - R1005 - Resources Store (32.72 m2)</b>						
Floor Coverings Res/Textile	Backing to vinyl flooring.					
8391/B00B/R1005/Floor Coverings Res/Textile/S30						No Asbestos Detected
<b>B00B - R1006 - Art Learning Space (66.76 m2)</b>						
No Asbestos						
<b>B00B - R1007 - Workshop (32.35 m2)</b>						
No Asbestos						
<b>B00B - R1008 - Art Learning Space (66.11 m2)</b>						
No Asbestos						
<b>B00B - R1009 - Resources Store (5.67 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0031/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1010 - Staff - Toilet (6.7 m2)</b>						
Partition Walls (Cubicles)	Flat AC Sheeting	2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00C/R0016/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1011 - General Storeroom (3.49 m2)</b>						
In-fill-panel	Compressed AC Sheet	4m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1012 - Movement (108.73 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	109m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R1004/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1013 - Cleaning Store - Distributed (3.57 m2)</b>						
In-fill-panel	Compressed AC Sheet	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00A/R0034/In-fill-panel/S6					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1014 - Distribution Board Cupboard (0.6 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8391/B00B/R1014/Wall Linings Internal/S22					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00B - R1015 - Stairs (5.58 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8391/B00B/R0001/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>	
<b>B00B - R1016 - Stairs (5.83 m2)</b>						
Ceiling Structures/Linings	Corrugated AC Sheeting					
8391/B00B/R0001/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1965 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos - Height Restriction (6-8m)**

Ceiling Voids	Non Accessible Area - Area inaccessible. Access hatch to ceiling cavity (4.5m high) is located above false ceiling. Access via canteen B00C-R0012.					
---------------	---	--	--	--	--	--

Underfloor Voids - Slab on Ground	No Asbestos Found					
-----------------------------------	-------------------	--	--	--	--	--

**Interior****B00C - R0001 - External Movement (25.99 m2)**

No Asbestos

**B00C - R0002 - Shower/Change (35.76 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

In-fill-panel	Flat AC Sheeting	8m	South, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>

**B00C - R0003 - Movement (6.57 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0004 - Cleaning Store - Distributed (7.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Shower/Change (37.4 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

In-fill-panel	Flat AC Sheeting	8m	North, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>

**B00C - R0006 - Staff Shower (7.29 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0007 - Movement (6.5 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00C - R0008 - Toilets-Girls (52.49 m2)**

In-fill-panel	Flat AC Sheeting	8m	North, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00C/R0016/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0009 - Student Drinking Facilities (31.89 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
<b>B00C - R0010 - General Storeroom (12.65 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0011 - Movement (167.88 m2)</b>							
No Asbestos							
<b>B00C - R0012 - Student Canteen (34.15 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>		
In-fill-panel	Flat AC Sheeting	1m	North, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0013 - General Storeroom (14.2 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>		
In-fill-panel	Flat AC Sheeting	2m	North, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0014 - Sport Equipment Store (14.21 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>		
In-fill-panel	Flat AC Sheeting	2m	South, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0015 - Pantry (4.8 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8391/B00C/R0015/Ceiling Structures/Linings/S31				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Backing to vinyl tiles	8391/B00C/R0015/Floor Coverings Res/Textile/S32				<b>No Asbestos Detected</b>	
<b>B00C - R0016 - Staff - Toilet (4 m2)</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0016/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0017 - Movement (5.29 m2)</b>							
No Asbestos							
<b>B00C - R0018 - Pantry (5.38 m2)</b>							
No Asbestos							
<b>B00C - R0019 - Student Drinking Facilities (31.63 m2)</b>							
No Asbestos							
<b>B00C - R0020 - Sport Equipment Store (5.86 m2)</b>							
No Asbestos							
<b>B00C - R0021 - Toilets-Boys (46.12 m2)</b>							
In-fill-panel	Flat AC Sheeting	8m	South, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0012/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8391/B00C/R0016/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - R0022 - External Movement (25.99 m2)**

No Asbestos

**B00C - R0023 - External Movement (89.77 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration - 1965 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0021/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00D - R0001 - Clinic - Boys (17.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

**B00D - R0002 - Interview/Office - Type 1 (9.72 m2)**

No Asbestos

**B00D - R0003 - Distribution Board Cupboard (0.7 m2)**

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	Communication cable boxes	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8391/B00D/R0003/Electrical Mounting Board/S15				Chrysotile (white asbestos)	

**B00D - R0004 - Staff Kitchen (3.04 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	2m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0004/In-fill-panel/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0005 - Staff Change (3.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

**B00D - R0006 - Staff - Toilet (1.66 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0013/Wall Linings Internal/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0007 - Staff - Toilet (1.6 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0013/Wall Linings Internal/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0008 - Cleaning Store - Distributed (2.79 m2)**

No Asbestos

**B00D - R0009 - Staff Change (3.6 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8391/B00D/R0001/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

**B00D - R0010 - Duplicating Workroom (13.35 m2)**

No Asbestos

**B00D - R0011 - Deputy Principal Office (20.29 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R0012 - General Storeroom (3.6 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0012/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	

**B00D - R0013 - Staff - Toilet (4.5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0001/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0013/Wall Linings Internal/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0014 - Principal Office (20.27 m2)**

No Asbestos

**B00D - R0015 - Administration - Clerical (17.26 m2)**

No Asbestos

**B00D - R0016 - Staff Study (9.89 m2)**

No Asbestos

**B00D - R0017 - Interview/Office - Type 1 (9.92 m2)**

No Asbestos

**B00D - R0018 - Administration - Clerical (17.55 m2)**

No Asbestos

**B00D - R0019 - Movement (64.37 m2)**

No Asbestos

**B00D - R0020 - External Movement (4.27 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0021/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

**B00D - R0021 - External Movement (12.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8391/B00D/R0021/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

**B00D - R0022 - Access Student Shower/Toilet - Type 2 (5.04 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Technological & Applied Studies - 1989 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00E - R0001 - Movement (13.05 m2)**

No Asbestos

**B00E - R0002 - Dust Extraction Space (8.9 m2)**

No Asbestos

**B00E - R0003 - Metal Technology Bay (21.08 m2)**

No Asbestos

**B00E - R0004 - Wood Technology Bay (21.94 m2)**

No Asbestos

**B00E - R0005 - Materials Technology L.S. (107.18 m2)**

No Asbestos

**B00E - R0006 - T.A.S. Outdoor Area (23.38 m2)**

No Asbestos

**B00E - R0007 - Bulk Store (33.84 m2)**

No Asbestos

**B00E - R0008 - Design L.S. (58.26 m2)**

Vinyl Tiles (Under Floor      No Asbestos Found  
Covering/Carpet)

**B00E - R0009 - Seminar/Technology Space (25.41 m2)**

Vinyl Tiles (Under Floor      No Asbestos Found  
Covering/Carpet)

**B00E - R0010 - Staff Study (23.23 m2)**

Vinyl Tiles (Under Floor      No Asbestos Found  
Covering/Carpet)

**B00E - R0011 - Distribution Board Cupboard (0.75 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0012 - General Assistants (14.44 m2)**

No Asbestos

**B00E - R0013 - Cleaning Supplies Store (17.18 m2)**

Vinyl Tiles (Under Floor      No Asbestos Found  
Covering/Carpet)

**B00E - R0014 - External Movement (78.36 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Technological & Applied Studies - 1989 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0005 - Workshop Area (120.03 m2)**

No Asbestos

**B00F - R0006 - Dust Extraction Space (3.71 m2)**

No Asbestos

**B00F - R0007 - Distribution Board Cupboard (0.81 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0008 - External Movement (12.31 m2)**

No Asbestos

**B00F - R0009 - Project Store - Type 1 (46.18 m2)**

No Asbestos

**B00F - R0010 - Materials Store (10.78 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00G - Multi Purpose Facilities - 1991 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00G - M0001 - Control Room (5.7 m2)**

No Asbestos

**B00G - M0002 - Control Room (5.7 m2)**

No Asbestos

**B00G - R0001 - Chair Store (48.71 m2)**

No Asbestos

**B00G - R0002 - Toilets-Disabled (4.2 m2)**

No Asbestos

**B00G - R0003 - Cleaning Store - Distributed (3.24 m2)**

No Asbestos

**B00G - R0004 - Movement (2.67 m2)**

No Asbestos

**B00G - R0005 - Toilets-Boys (17.76 m2)**

No Asbestos

**B00G - R0006 - Shower/Change (30.01 m2)**

No Asbestos

**B00G - R0007 - Movement (42.32 m2)**

No Asbestos

**B00G - R0008 - Stage (65.39 m2)**

No Asbestos

**B00G - R0009 - Movement (15.34 m2)**

No Asbestos

**B00G - R0010 - Movement (6.02 m2)**

No Asbestos

**B00G - R0011 - Shower/Change (29.97 m2)**

No Asbestos

**B00G - R0012 - Toilets-Girls (17.93 m2)**

No Asbestos

**B00G - R0013 - Movement (2.9 m2)**

No Asbestos

**B00G - R0014 - Main Switchroom (3.24 m2)**

No Asbestos

**B00G - R0015 - Staff Kitchen (14.51 m2)**

No Asbestos

**B00G - R0016 - Staff Shower (5.63 m2)**

No Asbestos

**B00G - R0017 - Staff Study (11.79 m2)**

No Asbestos

**B00G - R0018 - Sport Equipment Store (20.77 m2)**

No Asbestos

**B00G - R0019 - Multi-Purpose Space (455.53 m2)**

No Asbestos

**B00G - R0020 - External Movement (267.88 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Agricultural Science - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00H - R0001 - Staff - Toilet (1.5 m2)**

No Asbestos

**B00H - R0002 - Staff Study (12.94 m2)**

No Asbestos

**B00H - R0003 - Class Tools Storage (14.64 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Agricultural Science - 1985 - Brick/Block (Brick/Block)****Exterior**

Wall Cladding	Flat AC Sheeting 8391/B001/Wall Cladding/S23	20m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 8391/B001/Eaves Linings/S25	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B001 - R0001 - Plant Space (9.41 m2)**

Wall Linings Internal	Flat AC Sheeting 8391/B001/Wall Cladding/S23	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting 8391/B001/R0001/Wall Linings Internal/S24	40m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B001 - R0002 - Movement (16.87 m2)**

Wall Linings Internal	Flat AC Sheeting 8391/B001/Wall Cladding/S23	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	---	------	-------	--------------------	---------	--

**B001 - R0003 - Animal Space (11.23 m2)**

No Asbestos

**B001 - R0004 - Machine Storage (44.99 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Agricultural Science - 2000 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

<b>B00J - R0001 - Animal Space (4.72 m2)</b>	No Asbestos
<b>B00J - R0002 - Animal Space (4.7 m2)</b>	No Asbestos
<b>B00J - R0003 - Animal Space (4.58 m2)</b>	No Asbestos
<b>B00J - R0004 - Animal Space (4.68 m2)</b>	No Asbestos
<b>B00J - R0005 - Animal Space (4.5 m2)</b>	No Asbestos
<b>B00J - R0006 - Animal Space (4.59 m2)</b>	No Asbestos
<b>B00J - R0007 - Class Tools Storage (4.31 m2)</b>	No Asbestos
<b>B00J - R0008 - Animal Space (4.59 m2)</b>	No Asbestos
<b>B00J - R0009 - Animal Space (4.64 m2)</b>	No Asbestos
<b>B00J - R0010 - Animal Space (4.65 m2)</b>	No Asbestos
<b>B00J - R0011 - Animal Space (4.44 m2)</b>	No Asbestos
<b>B00J - R0012 - Animal Space (4.29 m2)</b>	No Asbestos
<b>B00J - R0013 - Animal Space (4.59 m2)</b>	No Asbestos
<b>B00J - R0014 - Animal Space (4.17 m2)</b>	No Asbestos
<b>B00J - R0015 - Animal Space (5.07 m2)</b>	No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Agricultural Science - 2005 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00K - R0001 - Movement (37.08 m2)**

No Asbestos

**B00K - R0002 - Agriculture Covered Area (18 m2)**

No Asbestos

**B00K - R0003 - Machine Storage (63.99 m2)**

No Asbestos

**B00K - R0004 - Toilets-Unisex (3.14 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Computer Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00L - R0001 - Computer Learning Space (91.37 m2)**

No Asbestos

**B00L - R0002 - Seminar - Type 2 (18.68 m2)**

No Asbestos

**B00L - R0003 - Resource/Project Store (10.08 m2)**

No Asbestos

**B00L - R0004 - Computer Store (9 m2)**

No Asbestos

**B00L - R0005 - External Movement (28.22 m2)**

No Asbestos

**B00L - R0006 - Distribution Board Cupboard (0.5 m2)**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Building Services/Art - 2008 - Steel (Steel)**

**Exterior**

No Asbestos

**Interior**

**B00M - R0001 - General Assistants (68.21 m2)**

No Asbestos

**B00M - R0002 - Kiln Space (15.43 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Art - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00N - R0001 - General Storeroom (66.73 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 904 - D11960 - Dormitory (Toilet/Shower) : Placement Date - 30/09/2002

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		28.8 m2

### Interior

#### R1 - Toilets

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		6 m2

#### R2 - Change Room

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		6 m2

#### R3 - Toilets

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		6 m2

#### R4 - Change Room

Ceiling	Flat AC Sheet	Assumed Asbestos		6 m2
---------	---------------	------------------	--	------

#### R5 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		6 m2
---------	---------------	------------------	--	------

#### R6 - Performance Workshop

Ceiling	Flat AC Sheet	Assumed Asbestos		128 m2
---------	---------------	------------------	--	--------

OS 600 - D15268 - Learning Unit - Small : Placement Date - 30/06/1995

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		8.64 m2

### Interior

#### R1 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017