

# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** West Wyalong High School (8392)


**Region :** Riverina

**State Electorate :** Cootamundra

**Local Government Area :** Bland

**Initial Survey :** Noel Arnold & Associates : 07 - May - 2008

**Reviewed By :** AECOM : 26 - Nov - 2014

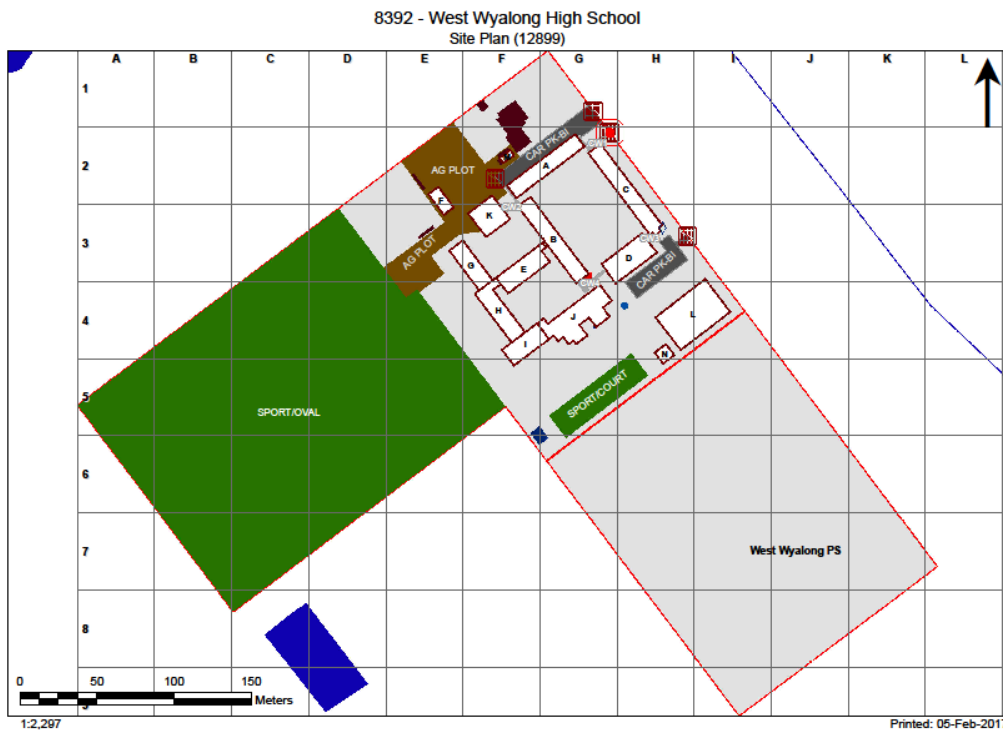

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Science - 1963 - Brick/Block (Brick/Block)****Exterior**

Window In-fill-panel	Flat AC Sheeting	120m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Window In-fill-panel/S10					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	120m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Area inaccessible - Limited access via AR0022 due low clearance (<0.5m).					
Underfloor Voids	Non Accessible Area - Area inaccessible - crawl space only, clearance ~ 0.5m.					

**Interior****B00A - R0001 - Duplicating Workroom (15.18 m2)**

No Asbestos

**B00A - R0002 - Clinic - Boys (8.73 m2)**

No Asbestos

**B00A - R0003 - Staff - Toilet (5.76 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/R0011/Wall Linings Internal/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00A - R0004 - Staff - Toilet (5.76 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/R0011/Wall Linings Internal/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00A - R0007 - Staff Study (16.71 m2)**

No Asbestos

**B00A - R0008 - Interview/Office - Type 1 (9.31 m2)**

No Asbestos

**B00A - R0009 - Deputy Principal Office (12.39 m2)**

No Asbestos

**B00A - R0010 - Principal Office (17.89 m2)**

No Asbestos

**B00A - R0011 - Staff - Toilet (3.59 m2)**

Wall Linings Internal	Flat AC Sheeting	15m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/R0011/Wall Linings Internal/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00A - R0012 - Movement (51.22 m2)**

No Asbestos

**B00A - R0013 - Movement (31.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00A/R0020/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00A - R0014 - General Storeroom (9.27 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8392/B00A/R0015/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

**B00A - R0015 - Preparation (16.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
8392/B00A/R0015/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0016 - Laboratory L.S. (92.46 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Laboratory L.S. (79.13 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Preparation (17.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8392/B00A/R0015/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0019 - General Storeroom (8.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8392/B00A/R0015/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0020 - Movement (1.32 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00A/R0020/Ceiling Structures/Linings/S12						<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R0021 - Movement (51.53 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Administration - Clerical (31.59 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - Staff Facilities/Technological & Applied Studies - 1963 - Brick/Block (Brick/Block)****Exterior**

Window In-fill-panel	Flat AC Sheeting	120m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Window In-fill-panel/S10				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	120m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Eaves Linings/S11				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Area inaccessible - Limited access via BR0007 due low clearance (<0.5m).					
Underfloor Voids	Non Accessible Area - Area inaccessible – crawl space only, clearance ~0.6m.					

**Interior****B00B - R0006 - Design L.S. (65.71 m2)**

No Asbestos

**B00B - R0007 - Shower/Change (5.93 m2)**

No Asbestos

**B00B - R0008 - General Storeroom (4.29 m2)**

No Asbestos

**B00B - R0009 - General Storeroom (2.33 m2)**

No Asbestos

**B00B - R0010 - Staff Study (18.76 m2)**

No Asbestos

**B00B - R0011 - Staff - Toilet (4.74 m2)**

Wall Linings Internal	Flat AC Sheeting	15m2	Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8392/B00B/R0011/Wall Linings Internal/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0012 - Cleaning Store - Distributed (1.77 m2)**

Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/R0011/Wall Linings Internal/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0013 - Staff - Toilet (4.13 m2)**

Wall Linings Internal	Flat AC Sheeting	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/R0011/Wall Linings Internal/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0014 - Movement (51.41 m2)**

No Asbestos

**B00B - R0015 - Movement (1.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00C/R0004/Ceiling Structures/Linings/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0016 - Movement (23.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Eaves Linings/S11				<b>Chrysotile (white asbestos)</b>	

**B00B - R0017 - Staff Study (12.75 m2)**

No Asbestos

**B00B - R0018 - Staff Study (12.78 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0019 - Staff Study (25.84 m2)</b>						
No Asbestos						
<b>B00B - R0020 - General Storeroom (12.71 m2)</b>						
No Asbestos						
<b>B00B - R0021 - Commonroom (85.07 m2)</b>						
No Asbestos						
<b>B00B - R0022 - General Storeroom (19.71 m2)</b>						
No Asbestos						
<b>B00B - R0023 - General Learning Space (39.28 m2)</b>						
No Asbestos						
<b>B00B - R0024 - Movement (1.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00C/R0004/Ceiling Structures/Linings/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0025 - Movement (48.18 m2)</b>						
No Asbestos						
<b>B00B - R0026 - Food Technology L.S. (77.84 m2)</b>						
No Asbestos						
<b>B00B - R0027 - Preparation - Materials (11.15 m2)</b>						
No Asbestos						
<b>B00B - R0028 - Pantry (7.31 m2)</b>						
No Asbestos						
<b>B00B - R0029 - Laundry (12.75 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Window In-fill-panel	Flat AC Sheeting 8392/B00B/Window In-fill-panel/S10	120m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 8392/B00C/R0012/Ceiling Structures/Linings/S16	120m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Area inaccessible - Limited access via CR0009 due low clearance (<0.5m).					
Underfloor Voids	AC Fragments/Debris 8392/B00C/Underfloor Voids/S8	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior**

**B00C - R0001 - General Storeroom (4.26 m2)**

No Asbestos

**B00C - R0002 - Main Switchroom (11.95 m2)**

Electrical Mounting Board	Resinous Board	1Unit	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00C - R0003 - General Storeroom (4.82 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8392/B00C/R0003/Ceiling Structures/Linings/S14					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00C - R0004 - Movement (1.4 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8392/B00C/R0004/Ceiling Structures/Linings/S15	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

**B00C - R0005 - General Learning Space (52.56 m2)**

No Asbestos

**B00C - R0006 - General Learning Space (52.93 m2)**

No Asbestos

**B00C - R0007 - General Learning Space (52.64 m2)**

No Asbestos

**B00C - R0008 - General Learning Space (19.42 m2)**

No Asbestos

**B00C - R0009 - General Storeroom (9.32 m2)**

No Asbestos

**B00C - R0010 - Staff Study (38.03 m2)**

No Asbestos

**B00C - R0012 - Movement (23.9 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 8392/B00C/R0012/Ceiling Structures/Linings/S16	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	--------------	--------------------	---------	--

**B00C - R0013 - General Learning Space (52.57 m2)**

No Asbestos

**B00C - R0014 - General Learning Space (52.57 m2)**

No Asbestos

**B00C - R0015 - General Learning Space (52.57 m2)**

No Asbestos

**B00C - R0016 - General Learning Space (52.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00C - R0017 - Movement (1.41 m2)**

Ceiling Structures/Linings Flat AC Sheeting 2m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

8392/B00C/R0004/Ceiling Structures/Linings/S15

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00C - R0018 - Movement (48.01 m2)**

No Asbestos

**B00C - R0019 - General Storeroom (6.93 m2)**

No Asbestos

**B00C - R0020 - Movement (2.46 m2)**

No Asbestos

**B00C - R0021 - Movement (58.12 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1977 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible - Fixed raked ceilings, low angle roof.					
Underfloor Voids	Non Accessible Area					
	- Area inaccessible – crawl space only, clearance ~0.6m.					

**Interior****B00D - R0001 - Student Drinking Facilities (241.42 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0002 - Cleaning Supplies Store (9.4 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0003 - Cleaning Supplies Store (6.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0004 - Cleaning Supplies Store (15.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0005 - General Storeroom (32.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0006 - Toilets-Boys (32.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0007 - Student Canteen (44.36 m2)**

No Asbestos

**B00D - R0008 - Staff - Toilet (4.47 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0009 - General Storeroom (4.51 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00D - R0010 - Toilets-Girls (32.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00D/R0001/Ceiling Structures/Linings/S27					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0011 - General Storeroom (32.06 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00D/R0001/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
<b>B00D - R0012 - Darkroom Space (9.42 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00D/R0001/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00D/R0012/Floor Coverings Res/Textile/S4				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R0013 - Sport Equipment Store (6.83 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00D/R0001/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
<b>B00D - R0014 - General Storeroom (15.21 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8392/B00D/R0001/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Science Learning - 1977 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>
Window In-fill-panel	Flat AC Sheeting	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Window In-fill-panel/S10					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible - slab on ground					

**Interior****B00E - R0001 - Movement (8.79 m2)**

No Asbestos

**B00E - R0002 - Chemical Store (30.72 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8392/B00E/R0004/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>

**B00E - R0003 - Laboratory L.S. (96.78 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8392/B00E/R0004/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>

**B00E - R0004 - Preparation (49.59 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8392/B00E/R0004/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>

**B00E - R0005 - Laboratory L.S. (96.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8392/B00E/R0004/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>

**B00E - R0006 - Movement (57.58 m2)**

No Asbestos

**B00E - R0007 - Movement (17.56 m2)**

No Asbestos

**B00E - R0008 - Distribution Board Cupboard (1.15 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8392/B00E/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------------	--------------------	---------	--------------------

**Assumed Asbestos - Electrical Hazard - labelled 'FORMICA'****B00E - R0009 - Staff - Toilet (3.93 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/R0010/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>

**B00E - R0010 - Staff - Toilet (3.65 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/R0010/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00F - Agricultural Science - 1977 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible - slab on ground					
Ceiling Voids	No Asbestos Found					

**Interior****B00F - R0001 - General Storeroom (7.73 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00F/R0003/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Animal Space (12.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00F/R0003/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

**B00F - R0003 - Machine Storage (38.22 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00F/R0003/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

Infill panels behind roller door	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00F/R0003/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

**B00F - R0004 - Staff Shower (8.42 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00F/R0003/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/R0010/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>

**B00F - R0005 - Movement (29.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00F/R0003/Ceiling Structures/Linings/S19					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Staff Facilities/Senior Learning Unit - 1977 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 8392/B00E/Eaves Linings/S17	80m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Window In-fill-panel	Flat AC Sheeting 8392/B00B/Window In-fill-panel/S10	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground					
Electrical Backing Board	Resinous Board	3Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard - labelled</b>
Ceiling Voids	AC Fragments/Debris 8392/B00G/Ceiling Voids/S9	1Unit	Near access hatch in GR0009.	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior****B00G - R0001 - Staff Study (11.61 m2)**

Ceiling Structures/Linings	Vermiculite 8392/B00G/R0005/Ceiling Structures/Linings/S2	<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>				
----------------------------	--	---	--	--	--	--

**B00G - R0002 - Distribution Board Cupboard (1.09 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 8392/B00E/Eaves Linings/S17	2m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	---	-----	--------------	----------------------------	---------	--

**B00G - R0003 - Careers Advisers Office (11.93 m2)**

Ceiling Structures/Linings	Vermiculite 8392/B00G/R0005/Ceiling Structures/Linings/S2	<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>				
----------------------------	--	---	--	--	--	--

**B00G - R0004 - Staff Study (25.99 m2)**

Ceiling Structures/Linings	Vermiculite 8392/B00G/R0005/Ceiling Structures/Linings/S2	<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>				
----------------------------	--	---	--	--	--	--

**B00G - R0005 - Ancillary Staff (25.23 m2)**

Ceiling Structures/Linings	Vermiculite 8392/B00G/R0005/Ceiling Structures/Linings/S2	<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>				
----------------------------	--	---	--	--	--	--

**B00G - R0006 - Senior Study (25.34 m2)**

Ceiling Structures/Linings	Vermiculite 8392/B00G/R0005/Ceiling Structures/Linings/S2	<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>				
----------------------------	--	---	--	--	--	--

**B00G - R0007 - Senior Study (76.32 m2)**

Ceiling Structures/Linings	Vermiculite 8392/B00G/R0005/Ceiling Structures/Linings/S2	<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>				
----------------------------	--	---	--	--	--	--

**B00G - R0008 - Cleaning Supplies Store (16.62 m2)**

No Asbestos

**B00G - R0009 - Cleaning Store - Distributed (7.94 m2)**

No Asbestos

**B00G - R0010 - Movement (52.99 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00G - R0011 - Toilets-Boys (15.28 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	--------------	--------------------	---------	--------------------

8392/B00G/R0011/Partition Walls (Cubicles)/S20

**Chrysotile (white asbestos)**

**B00G - R0012 - Toilets-Girls (9.23 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	--------------	--------------------	---------	--------------------

8392/B00G/R0011/Partition Walls (Cubicles)/S20

**Chrysotile (white asbestos)**

**B00G - R0013 - Movement (11.05 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1977 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>
Window In-fill-panel	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Window In-fill-panel/S10					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground					
Ceiling Voids	Non Accessible Area - Area inaccessible - shelving located near access hatch in HR0003 and AC plant in ceiling void.					

**Interior****B00H - R0001 - Distribution Board Cupboard (1.12 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8392/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos)</b>
Electrical Mounting Board	Resinous Board	3Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard - labelled</b>					

**B00H - R0002 - Computer Learning Space (51.4 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00H - R0003 - Staff Study (25.2 m2)**

Ceiling cavity access panel	Flat AC Sheeting	0.5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00H/R0003/Ceiling cavity access panel/S21					<b>Chrysotile (white asbestos)</b>

**B00H - R0004 - General Learning Space (51.05 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00H - R0005 - General Learning Space (51.12 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00H - R0006 - General Learning Space (51.84 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00H - R0007 - Movement (140.8 m2)**

No Asbestos

**B00H - R0008 - Movement (11.83 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Music/Technological & Applied Studies - 1977 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00E/Eaves Linings/S17					<b>Chrysotile (white asbestos)</b>
Window In-fill-panel	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00B/Window In-fill-panel/S10					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible - slab on ground and/or no designated access point identified.					
Ceiling Voids	Non Accessible Area					
	- Area inaccessible - fixed ceilings.					

**Interior****B001 - R0001 - Movement (2.25 m2)**

No Asbestos

**B001 - R0002 - Materials Technology L.S. (121.19 m2)**

Ceiling Structures/Linings	Vermiculite					
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B001 - R0003 - Welding Area (10.4 m2)**

Ceiling Structures/Linings	Vermiculite					
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B001 - R0004 - Welding Area (5.47 m2)**

Ceiling Structures/Linings	Vermiculite					
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B001 - R0005 - Computer Learning Space (31.39 m2)**

No Asbestos

**B001 - R0006 - Music Learning Space (73.96 m2)**

Ceiling Structures/Linings	Vermiculite					
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B001 - R0007 - Movement (12.08 m2)**

No Asbestos

**B001 - R0008 - Movement (40.81 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - Technological &amp; Applied Studies - 1977 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00J/Eaves Linings/S23					<b>Chrysotile (white asbestos)</b>
Window In-fill-panel	Compressed AC Sheet	40m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00J/Window In-fill-panel/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - Area inaccessible - due roof support structure and AC plant above JR0004.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - slab on ground and/or no designated access point identified.					
<b>Interior</b>						
<b>B00J - R0001 - Resources Store (18.46 m2)</b>						
Ceiling Space Access Panel	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00H/R0003/Ceiling cavity access panel/S21					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8392/B00J/R0001/Wall Linings Internal/S3					
<b>B00J - R0002 - Darkroom Space (5.69 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8392/B00J/R0001/Wall Linings Internal/S3					
<b>B00J - R0003 - Workshop (64.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00J - R0004 - Workshop (67.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Workbench	Compressed AC Sheet	3m2	West facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8392/B00J/R0004/Workbench/S22					<b>Chrysotile (white asbestos)</b>
<b>B00J - R0005 - Kiln Space (7.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00J - R0006 - Art Learning Space (64.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00J - R0007 - Distribution Board Cupboard (0.85 m2)</b>						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8392/B00J/Eaves Linings/S23					<b>Chrysotile (white asbestos)</b>
Electrical Mounting Board	Resinous Board	3Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Electrical Hazard - labelled</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R0008 - Materials Technology L.S. (95.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8392/B00G/R0005/Ceiling Structures/Linings/S2			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00J - R0009 - Resource/Project Store (27.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8392/B00G/R0005/Ceiling Structures/Linings/S2			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00J - R0010 - Resource/Project Store (12.74 m2)</b>						
No Asbestos						
<b>B00J - R0011 - Movement (69.55 m2)</b>						
No Asbestos						
<b>B00J - R0012 - Movement (60.38 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		8392/B00J/R0012/Ceiling Structures/Linings/S25			No Asbestos Detected
<b>B00J - R0013 - Toilets-Girls (9.74 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet		8392/B00J/R0012/Ceiling Structures/Linings/S25			No Asbestos Detected
<b>B00J - R0014 - Toilets-Boys (21.12 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet		8392/B00J/R0012/Ceiling Structures/Linings/S25			No Asbestos Detected
<b>B00J - R0015 - Outdoor Workshop (79.12 m2)</b>						
No Asbestos						
<b>B00J - R0016 - Covered Outdoor Space (82.5 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00K - Library - 1977 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8392/B00K/Eaves Linings/S26					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible - slab on ground and/or no designated access point identified.					
Ceiling Voids	No Asbestos Found					

**Interior****B00K - R0001 - Staff - Toilet (2.99 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0002 - Distribution Board Cupboard (0.69 m2)**

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Electrical Hazard - labelled 'LEBAH'.</b>

**B00K - R0003 - Cleaning Store - Distributed (1.5 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0004 - Staff - Toilet (3.5 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0005 - Entry (28.99 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0006 - Workroom (12.82 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0007 - Workroom (13.18 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0008 - Audio Visual Workroom (26.24 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0009 - Main Area (161.48 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0010 - Seminar (52.78 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8392/B00G/R0005/Ceiling Structures/Linings/S2					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00K - R0011 - Librarian (5.76 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8392/B00G/R0005/Ceiling Structures/Linings/S2 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00K - R0012 - Duplicating Workroom (19.87 m2)**

Ceiling Structures/Linings Vermiculite  
 8392/B00G/R0005/Ceiling Structures/Linings/S2 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Multi Purpose Facilities - 1987 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00L - R0001 - Sport Equipment Store (20.25 m2)**

No Asbestos

**B00L - R0002 - Staff Study (11.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
		8392/B00L/R0003/Floor Coverings Res/Textile/S7				<b>No Asbestos Detected</b>

**B00L - R0003 - Staff Shower (5.6 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
		8392/B00L/R0003/Floor Coverings Res/Textile/S7				<b>No Asbestos Detected</b>

Partition Walls (Cubicles)	Compressed AC Sheet					
		8392/B00L/R0007/Partition Walls (Cubicles)/S6				<b>No Asbestos Detected</b>

**B00L - R0004 - Staff Kitchen (15.05 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
		8392/B00L/R0003/Floor Coverings Res/Textile/S7				<b>No Asbestos Detected</b>

**B00L - R0005 - Multi-Purpose Space (460.36 m2)**

No Asbestos

**B00L - R0006 - Main Switchroom (2.94 m2)**

No Asbestos

**B00L - R0007 - Toilets-Girls (17.61 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					
		8392/B00L/R0007/Partition Walls (Cubicles)/S6				<b>No Asbestos Detected</b>

**B00L - R0008 - Shower/Change (32.48 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					
		8392/B00L/R0007/Partition Walls (Cubicles)/S6				<b>No Asbestos Detected</b>

**B00L - R0009 - Movement (63.83 m2)**

No Asbestos

**B00L - R0010 - Stage (60.87 m2)**

No Asbestos

**B00L - R0011 - Shower/Change (32.55 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					
		8392/B00L/R0007/Partition Walls (Cubicles)/S6				<b>No Asbestos Detected</b>

**B00L - R0012 - Toilets-Boys (17.63 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					
		8392/B00L/R0007/Partition Walls (Cubicles)/S6				<b>No Asbestos Detected</b>

**B00L - R0013 - Cleaning Store - Distributed (3.15 m2)**

No Asbestos

**B00L - R0014 - Staff - Toilet (4.26 m2)**

No Asbestos

**B00L - R0015 - Chair Store (40.38 m2)**

No Asbestos

**B00L - R0016 - Plant (9.1 m2)**

No Asbestos

**B00L - R0017 - Movement (238.05 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Electrical Services - 1977 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00M - R0001 - General Assistants (31.43 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - General Learning - 2010 - Timber (Timber)**

**Exterior**

No Asbestos

**Interior**

**B00N - R0001 - General Learning Space (53.4 m2)**

No Asbestos

**B00N - R0002 - External Movement (24.92 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017