


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Windsor High School (8396)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 06 - Mar - 2015

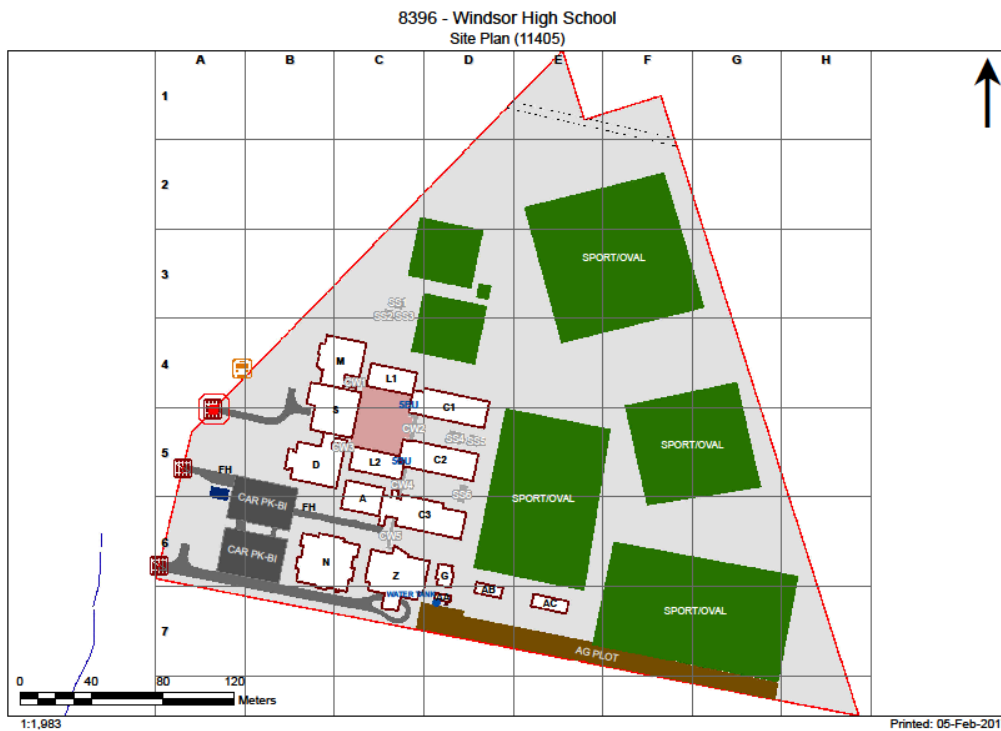

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00A - R0001 - Staff Study (16.24 m2)

No Asbestos

B00A - R0002 - External Movement (1.05 m2)

No Asbestos

B00A - R0003 - Deputy Principal Office (12.87 m2)

No Asbestos

B00A - R0004 - General Storeroom (3.5 m2)

No Asbestos

B00A - R0005 - Duplicating Workroom (13.79 m2)

No Asbestos

B00A - R0006 - General Storeroom (2.99 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00A - R0007 - Staff - Toilet (3.22 m2)

Partition Walls (Cubicles)	Compressed AC Sheet				
8396/B00A/R0015/Partition Walls (Cubicles)/S1					No Asbestos Detected

B00A - R0009 - General Storeroom (12.28 m2)

No Asbestos

B00A - R0010 - General Storeroom (2.56 m2)

No Asbestos

B00A - R0011 - Distribution Board Cupboard (0.75 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0016 - Cleaning Store - Distributed (1.83 m2)

No Asbestos

B00A - R0019 - External Movement (1.09 m2)

No Asbestos

B00A - R0021 - Clinic - Boys (10.23 m2)

No Asbestos

B00A - R0022 - Clinic - Girls (10.17 m2)

No Asbestos

B00A - R0023 - Principal Office (20.3 m2)

No Asbestos

B00A - R0024 - Public Reception (99.05 m2)

No Asbestos

B00A - R0025 - General Storeroom (4.44 m2)

No Asbestos

B00A - R0026 - Principal Office (16.22 m2)

No Asbestos

B00A - R0027 - Toilet - Lobby (1.92 m2)

No Asbestos

B00A - R0028 - Staff - Toilet (8.05 m2)

No Asbestos

B00A - R0029 - Staff - Toilet (4.19 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0030 - Toilet - Lobby (4.04 m2)

No Asbestos

B00A - R0031 - Administration - Clerical (42.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Technological & Applied Studies - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00D - R0001 - Toilets-Girls (65.34 m2)**

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Partition Walls (Cubicles)	Compressed AC Sheet 8396/B00D/R0001/Partition Walls (Cubicles)/S8	No Asbestos Detected
----------------------------	--	----------------------

B00D - R0002 - Food Technology L.S. (82.63 m2)

No Asbestos

B00D - R0010 - Movement (26.89 m2)

No Asbestos

B00D - R0011 - General Storeroom (6.55 m2)

No Asbestos

B00D - R0012 - Commonroom (72.06 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00D - R0013 - General Storeroom (8.69 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles 8396/B0C3/R1005/Floor Coverings Res/Textile/S6	No Asbestos Detected
-----------------------------	---	----------------------

B00D - R0014 - Staff Study (50.97 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00D - R0015 - Shower/Change (4.02 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00D - R0016 - Distribution Board Cupboard (1.35 m2) Note: No inspection of live electrical installation.

No Asbestos

B00D - R0018 - Laundry (3.51 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00D - R0019 - General Assistants (9.6 m2)

No Asbestos

B00D - R0020 - Cleaning Supplies Store (3.14 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00D - R0021 - Movement (69.9 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6				No Asbestos Detected	
B00D - R0024 - Stairs (5.3 m2)						
No Asbestos						
B00D - R0025 - Store (7.09 m2)						
No Asbestos						
B00D - R0026 - Stairs (6.91 m2)						
No Asbestos						
B00D - R0027 - External Movement (48.23 m2)						
No Asbestos						
B00D - R0028 - Preparation (20.43 m2)						
No Asbestos						
B00D - R0029 - Pantry (10.67 m2)						
No Asbestos						
B00D - R0030 - Food Technology L.S. (97.38 m2)						
No Asbestos						
B00D - R0031 - Pantry (15.75 m2)						
No Asbestos						
B00D - R1001 - Design L.S. (65.29 m2)						
No Asbestos						
B00D - R1002 - Secure Storeroom (11.05 m2)						
No Asbestos						
B00D - R1003 - General Storeroom (2.58 m2)						
No Asbestos						
B00D - R1004 - Computer Store (1.72 m2)						
No Asbestos						
B00D - R1005 - Computer Learning Space (65.88 m2)						
No Asbestos						
B00D - R1006 - Music Store (32.13 m2)						
No Asbestos						
B00D - R1007 - Music Learning Space (65.43 m2)						
No Asbestos						
B00D - R1008 - Music Learning Space (65.62 m2)						
No Asbestos						
B00D - R1009 - Movement (5.18 m2)						
No Asbestos						
B00D - R1010 - Resources Store (14.08 m2)						
No Asbestos						
B00D - R1011 - Art Learning Space (65.53 m2)						
No Asbestos						
B00D - R1012 - Art Learning Space (65.36 m2)						
No Asbestos						
B00D - R1013 - Distribution Board Cupboard (1.31 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R1014 - Cleaning Store - Distributed (0.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8396/B00D/R1014/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1015 - Movement (76.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B0L2/R1004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00D - R1016 - Stairs (16.12 m2)						
No Asbestos						
B00D - R1017 - Stairs (14.19 m2)						
No Asbestos						
B00D - R1018 - External Movement (48.23 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Agricultural Science - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Class Tools Storage (23.17 m2)

No Asbestos

B00G - R0002 - Machine Storage (14.64 m2)

No Asbestos

B00G - R0003 - Plant Space (7.41 m2)

No Asbestos

B00G - R0004 - Animal Space (17.32 m2)

No Asbestos

B00G - R0005 - Animal Space (22.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Technological & Applied Studies - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00M - R0001 - Materials Technology L.S. (82.17 m2)**

No Asbestos

B00M - R0002 - Toilets-Boys (67.36 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	------------	--------------------	---------	--------------------

8396/B00S/R1005/Partition Walls (Cubicles)/S11

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00M - R0003 - Cleaning Store - Distributed (1.64 m2)**

No Asbestos

B00M - R0004 - No Access (2.73 m2)

No Asbestos

B00M - R0005 - Movement (37.54 m2)

Ceiling Structures/Linings	Vermiculite
8396/B00S/R0014/Ceiling Structures/Linings/S9	

Limited Samples Taken**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works****B00M - R0010 - Darkroom Space (17.1 m2)**

No Asbestos

B00M - R0011 - Materials Technology L.S. (82.17 m2)

No Asbestos

B00M - R0017 - Dust Extraction Space (18.62 m2)

No Asbestos

B00M - R0018 - Materials Store (13.69 m2)

No Asbestos

B00M - R0019 - Chair Store (12.92 m2)

No Asbestos

B00M - R0020 - Store (9.93 m2)

No Asbestos

B00M - R0021 - Stairs (4.8 m2)

No Asbestos

B00M - R0022 - Metal Technology Bay (85.79 m2)

No Asbestos

B00M - R0023 - Metal Technology Bay (41.41 m2)

No Asbestos

B00M - R0024 - Welding/Hot Metals Area (3.42 m2)

No Asbestos

B00M - R0025 - Welding/Hot Metals Area (3.42 m2)

No Asbestos

B00M - R0026 - Welding/Hot Metals Area (3.42 m2)

No Asbestos

B00M - R0027 - Materials Store (13.67 m2)

No Asbestos

B00M - R0028 - External Movement (33.97 m2)

No Asbestos

B00M - R0029 - Kiln Space (7.06 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00M - R1001 - Art Learning Space (83.09 m2)

Ceiling Structures/Linings Vermiculite
 8396/B00S/R0014/Ceiling Structures/Linings/S9 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles) Compressed AC Sheet
 8396/B00D/R0001/Partition Walls (Cubicles)/S8 **No Asbestos Detected**

B00M - R1002 - General Storeroom (12.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------

8396/B0L2/R1004/Floor Coverings Res/Textile/S7 **Chrysotile (white asbestos)**

B00M - R1003 - Art Learning Space (52.19 m2)

No Asbestos

B00M - R1005 - Distribution Board Cupboard (1.14 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R1010 - Art Learning Space (82.81 m2)

No Asbestos

B00M - R1011 - Resources Store (21.37 m2)

No Asbestos

B00M - R1014 - Movement (67.37 m2)

No Asbestos

B00M - R1015 - Materials Technology L.S. (79.24 m2)

No Asbestos

B00M - R1016 - Resources Store (10.58 m2)

No Asbestos

B00M - R1017 - Stairs (14.97 m2)

No Asbestos

B00M - R1018 - External Movement (37.75 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - Multi Purpose Facilities - 1998 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00N - R0001 - Multi-Purpose Space (518.21 m2)**

No Asbestos

B00N - R0002 - Staff Kitchen (14.18 m2)

No Asbestos

B00N - R0003 - Sport Equipment Store (19.86 m2)

No Asbestos

B00N - R0004 - Toilets-Girls (19.77 m2)

No Asbestos

B00N - R0005 - Movement (5.04 m2)

No Asbestos

B00N - R0006 - Lift (1.2 m2)

No Asbestos

B00N - R0007 - Stage (73.37 m2)

No Asbestos

B00N - R0008 - Movement (21.83 m2)

No Asbestos

B00N - R0009 - Toilets-Boys (18.2 m2)

No Asbestos

B00N - R0010 - Chair Store (30.1 m2)

No Asbestos

B00N - R0011 - Toilets-Disabled (4.26 m2)

No Asbestos

B00N - R0012 - Distribution Board Cupboard (0.67 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0013 - External Movement (22.72 m2)

No Asbestos

B00N - R0014 - External Movement (12 m2)

No Asbestos

B00N - R0015 - External Movement (12 m2)

No Asbestos

B00N - R0016 - External Movement (7.8 m2)

No Asbestos

B00N - R0017 - External Movement (12 m2)

No Asbestos

B00N - R0018 - External Movement (12 m2)

No Asbestos

B00N - R0019 - Stairs (0.61 m2)

No Asbestos

B00N - R0020 - Stairs (0.61 m2)

No Asbestos

B00N - R0021 - External Movement (1.7 m2)

No Asbestos

B00N - R1001 - Shower/Change (47.02 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00N - R1002 - Control Room (6.17 m2)

No Asbestos

B00N - R1003 - Movement (2.47 m2)

No Asbestos

B00N - R1004 - Movement (2.47 m2)

No Asbestos

B00N - R1005 - Cleaning Store - Distributed (6.93 m2)

No Asbestos

B00N - R1006 - Shower/Change (46.73 m2)

No Asbestos

B00N - R1007 - Stairs (3.08 m2)

No Asbestos

B00N - R1008 - Stairs (2.64 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Physical Education/Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior**B00S - R0001 - Gymnasium (309.52 m2)**

No Asbestos

B00S - R0002 - Cleaning Store - Distributed (16 m2)

No Asbestos

B00S - R0003 - Main Switchroom (9.85 m2)

No Asbestos

B00S - R0004 - General Storeroom (18.04 m2)

No Asbestos

B00S - R0005 - General Storeroom (6.5 m2)

No Asbestos

B00S - R0006 - Student Canteen (51.44 m2)

No Asbestos

B00S - R0007 - Staff - Toilet (3.2 m2)

No Asbestos

B00S - R0008 - Cleaning Store - Distributed (6.22 m2)

No Asbestos

B00S - R0009 - Staff - Toilet (3.48 m2)

No Asbestos

B00S - R0010 - Sport Equipment Store (19.19 m2)

No Asbestos

B00S - R0011 - Cleaning Store - Distributed (0.95 m2)

No Asbestos

B00S - R0012 - Sport Equipment Store (16.93 m2)

No Asbestos

B00S - R0013 - Distribution Board Cupboard (0.74 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00S - R0014 - Movement (79.35 m2)

Ceiling Structures/Linings	Vermiculite	8396/B00S/R0014/Ceiling Structures/Linings/S9
----------------------------	-------------	---

Limited Samples Taken**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works****B00S - R0015 - External Movement (59.89 m2)**

No Asbestos

B00S - R1001 - Movement (64.78 m2)

No Asbestos

B00S - R1002 - Cleaning Store - Distributed (3.38 m2)

No Asbestos

B00S - R1003 - Staff Change (10.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
		8396/B00S/R1003/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
		8396/B0L2/R1004/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)

B00S - R1004 - Staff - Toilet (7.55 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00S - R1005 - Toilets-Girls (15.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1005/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00S - R1006 - Shower/Change (46.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00S - R1007 - Shower/Change (46.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00S - R1008 - Toilets-Boys (15.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1005/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00S - R1009 - Staff - Toilet (7.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00S - R1010 - Staff Change (10.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B0L2/R1004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00S - R1011 - Cleaning Store - Distributed (3.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B00S/R1003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Z - Support Unit - 2000 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00Z - R0001 - Covered Vehicle Area/Porte Cochere (103.7 m2)**

No Asbestos

B00Z - R0002 - Movement (19.46 m2)

No Asbestos

B00Z - R0003 - Toilets-Disabled (38 m2)

No Asbestos

B00Z - R0004 - Student Laundry - Type 3 (12.31 m2)

No Asbestos

B00Z - R0005 - Toilets-Disabled (37.91 m2)

No Asbestos

B00Z - R0006 - Practical Activity Area (120.8 m2)

No Asbestos

B00Z - R0007 - Practical Activity Area (36.34 m2)

No Asbestos

B00Z - R0008 - General Learning Space - S/P (64.21 m2)

No Asbestos

B00Z - R0009 - Home Base Store - S (7.63 m2)

No Asbestos

B00Z - R0010 - Seminar - Type 3 (8.38 m2)

No Asbestos

B00Z - R0011 - General Learning Space - S/P (63.64 m2)

No Asbestos

B00Z - R0012 - Seminar - Type 3 (8.42 m2)

No Asbestos

B00Z - R0013 - Home Base Store - S (7.74 m2)

No Asbestos

B00Z - R0014 - General Learning Space - S/P (60.1 m2)

No Asbestos

B00Z - R0015 - Seminar - Type 3 (9.44 m2)

No Asbestos

B00Z - R0016 - Home Base Store - S (7.31 m2)

No Asbestos

B00Z - R0017 - Security Store (18.05 m2)

No Asbestos

B00Z - R0018 - Toilets-Disabled (5.98 m2)

No Asbestos

B00Z - R0019 - Cleaning Store - Distributed (1.87 m2)

No Asbestos

B00Z - R0020 - Commonroom (25.48 m2)

No Asbestos

B00Z - R0021 - Distribution Board Cupboard (0.72 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00Z - R0022 - Movement (15.23 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00Z - R0023 - Distribution Board Cupboard (0.72 m2) Note: No inspection of live electrical installation.

No Asbestos

B00Z - R0024 - Covered Area (13.28 m2)

No Asbestos

B00Z - R0025 - Covered Area (14.25 m2)

No Asbestos

B00Z - R0026 - Covered Area (71.2 m2)

No Asbestos

B00Z - R0027 - External Movement (2.67 m2)

No Asbestos

B00Z - R0028 - External Movement (1.65 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0AA - Agricultural Science - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B0AA - R0001 - Machine Storage (30.27 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0AB - Agricultural Science - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B0AB - R0001 - General Learning Space (54.6 m2)

No Asbestos

B0AB - R0002 - Agriculture Covered Area (35.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0AC - Building Services/Physical Education - 2010 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0AC - R0001 - General Assistants (109.65 m2)

No Asbestos

B0AC - R0002 - Sport Equipment Store (26.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - General Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0C1 - R0001 - General Learning Space (53.51 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0002 - General Learning Space (53.29 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0003 - Staff Study (25.99 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles 8396/B0C3/R0015/Floor Coverings Res/Textile/S5	No Asbestos Detected
-----------------------------	---	----------------------

B0C1 - R0004 - Computer Learning Space (52.93 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0005 - Performance Workspace (107.02 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles 8396/B0C3/R0015/Floor Coverings Res/Textile/S5	No Asbestos Detected
-----------------------------	---	----------------------

B0C1 - R0006 - General Storeroom (4.87 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0007 - Staff - Toilet (5.1 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0008 - Staff - Toilet (6.87 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0009 - Sport Equipment Store (31.8 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0010 - Leading Teacher (11.02 m2)

Ceiling Structures/Linings	Vermiculite 8396/B0C3/R0010/Ceiling Structures/Linings/S3	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B0C1 - R0011 - Distribution Board Cupboard (0.92 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Electrical Backing Board	Resinous Board	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B0C1/R0011/Electrical Backing Board/S14				Chrysotile (white asbestos)		

B0C1 - R0012 - Cleaning Store - Distributed (2.74 m2)

No Asbestos

B0C1 - R0013 - Gymnasium (49.39 m2)

Ceiling Structures/Linings Vermiculite
 8396/B0C3/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8396/B0C3/R0015/Floor Coverings Res/Textile/S5 **No Asbestos Detected**

B0C1 - R0014 - Sport Equipment Store (8.75 m2)

Ceiling Structures/Linings Vermiculite
 8396/B0C3/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8396/B0C3/R0015/Floor Coverings Res/Textile/S5 **No Asbestos Detected**

B0C1 - R0015 - General Storeroom (5.05 m2)

Floor Coverings Res/Textile Vinyl Tiles
 8396/B0C3/R0015/Floor Coverings Res/Textile/S5 **No Asbestos Detected**

B0C1 - R0016 - Movement (84.24 m2)

Ceiling Structures/Linings Vermiculite
 8396/B0C3/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8396/B0C3/R0015/Floor Coverings Res/Textile/S5 **No Asbestos Detected**

B0C1 - R0017 - Computer Resource (12.15 m2)

Ceiling Structures/Linings Vermiculite
 8396/B0C3/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B0C1 - R0018 - Movement (2.55 m2)

Ceiling Structures/Linings Vermiculite
 8396/B0C3/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 8396/B0C3/R0015/Floor Coverings Res/Textile/S5 **No Asbestos Detected**

B0C1 - R0019 - Stairs (5.39 m2)

No Asbestos

B0C1 - R0020 - Store (12.97 m2)

No Asbestos

B0C1 - R0021 - External Movement (50.34 m2)

No Asbestos

B0C1 - R0022 - Stairs (5.08 m2)

No Asbestos

B0C1 - R1001 - General Learning Space (53.73 m2)

No Asbestos

B0C1 - R1002 - General Learning Space (53.73 m2)

No Asbestos

B0C1 - R1003 - Clinic - Boys (19.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B0C1 - R1004 - General Learning Space (53.28 m2)						
No Asbestos						
B0C1 - R1005 - General Learning Space (53.29 m2)						
No Asbestos						
B0C1 - R1006 - General Storeroom (19.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B0C1 - R1007 - General Learning Space (53.43 m2)						
No Asbestos						
B0C1 - R1008 - Movement (25.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B0C1 - R1009 - Movement (1.44 m2)						
No Asbestos						
B0C1 - R1010 - Staff Study (39.46 m2)						
No Asbestos						
B0C1 - R1011 - Interview/Office - Type 1 (10.95 m2)						
No Asbestos						
B0C1 - R1012 - Cleaning Store - Distributed (4.06 m2)						
No Asbestos						
B0C1 - R1013 - Distribution Board Cupboard (1.02 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B0C1 - R1014 - General Learning Space (53.28 m2)						
No Asbestos						
B0C1 - R1015 - General Learning Space (53.29 m2)						
No Asbestos						
B0C1 - R1016 - Movement (17.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B0C1 - R1017 - Stairs (14.32 m2)						
No Asbestos						
B0C1 - R1018 - Stairs (18.53 m2)						
No Asbestos						
B0C1 - R1019 - External Movement (46.38 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C2 - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B0C2 - R0001 - General Learning Space (52.7 m2)**

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected

B0C2 - R0002 - General Learning Space (52.7 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected

B0C2 - R0003 - Secure Storeroom (12 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8396/B0C2/R0003/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)

B0C2 - R0004 - Senior Study (51.04 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0005 - Cleaning Store - Distributed (2.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected

B0C2 - R0006 - Leading Teacher (10.98 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0007 - Distribution Board Cupboard (0.91 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8396/B0C2/R0007/Electrical Backing Board/S15					Chrysotile (white asbestos)

B0C2 - R0008 - Commonroom (31.8 m2)

No Asbestos

B0C2 - R0009 - Staff - Toilet (6.82 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected

B0C2 - R0010 - Staff - Toilet (5.1 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0C2 - R0011 - General Storeroom (4.87 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected
B0C2 - R0012 - General Learning Space (53.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected
B0C2 - R0013 - General Learning Space (52.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C2 - R0014 - General Storeroom (39.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C2 - R0015 - General Learning Space (46.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C2 - R0016 - General Storeroom (5.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C2 - R0017 - Movement (85.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected
B0C2 - R0018 - Movement (2.51 m2)						
No Asbestos						
B0C2 - R0019 - Stairs (5.29 m2)						
No Asbestos						
B0C2 - R0020 - Store (13.32 m2)						
No Asbestos						
B0C2 - R0021 - Stairs (5.01 m2)						
No Asbestos						
B0C2 - R0022 - External Movement (50.31 m2)						
No Asbestos						
B0C2 - R1001 - General Learning Space (53.87 m2)						
No Asbestos						
B0C2 - R1002 - General Learning Space (53.87 m2)						
No Asbestos						
B0C2 - R1003 - Movement (16.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R0015/Floor Coverings Res/Textile/S5					No Asbestos Detected
B0C2 - R1004 - General Learning Space (53.58 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0C2 - R1005 - Performance Workspace (53.13 m2)						
No Asbestos						
B0C2 - R1006 - Distribution Board Cupboard (1.02 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B0C2 - R1007 - Cleaning Store - Distributed (4.06 m2)						
No Asbestos						
B0C2 - R1008 - Performing Arts Store (10.98 m2)						
No Asbestos						
B0C2 - R1009 - Staff Study (39.53 m2)						
No Asbestos						
B0C2 - R1010 - Movement (27.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		8396/B0C3/R0015/Floor Coverings Res/Textile/S5				No Asbestos Detected
B0C2 - R1011 - General Learning Space (53.58 m2)						
No Asbestos						
B0C2 - R1012 - General Storeroom (19.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		8396/B0C3/R0015/Floor Coverings Res/Textile/S5				No Asbestos Detected
B0C2 - R1013 - General Learning Space (53.14 m2)						
No Asbestos						
B0C2 - R1014 - General Learning Space (53.57 m2)						
No Asbestos						
B0C2 - R1015 - Staff Study (18.86 m2)						
No Asbestos						
B0C2 - R1016 - Movement (1.51 m2)						
No Asbestos						
B0C2 - R1017 - Stairs (14.45 m2)						
No Asbestos						
B0C2 - R1018 - Stairs (18.76 m2)						
No Asbestos						
B0C2 - R1019 - External Movement (49.8 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0C3 - Library/General Learning - 1969 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B0C3 - R0001 - Administration - Clerical (54.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0002 - Seminar (26.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0003 - Workroom (26.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0004 - Main Area (311.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0005 - Workroom (5.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0006 - Cleaning Store - Distributed (0.6 m2)						
No Asbestos						
B0C3 - R0007 - Distribution Board Cupboard (0.7 m2)						
No Asbestos						
Note: No inspection of live electrical installation.						
B0C3 - R0008 - Audio Visual Workroom (20.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0009 - General Storeroom (1.25 m2)						
No Asbestos						
B0C3 - R0010 - Staff - Toilet (13.71 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8396/B0C3/R0010/Partition Walls (Cubicles)/S4					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0011 - General Storeroom (4.02 m2)						
No Asbestos						
B0C3 - R0012 - Cleaning Store - Distributed (1.24 m2)						
No Asbestos						
B0C3 - R0013 - Staff - Toilet (11.81 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8396/B0C3/R0010/Partition Walls (Cubicles)/S4					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0014 - Resources (20.16 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8396/B0C3/R0010/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0015 - Movement (30.96 m2)						
Ceiling Structures/Linings	Vermiculite	8396/B0C3/R0010/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8396/B0C3/R0015/Floor Coverings Res/Textile/S5				No Asbestos Detected
B0C3 - R0016 - General Storeroom (2.21 m2)						
Ceiling Structures/Linings	Vermiculite	8396/B0C3/R0010/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0017 - Stairs (2.64 m2)						
Ceiling Structures/Linings	Vermiculite	8396/B0C3/R0010/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B0C3 - R0019 - Movement (23.68 m2)						
No Asbestos						
B0C3 - R0020 - Lift (1.54 m2)						
No Asbestos						
B0C3 - R0021 - Store (13.5 m2)						
No Asbestos						
B0C3 - R0022 - Stairs (5 m2)						
No Asbestos						
B0C3 - R0023 - External Movement (85.4 m2)						
No Asbestos						
B0C3 - R0024 - External Movement (60.94 m2)						
No Asbestos						
B0C3 - R1001 - General Learning Space (54.53 m2)						
No Asbestos						
B0C3 - R1002 - General Learning Space (53.58 m2)						
No Asbestos						
B0C3 - R1003 - Resources Space (18.2 m2)						
No Asbestos						
B0C3 - R1004 - General Storeroom (3.22 m2)						
No Asbestos						
B0C3 - R1005 - General Storeroom (6.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8396/B0C3/R1005/Floor Coverings Res/Textile/S6				No Asbestos Detected
B0C3 - R1006 - General Learning Space (58.99 m2)						
No Asbestos						
B0C3 - R1007 - General Learning Space (59.65 m2)						
No Asbestos						
B0C3 - R1008 - General Learning Space (53.29 m2)						
No Asbestos						
B0C3 - R1009 - Movement (20.4 m2)						
No Asbestos						
B0C3 - R1010 - Staff Study (40.04 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B0C3 - R1011 - Staff Study (18.48 m2)

No Asbestos

B0C3 - R1012 - Distribution Board Cupboard (0.9 m2) Note: No inspection of live electrical installation.

No Asbestos

B0C3 - R1013 - General Learning Space (53.87 m2)

No Asbestos

B0C3 - R1014 - General Learning Space (53.79 m2)

No Asbestos

B0C3 - R1015 - Movement (20.44 m2)

No Asbestos

B0C3 - R1016 - General Storeroom (9.6 m2)

No Asbestos

B0C3 - R1017 - General Storeroom (3.62 m2)

No Asbestos

B0C3 - R1018 - Stairs (15.2 m2)

No Asbestos

B0C3 - R1019 - Lift (1.54 m2)

No Asbestos

B0C3 - R1020 - Movement (33.52 m2)

No Asbestos

B0C3 - R1021 - Stairs (20 m2)

No Asbestos

B0C3 - R1022 - External Movement (36.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0L1 - Science Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B0L1 - R0001 - Laboratory L.S. (91.31 m2)**

Ceiling Structures/Linings	Vermiculite						Limited Samples Taken
	8396/B0C3/R0010/Ceiling Structures/Linings/S3						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Workbench	Compressed AC Sheet	1m2	North side 3rd bench in	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8396/B0L1/R0001/Workbench/S12						Chrysotile (white asbestos)

B0L1 - R0002 - Staff Study (13.13 m2)

Ceiling Structures/Linings	Vermiculite						Limited Samples Taken
	8396/B0C3/R0010/Ceiling Structures/Linings/S3						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B0L1 - R0003 - Apparatus Store (4.28 m2)

Ceiling Structures/Linings	Vermiculite						Limited Samples Taken
	8396/B0C3/R0010/Ceiling Structures/Linings/S3						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8396/B0L2/R1004/Floor Coverings Res/Textile/S7						Chrysotile (white asbestos)

B0L1 - R0004 - Preparation (29.86 m2)

Ceiling Structures/Linings	Vermiculite						Limited Samples Taken
	8396/B0C3/R0010/Ceiling Structures/Linings/S3						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8396/B0L2/R1004/Floor Coverings Res/Textile/S7						Chrysotile (white asbestos)

B0L1 - R0005 - Lift (0.26 m2)

No Asbestos

B0L1 - R0006 - Materials Technology L.S. (91.3 m2)

Ceiling Structures/Linings	Vermiculite						Limited Samples Taken
	8396/B0C3/R0010/Ceiling Structures/Linings/S3						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Workbench	Compressed AC Sheet	1m2	North side 3rd bench in	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8396/B0L1/R0001/Workbench/S12						Chrysotile (white asbestos)

B0L1 - R0007 - Distribution Board Cupboard (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B0L1 - R0008 - Cleaning Store - Distributed (0.79 m2)

No Asbestos

B0L1 - R0009 - External Movement (70.68 m2)

No Asbestos

B0L1 - R1001 - Staff Study (91.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles						No Asbestos Detected
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6						

B0L1 - R1002 - Resources (13.13 m2)

No Asbestos

B0L1 - R1003 - Apparatus Store (4.28 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6					No Asbestos Detected
B0L1 - R1004 - Preparation (29.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6					No Asbestos Detected
B0L1 - R1005 - Lift (0.26 m2)						
No Asbestos						
B0L1 - R1006 - Laboratory L.S. (91.31 m2)						
No Asbestos						
B0L1 - R1007 - Distribution Board Cupboard (0.82 m2)						Note: No inspection of live electrical installation.
No Asbestos						
B0L1 - R1008 - Main Switchroom (0.82 m2)						
Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8396/B0L1/R1008/Electrical Backing Board/S16					Chrysotile (white asbestos)
B0L1 - R1009 - External Movement (65.98 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0L2 - Science Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B0L2 - M1001 - Movement (8.35 m2)**

No Asbestos

B0L2 - R0001 - Chair Store (11.88 m2)

No Asbestos

B0L2 - R0002 - Movement (5.7 m2)

No Asbestos

B0L2 - R0003 - General Storeroom (8.01 m2)

No Asbestos

B0L2 - R0004 - Laboratory L.S. (91.29 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0L2 - R0005 - Apparatus Store (13 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6					No Asbestos Detected

B0L2 - R0006 - Apparatus Store (5.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6					No Asbestos Detected

B0L2 - R0007 - Preparation (28.04 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles					
	8396/B0C3/R1005/Floor Coverings Res/Textile/S6					No Asbestos Detected

B0L2 - R0008 - Lift (0.26 m2)

No Asbestos

B0L2 - R0009 - Laboratory L.S. (91.31 m2)

Ceiling Structures/Linings	Vermiculite					
	8396/B0C3/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B0L2 - R0010 - Distribution Board Cupboard (0.79 m2) Note: No inspection of live electrical installation.

No Asbestos

B0L2 - R0011 - Cleaning Store - Distributed (0.79 m2)

No Asbestos

B0L2 - R0012 - External Movement (70.58 m2)

No Asbestos

B0L2 - R0013 - Stairs (2.78 m2)

No Asbestos

B0L2 - R1001 - Plant Space (8.38 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0L2 - R1002 - Animal Space (8 m2)						
No Asbestos						
B0L2 - R1003 - Laboratory L.S. (91.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B0L2/R1004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B0L2 - R1004 - Apparatus Store (12.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B0L2/R1004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B0L2 - R1005 - Apparatus Store (3.06 m2)						
No Asbestos						
B0L2 - R1006 - Preparation (31.37 m2)						
No Asbestos						
B0L2 - R1007 - Lift (0.26 m2)						
Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8396/B0L2/R1007/Electrical Backing Board/S17					Chrysotile (white asbestos)	
B0L2 - R1008 - Laboratory L.S. (91.3 m2)						
No Asbestos						
B0L2 - R1009 - Distribution Board Cupboard (0.79 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B0L2 - R1010 - Main Switchroom (0.79 m2)						
No Asbestos						
B0L2 - R1011 - External Movement (65.9 m2)						
No Asbestos						
B0L2 - R1012 - Movement (2.58 m2)						
No Asbestos						
B0L2 - R1013 - Stairs (2.78 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017