


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Woonona High School (8410)  
**Region :** Illawarra and South East  
**State Electorate :** Keira  
**Local Government Area :** Wollongong

**Initial Survey :** Noel Arnold & Associates : 22 - Apr - 2008  
**Reviewed By :** Greencap-NAA : 26 - Aug - 2014

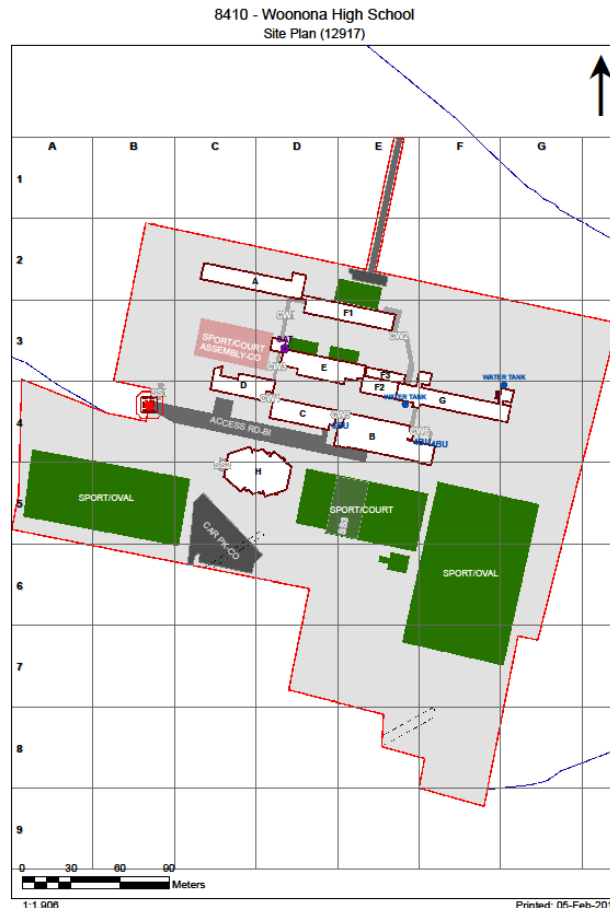

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Technological & Applied Studies - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00A - R0001 - Chemical Store (9.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting 8410/B00A/R0031/Wall Linings Internal/S31					
<b>No Asbestos Detected</b>						

**B00A - R0002 - Toilets-Boys (10.39 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0002/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00A - R0003 - Staff - Toilet (3.84 m2)**

No Asbestos

**B00A - R0004 - Cleaning Store - Distributed (4.05 m2)**

No Asbestos

**B00A - R0005 - Main Area (4.9 m2)**

Electrical Backing Board	Resinous Board 8410/B00G/R1002/Electrical Backing Board/S30					
<b>No Asbestos Detected</b>						

**B00A - R0007 - Staff Study (24.2 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite 8410/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Limited Samples Taken</b>						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0008 - Laboratory L.S. (86.12 m2)**

Ceiling Structures/Linings	Vermiculite 8410/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Limited Samples Taken</b>						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0009 - General Storeroom (9.57 m2)**

Ceiling Structures/Linings	Vermiculite 8410/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Limited Samples Taken</b>						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0010 - Preparation (27.76 m2)**

Ceiling Structures/Linings	Vermiculite 8410/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Limited Samples Taken</b>						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0011 - Laboratory L.S. (86.41 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8410/B00A/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0012 - Darkroom Space (23.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00A/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	23.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00A - R0016 - Laundry (11.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00A/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0018 - Distribution Board Cupboard (1.65 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	8410/B00A/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0020 - L.P.G. Store (0.69 m2)</b>						
No Asbestos						
<b>B00A - R0021 - External Movement (107.5 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Stairs (3.87 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Laboratory L.S. (87.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00A/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0026 - Movement (8.65 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Stairs (3.51 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Store (3.93 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Store (13.38 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Store (11.25 m2)</b>						
No Asbestos						
<b>B00A - R0031 - Movement (45.95 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	8410/B00A/R0031/Wall Linings Internal/S31					No Asbestos Detected
<b>B00A - R1001 - General Storeroom (10.01 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Toilets-Girls (11.08 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Staff - Toilet (3.9 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Cleaning Store - Distributed (4.09 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Apparatus Store (4.9 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1007 - Staff Study (24.2 m2)</b>						
No Asbestos						
<b>B00A - R1008 - General Storeroom (6.5 m2)</b>						
No Asbestos						
<b>B00A - R1009 - General Storeroom (6.37 m2)</b>						
No Asbestos						
<b>B00A - R1010 - General Storeroom (25.37 m2)</b>						
No Asbestos						
<b>B00A - R1011 - General Learning Space (52.63 m2)</b>						
No Asbestos						
<b>B00A - R1012 - General Learning Space (52.63 m2)</b>						
No Asbestos						
<b>B00A - R1013 - General Storeroom (5.68 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5.67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1014 - General Storeroom (6.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1015 - General Learning Space (52.64 m2)</b>						
No Asbestos						
<b>B00A - R1016 - General Learning Space (52.64 m2)</b>						
No Asbestos						
<b>B00A - R1017 - General Storeroom (3.64 m2)</b>						
No Asbestos						
<b>B00A - R1019 - General Learning Space (65.57 m2)</b>						
No Asbestos						
<b>B00A - R1020 - Cleaning Store - Distributed (4.86 m2)</b>						
No Asbestos						
<b>B00A - R1021 - External Movement (130.69 m2)</b>						
No Asbestos						
<b>B00A - R1022 - Distribution Board Cupboard (0.79 m2)</b>						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	0.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00C/R1012/Ceiling Structures/Linings/S26					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1023 - Stairs (5.29 m2)</b>						
No Asbestos						
<b>B00A - R1024 - Stairs (6.88 m2)</b>						
No Asbestos						
<b>B00A - R1025 - Movement (43.13 m2)</b>						
No Asbestos						
<b>B00A - R1026 - Performance Store (21.73 m2)</b>						
No Asbestos						
<b>B00A - R1027 - General Storeroom (4.09 m2)</b>						
No Asbestos						
<b>B00A - R1028 - General Storeroom (4.41 m2)</b>						
No Asbestos						
<b>B00A - R9001 - Chemical Store (12.85 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - R9002 - Movement (11.88 m2)**

No Asbestos

**B00A - R9003 - Stairs (3.41 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	55m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					

**Interior**

**B00B - R0002 - Cleaning Store - Distributed (7.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Shower/Change (45.64 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	45.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - FCS encapsulated by metal cladding</b>						

**B00B - R0005 - General Storeroom (3.24 m2)**

No Asbestos

**B00B - R0006 - Garden Store Room (30.95 m2)**

No Asbestos

**B00B - R0007 - Student Canteen (43.25 m2)**

In-fill-panel	Flat AC Sheeting	50m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0007/In-fill-panel/S19					<b>Chrysotile (white asbestos)</b>	

**B00B - R0008 - Staff Change (3.06 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0009 - Staff - Toilet (1.67 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0010 - Office/Store (4.5 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0012 - Cleaning Store - Distributed (3.35 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0013 - Sport Equipment Store (23.1 m2)**

No Asbestos

**B00B - R0014 - Toilets-Girls (85.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)	
<b>B00B - R0015 - Sport Equipment Store (7.89 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
<b>B00B - R0016 - Shower/Change (45.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	45.38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	45.38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)	
<b>B00B - R0017 - Movement (303.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	303.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0017/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
<b>B00B - R0018 - General Storeroom (6.6 m2)</b>						
No Asbestos						
<b>B00B - R0019 - General Storeroom (3.84 m2)</b>						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - 1 sealed unit						
<b>B00B - R0020 - General Storeroom (3.85 m2)</b>						
No Asbestos						
<b>B00B - R0021 - General Storeroom (6.55 m2)</b>						
No Asbestos						
<b>B00B - R0022 - General Storeroom (8.9 m2)</b>						
No Asbestos						
<b>B00B - R0023 - Sport Equipment Store (17.64 m2)</b>						
No Asbestos						
<b>B00B - R0024 - External Movement (1.14 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
<b>B00B - R0025 - Movement (1.14 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
<b>B00B - R0026 - External Movement (175.5 m2)</b>						
No Asbestos						
<b>B00B - R0027 - Movement (5.74 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
<b>B00B - R0028 - Movement (32.24 m2)</b>						
No Asbestos						
<b>B00B - R0029 - Movement (33.1 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
<b>B00B - R0030 - Movement (5.63 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0031 - Toilets-Boys (59.86 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0031/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
8410/B00B/R0032/Wall Linings Internal/S2					<b>No Asbestos Detected</b>	
<b>B00B - R0032 - No Access (23.44 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
8410/B00B/R0032/Wall Linings Internal/S2					<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00B/R0031/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Technological & Applied Studies/Art - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					

**Interior**

**B00C - R0001 - Movement (17.75 m2)**

Stored Flat ACS	Flat AC Sheeting	8410/B00C/R0001/Stored Flat ACS/S23				No Asbestos Detected
-----------------	------------------	-------------------------------------	--	--	--	----------------------

**B00C - R0002 - Cleaning Store - Distributed (2.1 m2)**

No Asbestos

**B00C - R0003 - Materials Store (6.12 m2)**

No Asbestos

**B00C - R0004 - Materials Store (18.6 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00C/R0008/Ceiling Structures/Linings/S16				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0005 - Materials Technology L.S. (79.66 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00C/R0008/Ceiling Structures/Linings/S16				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0006 - Distribution Board Cupboard (0.38 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0007 - Materials Store (18.15 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00C/R0008/Ceiling Structures/Linings/S16				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0008 - Materials Technology L.S. (81.46 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00C/R0008/Ceiling Structures/Linings/S16				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Wall Linings Internal	Flat AC Sheeting	8410/B00C/R0012/Wall Linings Internal/S22				No Asbestos Detected
-----------------------	------------------	---	--	--	--	----------------------

**B00C - R0009 - Movement (13.35 m2)**

No Asbestos

**B00C - R0010 - Materials Store (7.61 m2)**

No Asbestos

**B00C - R0011 - Staff - Toilet (4.29 m2)**

No Asbestos

**B00C - R0012 - Welding Area (11.19 m2)**

Wall Linings Internal	Flat AC Sheeting	8410/B00C/R0012/Wall Linings Internal/S22				No Asbestos Detected
-----------------------	------------------	---	--	--	--	----------------------

**B00C - R0013 - L.P.G. Store (0.8 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00C - R0014 - External Movement (67.06 m2)</b>						
No Asbestos						
<b>B00C - R0015 - Kiln Space (18.09 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Stairs (6.73 m2)</b>						
No Asbestos						
<b>B00C - R0017 - Stairs (4.74 m2)</b>						
No Asbestos						
<b>B00C - R0018 - External Movement (96.52 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Movement (19.74 m2)</b>						
No Asbestos						
<b>B00C - R1002 - Resources Store (5.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	5.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1003 - Art Learning Space (52.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	52.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1004 - Art Learning Space (52.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	52.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1005 - Art Learning Space (52.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	52.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1006 - Distribution Board Cupboard (0.64 m2)</b>						
Electrical cover board	Resinous Board 8410/B00C/R1006/Electrical cover board/S25				Note: No inspection of live electrical installation. <b>No Asbestos Detected</b>	
<b>B00C - R1007 - Resources Store (6.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	6.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1008 - Kiln Space (19.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	19.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1009 - Staff Study (25.55 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00C/R1003/Floor Coverings Res/Textile/S24	25.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1010 - Movement (21.04 m2)</b>						
No Asbestos						
<b>B00C - R1011 - Cleaning Store - Distributed (1.39 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8410/B00C/R1012/Ceiling Structures/Linings/S26	1.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1012 - Staff - Toilet (3.53 m2)</b>						
Incinerette	Encapsulated Insulation material within unit <b>Assumed Asbestos - 1 sealed unit</b>	1Unit(s)	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00C/R1012/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	

**B00C - R1013 - External Movement (67.68 m2)**

No Asbestos

**B00C - R1014 - Stairs (5.95 m2)**

No Asbestos

**B00C - R1015 - Stairs (6.16 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos - Height Restriction**

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00D - R0001 - Staff Study (18.09 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	

**B00D - R0002 - Staff - Toilet (5.43 m2)**

No Asbestos

**B00D - R0003 - Staff Change (3.08 m2)**

No Asbestos

**B00D - R0004 - Staff - Toilet (5.45 m2)**

No Asbestos

**B00D - R0005 - Distribution Board Cupboard (0.82 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0006 - Staff Change (2 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	

**B00D - R0007 - Principal Office (18.2 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00D/R0022/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>	

**B00D - R0008 - Staff - Toilet (5.49 m2)**

No Asbestos

**B00D - R0009 - Cleaning Store - Distributed (3.09 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	

**B00D - R0010 - General Storeroom (8.84 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	

**B00D - R0011 - Deputy Principal Office (18.1 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00D/R0022/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>	

**B00D - R0015 - Duplicating Workroom (22.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00D/R0022/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>	

**B00D - R0016 - Administration - Clerical (13.48 m2)**

No Asbestos

**B00D - R0017 - Interview/Office - Type 1 (13.76 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0019 - Staff - Toilet (2.97 m2)</b>						
No Asbestos						
<b>B00D - R0020 - Staff - Toilet (2.95 m2)</b>						
No Asbestos						
<b>B00D - R0021 - Movement (35.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8410/B00D/R0022/Floor Coverings Res/Textile/S21	35.52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R0028 - External Movement (30.63 m2)</b>						
No Asbestos						
<b>B00D - R0029 - Public Entry (21.1 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0030 - Interview/Meeting (10.74 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0031 - Administration - Clerical (39.16 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0032 - Student Reception (12.18 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0033 - Interview/Meeting (8.95 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0034 - Deputy Principal Office (18 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0035 - Interview/Meeting (13.2 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00D - R0036 - External Movement (61.79 m2)</b>						
Recently Modified Space Requires Inspection						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Technological & Applied Studies/Library - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

**Interior**

**B00E - R0001 - Movement (17.78 m2)**

No Asbestos

**B00E - R0002 - Cleaning Store - Distributed (6.02 m2)**

No Asbestos

**B00E - R0003 - Cleaning Store - Distributed (4.97 m2)**

No Asbestos

**B00E - R0011 - Distribution Board Cupboard (0.66 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite	8410/B00E/R0030/Ceiling Structures/Linings/S13			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0012 - Staff Study (25.92 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00E/R0030/Ceiling Structures/Linings/S13			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2						<b>Chrysotile (white asbestos)</b>

**B00E - R0013 - Staff Study (25.4 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00E/R0030/Ceiling Structures/Linings/S13			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2						<b>Chrysotile (white asbestos)</b>

**B00E - R0014 - Cleaning Store - Distributed (2.19 m2)**

No Asbestos

**B00E - R0015 - Staff - Toilet (4.03 m2)**

No Asbestos

**B00E - R0016 - Movement (42.33 m2)**

Wall Linings Internal	Flat AC Sheeting	8410/B00C/R0012/Wall Linings Internal/S22			<b>No Asbestos Detected</b>	
-----------------------	------------------	---	--	--	-----------------------------	--

**B00E - R0017 - External Movement (96.75 m2)**

No Asbestos

**B00E - R0018 - Seminar (12.81 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B00E/R0030/Ceiling Structures/Linings/S13			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	12.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00E - R0019 - Seminar (12.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	12.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00E - R0020 - Main Area (241.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	241.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00E - R0021 - Librarian (11.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00E - R0022 - Entry (7.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00E - R0023 - Audio Visual Workroom (33.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	33.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
<b>B00E - R0025 - Staff - Toilet (1.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00E - R0026 - Workroom (25.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8410/B00E/R0030/Ceiling Structures/Linings/S13					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B00E - R0027 - Stairs (5.53 m2)</b>						
No Asbestos						
<b>B00E - R0028 - Stairs (2.1 m2)</b>						
No Asbestos						
<b>B00E - R0029 - External Movement (29.41 m2)</b>						
No Asbestos						
<b>B00E - R0030 - Movement (4.06 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8410/B00E/R0030/Ceiling Structures/Linings/S13					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8410/B00A/R0010/Floor Coverings Res/Textile/S2	4.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0031 - General Storeroom (18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8410/B00A/R0010/Floor Coverings Res/Textile/S2	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8410/B00E/R0030/Ceiling Structures/Linings/S13					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1001 - Movement (21.18 m2)</b>						
No Asbestos						
<b>B00E - R1002 - Cleaning Store - Distributed (3.27 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8410/B00C/R1012/Ceiling Structures/Linings/S26	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1003 - Music Learning Space (52.13 m2)</b>						
No Asbestos						
<b>B00E - R1004 - Music Store (12.52 m2)</b>						
No Asbestos						
<b>B00E - R1005 - Cleaning Store - Distributed (1.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8410/B00E/R0030/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>
<b>B00E - R1006 - Music Learning Space (53.44 m2)</b>						
No Asbestos						
<b>B00E - R1007 - Design L.S. (65.3 m2)</b>						
No Asbestos						
<b>B00E - R1008 - Distribution Board Cupboard (1 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00E - R1011 - Materials Store (6.43 m2)</b>						
No Asbestos						
<b>B00E - R1014 - Movement (14.55 m2)</b>						
No Asbestos						
<b>B00E - R1015 - General Learning Space (22.26 m2)</b>						
No Asbestos						
<b>B00E - R1016 - Staff - Toilet (4.03 m2)</b>						
No Asbestos						
<b>B00E - R1017 - External Movement (107.97 m2)</b>						
No Asbestos						
<b>B00E - R1018 - Stairs (5.09 m2)</b>						
No Asbestos						
<b>B00E - R1019 - Stairs (4.7 m2)</b>						
No Asbestos						
<b>B00E - R1020 - Movement (6.12 m2)</b>						
No Asbestos						
<b>B00E - R1021 - Computer Room (5.65 m2)</b>						
No Asbestos						
<b>B00E - R1022 - Commonroom (118.52 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Art - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					

**Interior**

**B00G - R0001 - Movement (28.22 m2)**

No Asbestos

**B00G - R0002 - Cleaning Store - Distributed (12.32 m2)**

No Asbestos

**B00G - R0003 - L.P.G. Store (1.03 m2)**

No Asbestos

**B00G - R0004 - Distribution Board Cupboard (1 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0005 - Cleaning Store - Distributed (3.19 m2)**

No Asbestos

**B00G - R0006 - General Storeroom (25.14 m2)**

Ceiling Structures/Linings Vermiculite  
8410/B00G/R1023/Ceiling Structures/Linings/S10 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00G - R0010 - Laboratory L.S. (82.75 m2)**

No Asbestos

**B00G - R0011 - Resource/Project Store (6.28 m2)**

Ceiling Structures/Linings Vermiculite  
8410/B00G/R1023/Ceiling Structures/Linings/S10 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00G - R0012 - Laundry (15.93 m2)**

No Asbestos

**B00G - R0013 - Food Technology L.S. (89.38 m2)**

No Asbestos

**B00G - R0014 - Food/Research Space (9.54 m2)**

No Asbestos

**B00G - R0015 - Food/Research Space (9.43 m2)**

No Asbestos

**B00G - R0016 - General Storeroom (23.45 m2)**

Ceiling Structures/Linings Vermiculite  
8410/B00G/R1023/Ceiling Structures/Linings/S10 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)  
8410/B00G/R1015/Floor Coverings Res/Textile/S11 **No Asbestos Detected**

**B00G - R0017 - Cleaning Store - Distributed (1.78 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R0018 - External Movement (58.45 m2)</b>						
No Asbestos						
<b>B00G - R0019 - Toilets-Girls (25.49 m2)</b>						
No Asbestos						
<b>B00G - R0020 - Toilets-Boys (32.32 m2)</b>						
No Asbestos						
<b>B00G - R0021 - Distribution Board Cupboard (0.9 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00G - R0022 - Movement (28.2 m2)</b>						
No Asbestos						
<b>B00G - R0023 - Cleaning Store - Distributed (8.82 m2)</b>						
No Asbestos						
<b>B00G - R0024 - External Movement (117.73 m2)</b>						
No Asbestos						
<b>B00G - R0025 - Stairs (8.06 m2)</b>						
No Asbestos						
<b>B00G - R0026 - Stairs (4.32 m2)</b>						
No Asbestos						
<b>B00G - R0027 - Design L.S. (65.45 m2)</b>						
No Asbestos						
<b>B00G - R0028 - Design L.S. (59.32 m2)</b>						
No Asbestos						
<b>B00G - R1002 - Distribution Board Cupboard (1 m2)</b>					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board					
	8410/B00G/R1002/Electrical Backing Board/S30					<b>No Asbestos Detected</b>
<b>B00G - R1003 - Cleaning Store - Distributed (3.19 m2)</b>						
No Asbestos						
<b>B00G - R1014 - Workroom (15.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1015 - General Storeroom (10.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00G - R1016 - Cleaning Store - Distributed (1.73 m2)</b>						
No Asbestos						
<b>B00G - R1017 - Staff Study (12.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B00G - R1018 - Staff Study (21.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R1019 - Staff Study (8.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R1020 - General Learning Space (52.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R1021 - Distribution Board Cupboard (1.01 m2)</b>						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board					
	8410/B00G/R1002/Electrical Backing Board/S30					No Asbestos Detected
<b>B00G - R1022 - General Storeroom (12.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1023 - General Storeroom (13.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1025 - Movement (20.47 m2)</b>						
No Asbestos						
<b>B00G - R1026 - Movement (20.12 m2)</b>						
No Asbestos						
<b>B00G - R1027 - Art Learning Space (66.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1028 - Art Learning Space (55.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1029 - Bulk Store (9.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1030 - General Learning Space (52.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1031 - General Learning Space (39.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8410/B00G/R1023/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1034 - Staff Study (9.55 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8410/B00G/R1023/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1035 - Workshop (12.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8410/B00G/R1023/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1036 - Workshop (13 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8410/B00G/R1023/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00G - R1037 - Stairs (25.24 m2)</b>						
No Asbestos						
<b>B00G - R1038 - Stairs (25.28 m2)</b>						
No Asbestos						
<b>B00G - R1039 - External Movement (101.76 m2)</b>						
No Asbestos						
<b>B00G - R1040 - General Learning Space (79.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8410/B00G/R1023/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8410/B00G/R1015/Floor Coverings Res/Textile/S11				No Asbestos Detected
<b>B00G - R1041 - Interview/Office - Type 1 (15.71 m2)</b>						
No Asbestos						
<b>B00G - R1042 - External Movement (28.42 m2)</b>						
No Asbestos						
<b>B00G - R1043 - Movement (7.41 m2)</b>						
No Asbestos						
<b>B00G - R2002 - Distribution Board Cupboard (1 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00G - R2003 - Cleaning Store - Distributed (3.17 m2)</b>						
No Asbestos						
<b>B00G - R2004 - General Learning Space (53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8410/B00G/R2014/Floor Coverings Res/Textile/S12				No Asbestos Detected
<b>B00G - R2005 - General Storeroom (6.09 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8410/B00G/R1015/Floor Coverings Res/Textile/S11				No Asbestos Detected
<b>B00G - R2006 - General Storeroom (6.08 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8410/B00G/R1015/Floor Coverings Res/Textile/S11				No Asbestos Detected
<b>B00G - R2007 - General Learning Space (52.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8410/B00G/R2014/Floor Coverings Res/Textile/S12				No Asbestos Detected
<b>B00G - R2008 - General Learning Space (52.63 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R2014/Floor Coverings Res/Textile/S12					No Asbestos Detected
<b>B00G - R2009 - General Learning Space (52.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R2014/Floor Coverings Res/Textile/S12					No Asbestos Detected
<b>B00G - R2010 - Cleaning Store - Distributed (1.98 m2)</b>						
No Asbestos						
<b>B00G - R2011 - General Storeroom (4.04 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R2012 - General Storeroom (6.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R2013 - General Learning Space (53.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R2014 - General Learning Space (52.13 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R2014/Floor Coverings Res/Textile/S12					No Asbestos Detected
<b>B00G - R2015 - General Learning Space (53.22 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R2014/Floor Coverings Res/Textile/S12					No Asbestos Detected
<b>B00G - R2016 - Staff Study (21.12 m2)</b>						
No Asbestos						
<b>B00G - R2017 - General Learning Space (52.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R2018 - Staff Study (26.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8410/B00G/R1015/Floor Coverings Res/Textile/S11					No Asbestos Detected
<b>B00G - R2019 - Distribution Board Cupboard (0.74 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00G - R2020 - Movement (20.47 m2)</b>						
No Asbestos						
<b>B00G - R2021 - Movement (20.5 m2)</b>						
No Asbestos						
<b>B00G - R2022 - Stairs (25.28 m2)</b>						
No Asbestos						
<b>B00G - R2023 - Stairs (25.24 m2)</b>						
No Asbestos						
<b>B00G - R2024 - External Movement (156.26 m2)</b>						
No Asbestos						
<b>B00G - R2025 - Staff Study (11.29 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Multi Purpose Facilities - 1976 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction

**Interior**

**B00H - M1001 - Plant (20.64 m2)**

No Asbestos

**B00H - M1002 - Control Room (14.2 m2)**

No Asbestos

**B00H - M1003 - Plant (20.64 m2)**

No Asbestos

**B00H - R0001 - Chair Store (21.18 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8410/B00H/R0009/Floor Coverings Res/Textile/S14	<b>No Asbestos Detected</b>
-----------------------------	--	-----------------------------

**B00H - R0002 - Stage (117.08 m2)**

No Asbestos

**B00H - R0003 - Sport Equipment Store (19.05 m2)**

No Asbestos

**B00H - R0004 - Toilets-Boys (1.84 m2)**

No Asbestos

**B00H - R0005 - Toilets-Girls (14.2 m2)**

No Asbestos

**B00H - R0006 - Shower/Change (12.19 m2)**

No Asbestos

**B00H - R0007 - Cleaning Store - Distributed (2.91 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8410/B00H/R0009/Floor Coverings Res/Textile/S14	<b>No Asbestos Detected</b>
-----------------------------	--	-----------------------------

**B00H - R0008 - Distribution Board Cupboard (0.87 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0009 - General Storeroom (13.06 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8410/B00H/R0009/Floor Coverings Res/Textile/S14	<b>No Asbestos Detected</b>
-----------------------------	--	-----------------------------

**B00H - R0010 - Movement (71.1 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8410/B00H/R0009/Floor Coverings Res/Textile/S14	<b>No Asbestos Detected</b>
-----------------------------	--	-----------------------------

**B00H - R0011 - Student Canteen (18.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8410/B00H/R0009/Floor Coverings Res/Textile/S14	<b>No Asbestos Detected</b>
-----------------------------	--	-----------------------------

**B00H - R0012 - Shower/Change (12.11 m2)**

No Asbestos

**B00H - R0013 - Toilets-Boys (14.36 m2)**

No Asbestos

**B00H - R0014 - Multi-Purpose Space (454.22 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00H - R0015 - Movement (1.8 m2)**

No Asbestos

**B00H - R0016 - Movement (1.8 m2)**

No Asbestos

**B00H - R0017 - External Movement (2.37 m2)**

No Asbestos

**B00H - R0018 - External Movement (2.37 m2)**

No Asbestos

**B00H - R0020 - External Movement (2.37 m2)**

No Asbestos

**B00H - R0021 - External Movement (2.38 m2)**

No Asbestos

**B00H - R0022 - External Movement (1.46 m2)**

No Asbestos

**B00H - R0023 - External Movement (1.46 m2)**

No Asbestos

**B00H - R1001 - Toilets-Boys (1.67 m2)**

No Asbestos

**B00H - R1002 - Performing Arts Changeroom (16.13 m2)**

Floor Coverings Vinyl Tiles  
Res/Textile

8410/B00H/R0009/Floor Coverings Res/Textile/S14

**No Asbestos Detected**

**B00H - R1003 - Shower/Change (1.67 m2)**

No Asbestos

**B00H - R1004 - Shower/Change (1.69 m2)**

No Asbestos

**B00H - R1005 - Toilets-Girls (1.72 m2)**

No Asbestos

**B00H - R1006 - Performing Arts Changeroom (15.82 m2)**

Floor Coverings Vinyl Tiles  
Res/Textile

8410/B00H/R0009/Floor Coverings Res/Textile/S14

**No Asbestos Detected**

**B00H - R1007 - Movement (4.16 m2)**

No Asbestos

**B00H - R1008 - Movement (4.09 m2)**

No Asbestos

**B00H - R9001 - Gymnasium (109.35 m2)**

No Asbestos





Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0F1 - General Learning/Science Learning - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					

**Interior**

**B0F1 - R0001 - Movement (19.96 m2)**

No Asbestos

**B0F1 - R0002 - Staff - Toilet (3.01 m2)**

No Asbestos

**B0F1 - R0003 - Cleaning Store - Distributed (1.87 m2)**

No Asbestos

**B0F1 - R0004 - Staff Study (25.44 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B0F1/R0005/Ceiling Structures/Linings/S6			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	25.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B0F1 - R0005 - General Learning Space (52.64 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B0F1/R0005/Ceiling Structures/Linings/S6			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B0F1 - R0006 - General Learning Space (55.41 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B0F1/R0005/Ceiling Structures/Linings/S6			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	55.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B0F1 - R0007 - General Storeroom (9.78 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

Ceiling Structures/Linings	Vermiculite	8410/B0F1/R0005/Ceiling Structures/Linings/S6			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0F1 - R0008 - Distribution Board Cupboard (0.78 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite	8410/B0F1/R0005/Ceiling Structures/Linings/S6			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0F1 - R0009 - Laboratory L.S. (91.67 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8410/B0F1/R0005/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0F1 - R0010 - General Storeroom (9.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8410/B0F1/R0005/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0F1 - R0011 - Preparation (28.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8410/B00A/R0010/Floor Coverings Res/Textile/S2	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8410/B0F1/R0005/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Fume Cupboard	Flat AC Sheeting 8410/B00A/R0010/Fume Cupboard/S3	1Unit	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Heat-proof Mat	Flat AC Sheeting 8410/B0F1/R0011/Broken AC Sheet used for heat mat/S7					No Asbestos Detected
<b>B0F1 - R0012 - Laboratory L.S. (91.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8410/B0F1/R0005/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0F1 - R0013 - L.P.G. Store (0.65 m2)</b>						
No Asbestos						
<b>B0F1 - R0014 - External Movement (116.86 m2)</b>						
No Asbestos						
<b>B0F1 - R0015 - Stairs (6.03 m2)</b>						
No Asbestos						
<b>B0F1 - R1001 - Movement (20.48 m2)</b>						
No Asbestos						
<b>B0F1 - R1002 - Staff - Toilet (3.09 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8410/B00C/R1012/Ceiling Structures/Linings/S26	3.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0F1 - R1003 - Cleaning Store - Distributed (1.83 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8410/B00C/R1012/Ceiling Structures/Linings/S26	1.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0F1 - R1004 - Staff Study (25.22 m2)</b>						
No Asbestos						
<b>B0F1 - R1005 - General Learning Space (52.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8410/B00A/R0010/Floor Coverings Res/Textile/S2	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0F1 - R1006 - General Learning Space (52.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8410/B00A/R0010/Floor Coverings Res/Textile/S2	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0F1 - R1007 - General Learning Space (52.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8410/B00A/R0010/Floor Coverings Res/Textile/S2	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0F1 - R1008 - Distribution Board Cupboard (0.74 m2)</b>						
				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B0F1 - R1009 - General Storeroom (5.69 m2)**

No Asbestos

**B0F1 - R1010 - General Storeroom (5.91 m2)**

No Asbestos

**B0F1 - R1011 - General Learning Space (52.64 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	

**B0F1 - R1012 - General Learning Space (52.64 m2)**

No Asbestos

**B0F1 - R1013 - Computer Learning Space (65.21 m2)**

No Asbestos

**B0F1 - R1014 - External Movement (102.79 m2)**

No Asbestos

**B0F1 - R1015 - Stairs (5.02 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0F2 - Technological & Applied Studies - 1964 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					

**Interior****B0F2 - R0001 - Movement (20.74 m2)**

No Asbestos

**B0F2 - R0002 - Staff - Toilet (3.05 m2)**

No Asbestos

**B0F2 - R0003 - Cleaning Store - Distributed (1.94 m2)**

No Asbestos

**B0F2 - R0004 - Materials Store (24.18 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B0F2/R0006/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

**B0F2 - R0005 - Distribution Board Cupboard (1.11 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite	8410/B0F2/R0006/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B0F2 - R0006 - Materials Technology L.S. (105.8 m2)**

Ceiling Structures/Linings	Vermiculite	8410/B0F2/R0006/Ceiling Structures/Linings/S8				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B0F2 - R0007 - External Movement (38.63 m2)**

No Asbestos

**B0F2 - R0008 - Stairs (5.71 m2)**

No Asbestos

**B0F2 - R1001 - Movement (19.73 m2)**

No Asbestos

**B0F2 - R1002 - Staff - Toilet (3.11 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00C/R1012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>		

**B0F2 - R1003 - Cleaning Store - Distributed (1.95 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00C/R1012/Ceiling Structures/Linings/S26				<b>Chrysotile (white asbestos)</b>		

**B0F2 - R1004 - Materials Store (12.59 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0F2 - R1005 - Staff Study (10.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B0F2 - R1006 - Materials Store (13.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B0F2 - R1007 - Distribution Board Cupboard (0.89 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B0F2 - R1008 - Materials Technology L.S. (94.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B0F2/R1008/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8410/B00A/R0010/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B0F2 - R1009 - External Movement (37.83 m2)</b>						
No Asbestos						
<b>B0F2 - R1010 - Stairs (5.11 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0F3 - Technological & Applied Studies - 2010 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Wall Cladding      No Asbestos Found

**Interior**

**B0F3 - R0001 - Materials Technology L.S. (91.43 m2)**

No Asbestos

**B0F3 - R0002 - Welding Area (17.63 m2)**

No Asbestos

**B0F3 - R0003 - Welding Area (2.11 m2)**

No Asbestos

**B0F3 - R0004 - External Movement (15.71 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017