


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : West Wallsend High School (8411)
Region : Hunter/Central Coast
State Electorate : Cessnock
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : Greencap-NAA : 26 - Mar - 2015

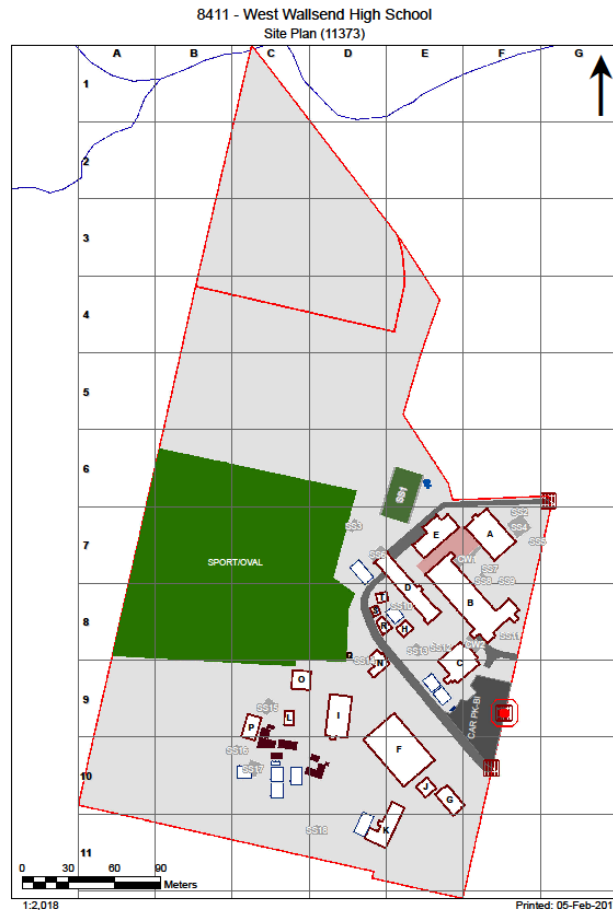

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Computer Learning/General Learning - 1965 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00A - R0001 - Staff Study (22.53 m2)

No Asbestos

B00A - R0002 - General Storeroom (19.04 m2)

No Asbestos

B00A - R0003 - Computer Learning Space (53.28 m2)

No Asbestos

B00A - R0004 - General Learning Space (52.84 m2)

No Asbestos

B00A - R0005 - Computer Resource (24.62 m2)

No Asbestos

B00A - R0006 - Staff Study (13.44 m2)

No Asbestos

B00A - R0007 - Staff Study (13.17 m2)

No Asbestos

B00A - R0008 - General Learning Space (52.77 m2)

No Asbestos

B00A - R0009 - General Learning Space (52.93 m2)

No Asbestos

B00A - R0010 - Computer Learning Space (52.78 m2)

No Asbestos

B00A - R0011 - Staff Study (10.28 m2)

No Asbestos

B00A - R0012 - Staff - Toilet (3.51 m2)

No Asbestos

B00A - R0014 - Cleaning Store - Distributed (5.06 m2)

No Asbestos

B00A - R0015 - Commonroom (26.42 m2)

No Asbestos

B00A - R0016 - Main Switchroom (1.58 m2)

Electrical Backing Board	Resinous Board	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00A - R0017 - Movement (71.14 m2)

No Asbestos

B00A - R0018 - Movement (2.74 m2)

No Asbestos

B00A - R0019 - Movement (2.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8411/B00B/Eaves Linings/S25

Chrysotile (white asbestos) , Crocidolite (blue asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Administration/Technological & Applied Studies - 1965 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 8411/B00B/Eaves Linings/S25	140m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Infil panels old	Flat AC Sheeting 8411/B00B/R0029/In-fill-panel/S3	25m2	Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infil panels new	Compressed AC Sheet 8411/B00B/Infil panel/S26					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0002 - Staff - Toilet (2.2 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0003 - Principal Office (19.46 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0004 - Administration - Clerical (35.93 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0005 - Clinic - Boys (9.77 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0006 - Duplicating Workroom (18.51 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0007 - Duplicating Workroom (3.34 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0008 - Security Store (11.39 m2)

No Asbestos

B00B - R0009 - Cleaning Store - Distributed (3.7 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0010 - Staff - Toilet (9.21 m2)

Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	---

B00B - R0013 - Interview/Office - Type 1 (9.99 m2)

No Asbestos

B00B - R0014 - Deputy Principal Office (15.54 m2)

No Asbestos

B00B - R0015 - Interview/Office - Type 1 (10.85 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0016 - Clinic - Girls (17.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0017 - Clinic-Toilets (1.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0018 - Staff Study (33.87 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0019 - Design L.S. (60.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Sink pad	Resinous Membrane					
	8411/B00B/R0019/Sink pad/S32					No Asbestos Detected
B00B - R0020 - Materials Store (16.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0021 - Distribution Board Cupboard (1.47 m2) Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	8411/B00B/R0021/Wall Linings Internal/S30					Chrysotile (white asbestos)
B00B - R0022 - Food Technology L.S. (66.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Sink pad	Resinous Membrane					
	8411/B00B/R0019/Sink pad/S32					No Asbestos Detected
B00B - R0023 - Pantry (18.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Sink pad	Resinous Membrane					
	8411/B00B/R0019/Sink pad/S32					No Asbestos Detected
B00B - R0024 - Laundry (6.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0025 - Food Technology L.S. (66.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Sink pad	Resinous Membrane					
	8411/B00B/R0019/Sink pad/S32					No Asbestos Detected
B00B - R0026 - Staff Study (15.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Sink pad	Resinous Membrane					
	8411/B00B/R0019/Sink pad/S32					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0027 - Staff Study (10.11 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0028 - Staff - Toilet (19.68 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00B/R0028/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
B00B - R0029 - Staff - Toilet (4.63 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Compressed AC Sheet	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00B/R0029/In-fill-panel/S3					Chrysotile (white asbestos)
B00B - R0030 - Design L.S. (66.58 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0031 - Materials Store (6.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0032 - Materials Store (6.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0033 - Preparation (12.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0034 - Laboratory L.S. (93.81 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0035 - Preparation (26.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Sink pad	Resinous Membrane					No Asbestos Detected
	8411/B00B/R0019/Sink pad/S32					
B00B - R0039 - External Movement (12.41 m2)						
No Asbestos						
B00B - R0040 - Movement (10.7 m2)						
No Asbestos						
B00B - R0041 - External Movement (9.05 m2)						
No Asbestos						
B00B - R0043 - General Storeroom (8.48 m2)						
No Asbestos						
B00B - R0045 - Stairs (4.06 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0046 - Stairs (3.22 m2)						
No Asbestos						
B00B - R0047 - General Storeroom (8.79 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0048 - External Movement (16.92 m2)						
No Asbestos						
B00B - R0049 - Public Reception (22.87 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0050 - Movement (211.24 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Infil panel above EDB	Flat AC Sheeting		8411/B00B/R0050/Infil panel above EDB/S31			No Asbestos Detected
B00B - R0051 - Store (11.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
			8411/B00B/R0051/Floor Coverings Res/Textile/S28			Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive		8411/B00B/R0051/Floor Coverings Res/Textile/S29			No Asbestos Detected
B00B - R0052 - Laboratory L.S. (93.22 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1001 - Commonroom (90.39 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - Commonroom (8.02 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1003 - Staff Study (7.16 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1004 - General Learning Space (53.36 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - General Learning Space (53.14 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - General Learning Space (52.93 m2)						
Ceiling Structures/Linings	Vermiculite		8411/B00B/R0005/Ceiling Structures/Linings/S27			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00B/R1015/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00B - R1007 - Design L.S. (53.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1008 - Bulk Store (3.33 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00B/R1029/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00B - R1009 - Resources Space (5.21 m2)						
No Asbestos						
B00B - R1010 - Staff - Toilet (1.4 m2)						
No Asbestos						
B00B - R1011 - Darkroom Space (13.92 m2)						
No Asbestos						
B00B - R1012 - Resource/Project Store (3.99 m2)						
No Asbestos						
B00B - R1013 - Resources Space (6.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8411/B00B/R1017/Floor Coverings Res/Textile/S33					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected	
B00B - R1014 - Kiln Space (3.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00B/R1017/Floor Coverings Res/Textile/S33					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected	
B00B - R1015 - Art Learning Space (69.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	70m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8411/B00B/R1017/Floor Coverings Res/Textile/S33					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1016 - Art Learning Space (66.27 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00B - R1017 - Resources Store (2.89 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8411/B00B/R1017/Floor Coverings Res/Textile/S33	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00B - R1018 - Distribution Board Cupboard (0.99 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting 8411/B00B/R1018/Ceiling Structures/Linings/S6	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R1019 - General Storeroom (8.07 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1020 - General Learning Space (66.35 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8411/B00B/R1017/Floor Coverings Res/Textile/S33	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8411/B00B/R1017/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00B - R1021 - Music Learning Space (52.85 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1022 - Music Store (7.57 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1023 - Cleaning Store - Distributed (4.66 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1024 - Staff Study (26.64 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1026 - Stairs (3.95 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1027 - External Movement (8.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00B/R1018/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00B - R1028 - Stairs (17.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1029 - Movement (157.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00B/R0005/Ceiling Structures/Linings/S27					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	158m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00B/R1029/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Infil panel above EDB	Flat AC Sheeting					
	8411/B00B/R0050/Infil panel above EDB/S31					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Science Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00B/R1018/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8411/B00B/R1018/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Interior**B00C - R0001 - Laboratory L.S. (92.29 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00C/R0013/Ceiling Structures/Linings/S35					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0002 - Cleaning Store - Distributed (4.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00C - R0003 - Distribution Board Cupboard (0.8 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00C - R0004 - Toilets-Girls (18.52 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00C/R2007/Ceiling Structures/Linings/S7					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R0004/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)

B00C - R0005 - Toilets-Boys (19.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00C/R2007/Ceiling Structures/Linings/S7					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R0004/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)

B00C - R0006 - Dust Extraction Space (3.05 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00C - R0007 - Apparatus Store (2.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00C - R0008 - Laboratory L.S. (97.41 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00C/R0013/Ceiling Structures/Linings/S35					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0009 - Chemical Store (13.05 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00C - R0010 - Preparation (51.71 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0011 - Staff - Toilet (2.13 m2)						
No Asbestos						
B00C - R0012 - Staff Change (3.48 m2)						
No Asbestos						
B00C - R0013 - Movement (15.61 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0014 - Resources Store (8.74 m2)						
No Asbestos						
B00C - R0015 - Movement (21.24 m2)						
No Asbestos						
B00C - R0016 - Stairs (5.82 m2)						
No Asbestos						
B00C - R1001 - General Learning Space (52.42 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1002 - General Storeroom (18.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1003 - General Learning Space (52.49 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1004 - General Storeroom (24.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1005 - Staff Study (52.42 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00C/R1009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1006 - General Storeroom (18.72 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8411/B00C/R1009/Floor Coverings Res/Textile/S9	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1007 - General Learning Space (52.08 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8411/B00C/R1009/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1008 - Distribution Board Cupboard (0.96 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00C - R1009 - Movement (47.49 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8411/B00C/R1009/Floor Coverings Res/Textile/S9	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1010 - Cleaning Store - Distributed (1.05 m2)						
No Asbestos						
B00C - R1011 - Movement (8.26 m2)						
No Asbestos						
B00C - R1012 - Movement (8.74 m2)						
No Asbestos						
B00C - R1013 - Stairs (11.78 m2)						
No Asbestos						
B00C - R2001 - Staff Change (1.52 m2)						
No Asbestos						
B00C - R2002 - Staff - Toilet (1.27 m2)						
No Asbestos						
B00C - R2003 - Staff - Toilet (1.27 m2)						
No Asbestos						
B00C - R2004 - Cleaning Store - Distributed (2.71 m2)						
No Asbestos						
B00C - R2005 - Distribution Board Cupboard (0.94 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00C - R2006 - Staff Change (1.61 m2)						
No Asbestos						
B00C - R2007 - Main Area (12.6 m2)						
Ceiling Structures/Linings	Vermiculite 8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R2008 - Audio Visual Workroom (13.21 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2009 - Seminar (12.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2010 - Seminar (13.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2011 - Workroom (18.49 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2012 - Librarian (6.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2013 - Main Area (243.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8411/B00C/R0013/Ceiling Structures/Linings/S35					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2014 - Movement (15.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00B/R1018/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00C - R2015 - Movement (8.74 m2)						
No Asbestos						
B00C - R2016 - Stairs (5.89 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Technological & Applied Studies - 1976 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8411/B00D/Eaves Linings/S37					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Packing	10m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8411/B00D/Eaves Linings/S37					Chrysotile (white asbestos)

Interior

B00D - R0001 - Dust Extraction Space (5.53 m2)

No Asbestos

B00D - R0002 - Materials Store (30.75 m2)

No Asbestos

B00D - R0003 - Materials Technology L.S. (107.98 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0004 - Design L.S. (52.77 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0005 - Resource/Project Store (7.61 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0006 - Staff Change (2.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0007 - Staff - Toilet (1.53 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0008 - Staff Study (19.45 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0009 - Cleaning Store - Distributed (2.42 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0010 - Materials Technology L.S. (107.94 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8411/B00D/R0003/Ceiling Structures/Linings/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Top of bench	Vinyl Sheet					No Asbestos Detected
	8411/B00D/R0010/Top of bench/S39					

B00D - R0011 - Workshop Area (81.6 m2)

Hot Metal Workbench	Compressed AC Sheet					No Asbestos Detected
	8411/B00D/R0011/Hot Metal Workbench/S40					

B00D - R0012 - Welding Store (15.99 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00D - R0013 - Materials Store (8.72 m2)

No Asbestos

B00D - R0014 - Movement (24.03 m2)

Ceiling Structures/Linings Vermiculite

8411/B00D/R0003/Ceiling Structures/Linings/S38

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0015 - Movement (6.15 m2)

No Asbestos

B00D - R0016 - Distribution Board Cupboard (1 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8411/B00D/R0016/Ceiling Structures/Linings/S12

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0017 - Movement (3.28 m2)

Ceiling Structures/Linings Flat AC Sheeting

8411/B00D/R0003/Ceiling Structures/Linings/S38

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1965 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00E - R0001 - Cleaning Store - Distributed (7.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0002 - General Storeroom (7.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0003 - Toilets-Boys (29.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0004 - Shower/Change (10.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0005 - Shower/Change (9.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0012 - Shower/Change (13.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0014 - Maintenance Bulk Store (0.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0015 - External Movement (129.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	130m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0016 - Toilets-Girls (24.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0017 - Store (12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0018 - Covered Area (43.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0019 - Store (2.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					8411/B00E/R0015/Ceiling Structures/Linings/S13	
					Chrysotile (white asbestos)	

B00E - R0020 - Student Canteen (53.45 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R0021 - Cleaning Store - Distributed (2.82 m2)

No Asbestos

B00E - R0022 - Staff - Toilet (1.61 m2)

No Asbestos

B00E - R0023 - Store - Coolroom (4.95 m2)

No Asbestos

B00E - R0024 - Store - Coolroom (2.97 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 1982 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00F - M0001 - No Access (5.67 m2)**

No Asbestos

B00F - M0002 - Movement (5.66 m2)

No Asbestos

B00F - R0001 - Shower/Change (33 m2)

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	------------	--------------------	---------	--------------------

8411/B00F/R0011/Wall Linings Internal/S22

Chrysotile (white asbestos)

B00F - R0003 - Chair Store (63.83 m2)

No Asbestos

B00F - R0004 - Shower/Change (32.86 m2)

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	------------	--------------------	---------	--------------------

8411/B00F/R0011/Wall Linings Internal/S22

Chrysotile (white asbestos)

B00F - R0006 - Toilets-Girls (14.83 m2)

Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	------------	--------------------	---------	--------------------

8411/B00F/R0011/Wall Linings Internal/S22

Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	-------	--------------------	---------	--------------------

8411/B00F/R0016/Partition Walls (Cubicles)/S24

Chrysotile (white asbestos)

B00F - R0007 - Cleaning Store - Distributed (3.17 m2)

No Asbestos

B00F - R0008 - Toilets-Girls (2.82 m2)

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	------------	--------------------	---------	--------------------

8411/B00F/R0011/Wall Linings Internal/S22

Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
8411/B00F/R0008/Ceiling Structures/Linings/S23						

B00F - R0009 - Student Canteen (14.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
-----------------------------	-------------	-----	------------	---------------------------------------	---------	-----------------------

8411/B00F/R0009/Floor Coverings Res/Textile/S43

Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	---------------------------	--------------------	---------	--------------------

8411/B00F/R0011/Wall Linings Internal/S22

Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
8411/B00F/R0009/Floor Coverings Res/Textile/S44						

B00F - R0010 - Staff Shower (2.37 m2)

No Asbestos

B00F - R0011 - Staff Study (15.01 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------

8411/B00F/R0011/Floor Coverings Res/Textile/S21

Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00F/R0011/Wall Linings Internal/S22					Chrysotile (white asbestos)	

B00F - R0012 - Sport Equipment Store (20.62 m2)

No Asbestos

B00F - R0013 - Sport Equipment Store (54.93 m2)

Wall Linings Internal	Flat AC Sheeting	50m2	South, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00F/R0011/Wall Linings Internal/S22					Chrysotile (white asbestos)	

B00F - R0014 - Distribution Board Cupboard (2.94 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00F - R0015 - Toilets-Boys (2.9 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00F/R0011/Wall Linings Internal/S22					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	8411/B00F/R0008/Ceiling Structures/Linings/S23				No Asbestos Detected	
----------------------------	------------------	--	--	--	--	-----------------------------	--

B00F - R0016 - Toilets-Boys (14.64 m2)

Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00F/R0011/Wall Linings Internal/S22					Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00F/R0016/Partition Walls (Cubicles)/S24					Chrysotile (white asbestos)	

B00F - R0017 - Multi-Purpose Space (455.9 m2)

No Asbestos

B00F - R0018 - Movement (216.21 m2)

No Asbestos

B00F - R0019 - Stage (62.52 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Music/Performing Arts - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	0.1m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
8411/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

Interior

B00G - R0001 - Movement (23.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00G/R0001/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

B00G - R0002 - Performance Workspace (67.95 m2)

No Asbestos

B00G - R0003 - Performing Arts Store (11.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
8411/B00G/R0003/Floor Coverings Res/Textile/S20					No Asbestos Detected	

B00G - R0004 - Performing Arts Store (10.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
8411/B00G/R0003/Floor Coverings Res/Textile/S20					No Asbestos Detected	

B00G - R0005 - Music Learning Space (53.8 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Movement (12.41 m2)

No Asbestos

B00H - R0002 - Museum (46.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8411/B00H/R0002/Floor Coverings Res/Textile/S41	No Asbestos Detected
-----------------------------	-------------	---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Wall Linings Internal	Flat AC Sheeting					
	8411/B001/R0023/Wall Linings Internal/S15					No Asbestos Detected

B001 - R0021 - Staff Study (5.62 m2)

No Asbestos

B001 - R0022 - Movement (3.2 m2)

No Asbestos

B001 - R0023 - Staff - Toilet (4.28 m2)

Wall Linings Internal	Flat AC Sheeting					
	8411/B001/R0023/Wall Linings Internal/S15					No Asbestos Detected

B001 - R0024 - Interview/Office - Type 1 (9.91 m2)

No Asbestos

B001 - R0025 - Commonroom (19.05 m2)

No Asbestos

B001 - R0026 - Staff Study (5.98 m2)

No Asbestos

B001 - R0027 - Movement (30.16 m2)

No Asbestos

B001 - R9001 - General Storeroom (6.77 m2)

No Asbestos

B001 - R9002 - Movement (4.42 m2)

No Asbestos

B001 - R9003 - No Access (170.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Storage - 2001 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00J - R0001 - No Access (82.69 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other-Regional Use - 2001 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00K - R0001 - No Access (263.81 m2)

No Asbestos

B00K - R0002 - Other - Regional Use (43.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8411/B00K/R0002/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Agricultural Science - 2001 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00L - R0001 - Machine Storage (56.31 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other-Museum - 1990 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Surround	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8411/B00N/Eaves Linings/S42					Chrysotile (white asbestos)	

Interior

B00N - R0001 - Museum (44.96 m2)						
No Asbestos						
B00N - R0002 - Museum (46.49 m2)						
No Asbestos						
B00N - R0003 - Museum (6.45 m2)						
No Asbestos						
B00N - R0004 - Museum (20.35 m2)						
No Asbestos						
B00N - R0005 - External Movement (4.66 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2007 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B000 - R0001 - General Learning Space (49.79 m2)

No Asbestos

B000 - R0002 - External Movement (83.71 m2)

No Asbestos

B000 - R0003 - No Access (5.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Storage - 2005 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00P - R0001 - No Access (140.67 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Other - 2000 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00Q - R0001 - No Access (6.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Shed - 2004 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00R - R0001 - General Storeroom (15.03 m2)

No Asbestos

B00R - R0002 - Covered Area (45.59 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Storage - 2006 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00S - R0001 - No Access (27.86 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Storage - 2006 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00T - R0001 - No Access (22.97 m2)

No Asbestos

B00T - R0002 - Covered Area (17.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Added Building

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

Build+1 - Room+1 - Added Room

No Asbestos

Build+1 - Room+2 - Large walkway between buildings

Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8411/Build+1/Room+2/Ceiling Structures/Linings/S36					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 711 - D10853 - Home Science/Art/Science Dem/Computer : Placement Date - 30/01/2001

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		14.4 m2

Interior

R1 - Computer Room

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		

R2 - Food Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		73 m2

R3 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos		
---------	---------------	------------------	--	--

OS 601 - D11006 - Learning Unit - Standard/Withdrawal : Placement Date - 15/08/2003

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

OS 521 - D11985 - Staff Study : Placement Date - 19/01/2001

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Staff Room						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R2 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
R3 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
R4 - Lobby						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D12003 - Learning Unit - Standard/Withdrawal : Placement Date - 23/01/2001						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 760 - D12842 - Woodwork/Store : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - Woodwork						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				91 m2
R2 - Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
OS 601 - D12939 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995						
Exterior						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 780 - D13376 - Woodwork/Metalwork/Heat Area/Store : Placement Date - 12/06/2001						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
R2 - Materials Technology L.S.						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				91 m2
OS 843 - D13845 - Country Toilet - Reltb - Boys/Girls : Placement Date - 21/01/2001						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Staff Toilet						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - Staff Toilet						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
R3 - Female toilet						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
OS 601 - D14238 - Learning Unit - Standard/Withdrawal : Placement Date - 22/01/2001						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D15913 - Learning Unit - Standard/Withdrawal : Placement Date - 7/03/2001						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017