


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Willyama High School (8491)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Broken Hill

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Greencap-NAA : 03 - Mar - 2015

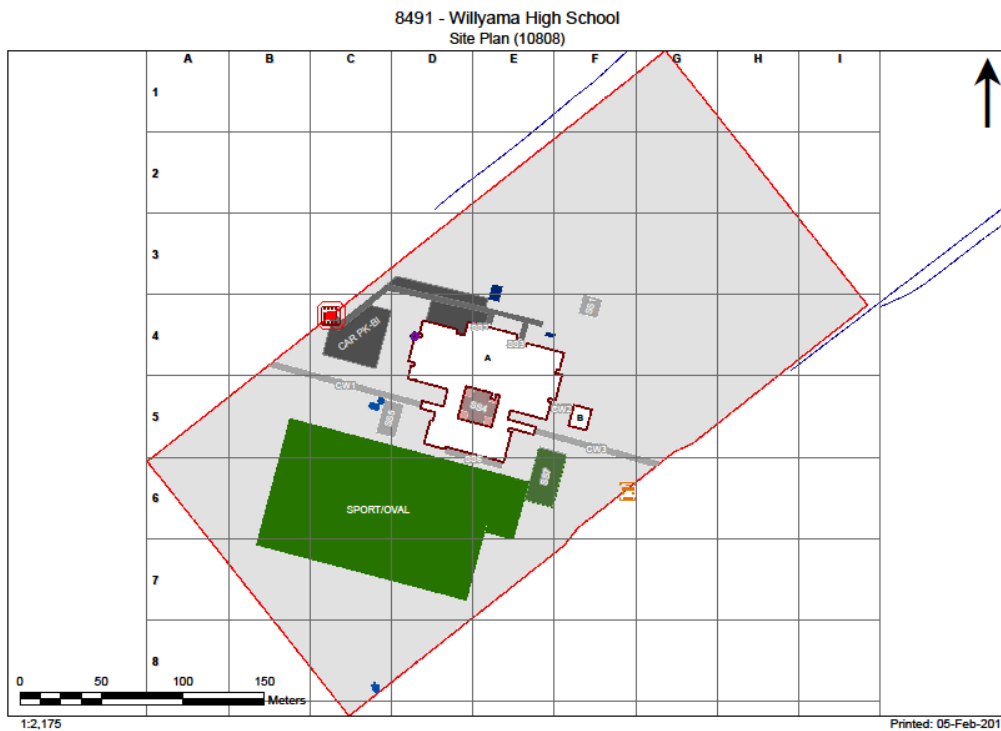

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Various - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	No Asbestos Found

Interior**B00A - R0E01 - Welding Area (9.64 m2)**

No Asbestos

B00A - R0E02 - Materials Store (13.98 m2)

No Asbestos

B00A - R0E03 - Plant (132.17 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E04 - Materials Technology L.S. (179.68 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E05 - Movement (7.63 m2)

No Asbestos

B00A - R0E06 - Design L.S. (51.13 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E07 - Design L.S. (51.27 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E09 - Materials Technology L.S. (205.31 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E10 - Dust Extraction Space (6.37 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E11 - Movement (7.63 m2)

No Asbestos

B00A - R0E12 - Materials Store (35.47 m2)

No Asbestos

B00A - R0E13 - Staff Study (13.54 m2)

No Asbestos

B00A - R0E14 - Staff Study (25.99 m2)

Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0E15 - General Storeroom (24.14 m2)

No Asbestos

B00A - R0E16 - Distribution Board Cupboard (0.69 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0E17 - Lift (0.8 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0E18 - General Storeroom (10.84 m2)						
No Asbestos						
B00A - R0E19 - Distribution Board Cupboard (2.55 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0E20 - Toilets-Boys (11.36 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0E21 - Toilets-Girls (11.59 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00A - R0E22 - Staff - Toilet (3.35 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0E23 - General Storeroom (3.35 m2)						
No Asbestos						
B00A - R0E24 - Movement (131.42 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0E25 - General Learning Space (58.58 m2)						
No Asbestos						
B00A - R0E26 - General Learning Space (58.65 m2)						
No Asbestos						
B00A - R0E27 - Materials Store (7.57 m2)						
No Asbestos						
B00A - R0E28 - General Storeroom (7.61 m2)						
No Asbestos						
B00A - R0E29 - General Storeroom (7.58 m2)						
No Asbestos						
B00A - R0E30 - General Storeroom (7.63 m2)						
No Asbestos						
B00A - R0N01 - Plant (17.26 m2)						
No Asbestos						
B00A - R0N02 - Plant (137.41 m2)						
No Asbestos						
B00A - R0N03 - Plant (11.86 m2)						
No Asbestos						
B00A - R0N04 - Movement (2.21 m2)						
No Asbestos						
B00A - R0N05 - Plant (7.01 m2)						
No Asbestos						
B00A - R0N06 - General Storeroom (7.12 m2)						
No Asbestos						
B00A - R0N07 - Cleaning Store - Distributed (6.8 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0N08 - Staff Study (30.2 m2)						
No Asbestos						
B00A - R0N09 - Movement (13.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0N10 - Staff Study (30.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0N11 - Practice/Seminar (65.33 m2)						
No Asbestos						
B00A - R0N12 - Music Learning Space (65.33 m2)						
No Asbestos						
B00A - R0N13 - General Storeroom (4.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0N14 - Music Store (4.93 m2)						
No Asbestos						
B00A - R0N15 - General Storeroom (7.65 m2)						
No Asbestos						
B00A - R0N16 - Student Canteen (45.83 m2)						
No Asbestos						
B00A - R0N17 - Movement (2.31 m2)						
No Asbestos						
B00A - R0N19 - Movement (245.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0N20 - Cleaning Supplies Store (6.8 m2)						
No Asbestos						
B00A - R0N21 - Cleaning Supplies Store (6.93 m2)						
No Asbestos						
B00A - R0N22 - Plant (7.24 m2)						
No Asbestos						
B00A - R0N23 - Lift (2.23 m2)						
No Asbestos						
B00A - R0N24 - External Movement (58.82 m2)						
No Asbestos						
B00A - R0S01 - Movement (21.89 m2)						
No Asbestos						
B00A - R0S02 - Movement (88.05 m2)						
No Asbestos						
B00A - R0S03 - General Storeroom (50.14 m2)						
No Asbestos						
B00A - R0S04 - Chair Store (20.85 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0S05 - Sport Equipment Store (25.66 m2)						
No Asbestos						
B00A - R0S06 - Distribution Board Cupboard (0.41 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0S07 - Movement (25.57 m2)						
No Asbestos						
B00A - R0S08 - Multi-Purpose Space (455 m2)						
No Asbestos						
B00A - R0S09 - Movement (88.5 m2)						
No Asbestos						
B00A - R0S10 - Shower/Change (36.61 m2)						
No Asbestos						
B00A - R0S11 - Shower/Change (25.83 m2)						
No Asbestos						
B00A - R0S12 - Shower/Change (23.99 m2)						
No Asbestos						
B00A - R0S13 - Cleaning Store - Distributed (4 m2)						
No Asbestos						
B00A - R0S14 - Movement (13.46 m2)						
No Asbestos						
B00A - R0S15 - Toilets-Boys (20.87 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0S16 - Garden Store Room (30.75 m2)						
No Asbestos						
B00A - R0S17 - Plant (4.94 m2)						
Flue	Fibre Cement Pipe	3m	West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8491/B00A/R0S17/Flue/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0S18 - General Storeroom (3.93 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0S19 - Movement (8.8 m2)						
No Asbestos						
B00A - R0S20 - Movement (76.13 m2)						
No Asbestos						
B00A - R0S21 - Distribution Board Cupboard (4 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0S22 - Practice/Seminar (97.76 m2)						
No Asbestos						
B00A - R0S23 - General Storeroom (9.28 m2)						
No Asbestos						
B00A - R0S24 - Shower/Change (32.16 m2)						
No Asbestos						
B00A - R0S25 - Shower/Change (38.69 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0S26 - Shower/Change (32.85 m2)						
No Asbestos						
B00A - R0S27 - Toilets-Girls (19.4 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0S28 - General Storeroom (4.4 m2)						
No Asbestos						
B00A - R0S29 - Movement (7.99 m2)						
No Asbestos						
B00A - R0S30 - Sport Equipment Store (18.42 m2)						
No Asbestos						
B00A - R0W01 - Main Switchroom (11.77 m2)						
No Asbestos						
B00A - R0W02 - Movement (16.1 m2)						
No Asbestos						
B00A - R0W03 - Staff - Toilet (5.66 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0W04 - Staff - Toilet (3.35 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0W05 - Toilets-Boys (15.12 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0W06 - Toilets-Girls (15.83 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R0E20/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0W07 - Cleaning Store - Distributed (2.58 m2)						
No Asbestos						
B00A - R0W08 - Darkroom Space (13.6 m2)						
Ceiling Structures/Linings	Vermiculite	8491/B00A/R1S06/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0W09 - Duplicating Workroom (22.54 m2)						
Ceiling Structures/Linings	Vermiculite	8491/B00A/R1S06/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0W10 - Movement (7.63 m2)						
No Asbestos						
B00A - R0W11 - Kiln Space (18.08 m2)						
Ceiling Structures/Linings	Vermiculite	8491/B00A/R1S06/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0W12 - Art Learning Space (54.79 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W13 - General Storeroom (17.51 m2)						
No Asbestos						
B00A - R0W14 - Art Learning Space (72.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W15 - Plant (129.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W16 - Workshop Area (53.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W17 - Plant (39.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W18 - Art Learning Space (52.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W19 - Resources Store (10.91 m2)						
No Asbestos						
B00A - R0W20 - Distribution Board Cupboard (2.55 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0W21 - General Storeroom (10.78 m2)						
No Asbestos						
B00A - R0W22 - Duplicating Workroom (5.64 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0W23 - Materials Technology L.S. (65.15 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0W26 - Special Learning Space (64.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0W27 - General Storeroom (5.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W01/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R0W28 - General Storeroom (5.95 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W01/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R0W29 - Staff Study (12.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R0W32 - Movement (173.92 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R0W33 - Laundry (1.5 m2)						
No Asbestos						
B00A - R0W34 - Food Technology L.S. (94.31 m2)						
No Asbestos						
B00A - R0W35 - Materials Store (15.21 m2)						
No Asbestos						
B00A - R0W36 - Pantry (10.5 m2)						
No Asbestos						
B00A - R0W37 - Food/Research Space (21.86 m2)						
No Asbestos						
B00A - R0W38 - Plant (0.55 m2)						
No Asbestos						
B00A - R0W39 - Food Technology L.S. (88.54 m2)						
No Asbestos						
B00A - R0W40 - Movement (17.4 m2)						
No Asbestos						
B00A - R0W41 - Pantry (10.39 m2)						
No Asbestos						
B00A - R1E01 - Laboratory L.S. (88.93 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W01/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R1E02 - Preparation (53.26 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1E03 - Laboratory L.S. (88.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W01/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00A - R1E04 - Toilets-Girls (11.51 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00A - R1E05 - Staff - Toilet (3.39 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1E06 - Staff - Toilet (3.39 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1E07 - Toilets-Boys (11.42 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1E08 - Distribution Board Cupboard (2.55 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
8491/B00A/R1E08/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)		
B00A - R1E09 - Apparatus Store (18.51 m2)						
No Asbestos						
B00A - R1E10 - Staff Study (29.31 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1E11 - General Learning Space (52.33 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1E12 - Computer Learning Space (84.37 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1E13 - Plant (3.77 m2)						
Pipework	Fibre Cement Pipe	1Unit(s)	Through ceiling	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8491/B00A/R1E13/Pipework/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1E14 - General Learning Space (52.47 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1E15 - Staff Study (29.59 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1E16 - General Storeroom (12.25 m2)						
No Asbestos						
B00A - R1E17 - General Storeroom (6.14 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R1E18 - Staff Study (12.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1E19 - Plant (3.77 m2)						
Pipework	Fibre Cement Pipe	1Unit(s)	Through ceiling	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8491/B00A/R1E13/Pipework/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1E20 - Laboratory L.S. (88.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1E21 - Preparation (52.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1E22 - Laboratory L.S. (88.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1E23 - Lift (0.8 m2)						
No Asbestos						
B00A - R1E26 - Movement (308.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1E27 - Movement (161.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1S19/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B00A - R1E28 - Movement (90.14 m2)						
No Asbestos						
B00A - R1N01 - Commonroom (149.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N02 - General Storeroom (2.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N03 - Workroom (64.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N04 - General Storeroom (9.37 m2)						
No Asbestos						
B00A - R1N05 - Main Area (194.96 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N06 - Entry (32.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N07 - General Storeroom (22.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1N08 - General Storeroom (23.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1N09 - Librarian (12.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N10 - Movement (155.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1N11 - Movement (50.84 m2)						
No Asbestos						
B00A - R1N12 - Cleaning Store - Distributed (6.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1S01 - Deputy Principal Office (18.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1S02 - Movement (8.14 m2)						
No Asbestos						
B00A - R1S03 - Public Entry (98.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1S04 - Cleaning Store - Distributed (3.98 m2)						
No Asbestos						
B00A - R1S05 - Movement (43.19 m2)						
No Asbestos						
B00A - R1S06 - Clinic - Boys (12.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1S07 - Duplicating Workroom (22.16 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1S08 - Administration - Clerical (17.82 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1S09 - Principal Office (27.86 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1S10 - General Storeroom (1.26 m2)						
No Asbestos						
B00A - R1S11 - Staff - Toilet (1.94 m2)						
No Asbestos						
B00A - R1S12 - Staff - Toilet (3.33 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8491/B00A/R1W07/Partition Walls (Cubicles)/S14	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1S13 - Staff - Toilet (3.33 m2)						
Incinerator	Encapsulated Insulation material within unit <i>Assumed Asbestos - Area inaccessible</i>	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Partition Walls (Cubicles)	Compressed AC Sheet 8491/B00A/R1W07/Partition Walls (Cubicles)/S14	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1S14 - Administration - Clerical (11.82 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1S15 - Administration - Clerical (27.12 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1S16 - Control Room (6.28 m2)						
No Asbestos						
B00A - R1S18 - Movement (66.04 m2)						
No Asbestos						
B00A - R1S19 - Movement (76.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8491/B00A/R1S19/Ceiling Structures/Linings/S11	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1S20 - Movement (75.96 m2)						
No Asbestos						
B00A - R1W01 - Staff Study (12.3 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R1W02 - Shower/Change (7.57 m2)						
No Asbestos						
B00A - R1W03 - Shower/Change (5.17 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1W04 - Self Help Toilet (8.31 m2)						
No Asbestos						
B00A - R1W05 - Staff - Toilet (3.29 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1W06 - Toilets-Boys (14.9 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1W07 - Toilets-Girls (15.58 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W07/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)		
B00A - R1W08 - Cleaning Store - Distributed (2.6 m2)						
No Asbestos						
B00A - R1W09 - Senior Seminar (17.77 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W10 - General Storeroom (9.37 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W11 - General Learning Space (50.96 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W12 - General Learning Space (51.69 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W13 - General Learning Space (51.17 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W14 - Plant (3.82 m2)						
Pipework	Fibre Cement Pipe	1Unit(s)	Through ceiling	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8491/B00A/R1E13/Pipework/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1W15 - Computer Learning Space (85.04 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W16 - General Learning Space (51.26 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R1W17 - General Learning Space (53.46 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W18 - Plant (3.81 m2)						
Non Accessible						
B00A - R1W19 - General Learning Space (51.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W20 - General Learning Space (51.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W21 - General Learning Space (52.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W22 - General Learning Space (51.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W23 - Staff Study (29.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W24 - General Storeroom (8.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W25 - Staff Study (65.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1W26 - Distribution Board Cupboard (2.58 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8491/B00A/R1E08/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00A - R1W28 - Movement (458.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2E01 - Laboratory L.S. (89.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R2E02 - Preparation (52.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2E03 - Laboratory L.S. (88.57 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E04 - Toilets-Girls (11.5 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8491/B00A/R2E04/Partition Walls (Cubicles)/S12	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Incinerator	Encapsulated Insulation material within unit Assumed Asbestos - Area inaccessible	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
B00A - R2E05 - Toilets-Boys (11.27 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8491/B00A/R2E04/Partition Walls (Cubicles)/S12	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E06 - Staff - Toilet (3.5 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8491/B00A/R2E04/Partition Walls (Cubicles)/S12	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E07 - Staff - Toilet (3.41 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8491/B00A/R2E04/Partition Walls (Cubicles)/S12	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E08 - Music Learning Space (84.6 m2)						
No Asbestos						
B00A - R2E09 - General Learning Space (52.33 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2E10 - General Learning Space (52.33 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2E11 - Commonroom (106.19 m2)						
No Asbestos						
B00A - R2E12 - Apparatus Store (24.95 m2)						
No Asbestos						
B00A - R2E13 - General Storeroom (5.75 m2)						
No Asbestos						
B00A - R2E14 - Chemical Store (9.34 m2)						
No Asbestos						
B00A - R2E15 - General Storeroom (9.4 m2)						
No Asbestos						
B00A - R2E16 - Distribution Board Cupboard (2.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8491/B00A/R1E08/Ceiling Structures/Linings/S10	3m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E17 - Plant (2.56 m2)						
Non Accessible						
B00A - R2E18 - Laboratory L.S. (88.76 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E19 - Preparation (53.07 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E20 - Laboratory L.S. (88.55 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2E21 - Lift (0.8 m2)						
No Asbestos						
B00A - R2E22 - Movement (260.24 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2N01 - General Learning Space (121.15 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2N02 - Cleaning Store - Distributed (2.33 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2N03 - General Storeroom (13.16 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2N04 - General Storeroom (11.83 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8491/B00A/R1W01/Floor Coverings Res/Textile/S2	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R2N05 - Main Area (218.18 m2)						
Ceiling Structures/Linings	Vermiculite 8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2N06 - Cleaning Store - Distributed (6.76 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N07 - Workroom (15.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N08 - Chair Store (29.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N09 - Interview/Office - Type 1 (14.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N10 - Interview/Office - Type 1 (14.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N11 - Audio Visual Workroom (29.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N12 - Workroom (15.51 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2N13 - Staff Study (16.95 m2)						
No Asbestos						
B00A - R2N16 - Uniform Shop (4.51 m2)						
No Asbestos						
B00A - R2N17 - Movement (155.61 m2)						
No Asbestos						
B00A - R2W01 - General Storeroom (28.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W02 - Staff - Toilet (5.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R2W02/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R2E04/Partition Walls (Cubicles)/S12				Chrysotile (white asbestos)	
B00A - R2W03 - Staff - Toilet (3.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R2W02/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R2E04/Partition Walls (Cubicles)/S12				Chrysotile (white asbestos)	
B00A - R2W04 - Toilets-Boys (14.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8491/B00A/R2W02/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R2E04/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)	
B00A - R2W05 - Toilets-Girls (15.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R2W02/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R2E04/Partition Walls (Cubicles)/S12					Chrysotile (white asbestos)	
B00A - R2W06 - Cleaning Store - Distributed (2.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1E08/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00A - R2W07 - Staff Study (28.12 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W08 - General Learning Space (51.11 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W09 - General Learning Space (51.69 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W10 - General Learning Space (50.82 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W11 - Computer Learning Space (84.68 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W12 - General Learning Space (52.12 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W13 - General Learning Space (52.11 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W14 - Duplicating Workroom (21.46 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8491/B00A/R1W01/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R2W15 - Staff Study (21.46 m2)						
Ceiling Structures/Linings	Vermiculite					
8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R2W16 - General Learning Space (52.63 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W17 - Interview/Office - Type 1 (52.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W18 - General Learning Space (51.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W19 - General Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W20 - General Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W21 - General Learning Space (51.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R2W22 - Plant (2.54 m2)						
No Asbestos						
B00A - R2W23 - Distribution Board Cupboard (2.54 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8491/B00A/R1E08/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00A - R2W24 - Movement (413.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	8491/B00A/R1S06/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Other - 2012 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00B - R0001 - Workshop Area (126.65 m2)

No Asbestos

B00B - R0002 - Dust Extraction Space (5.88 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017