


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Warialda High School (8519)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Gwydir

Initial Survey : Noel Arnold & Associates : 21 - May - 2008
Reviewed By : Greencap-NAA : 15 - May - 2015

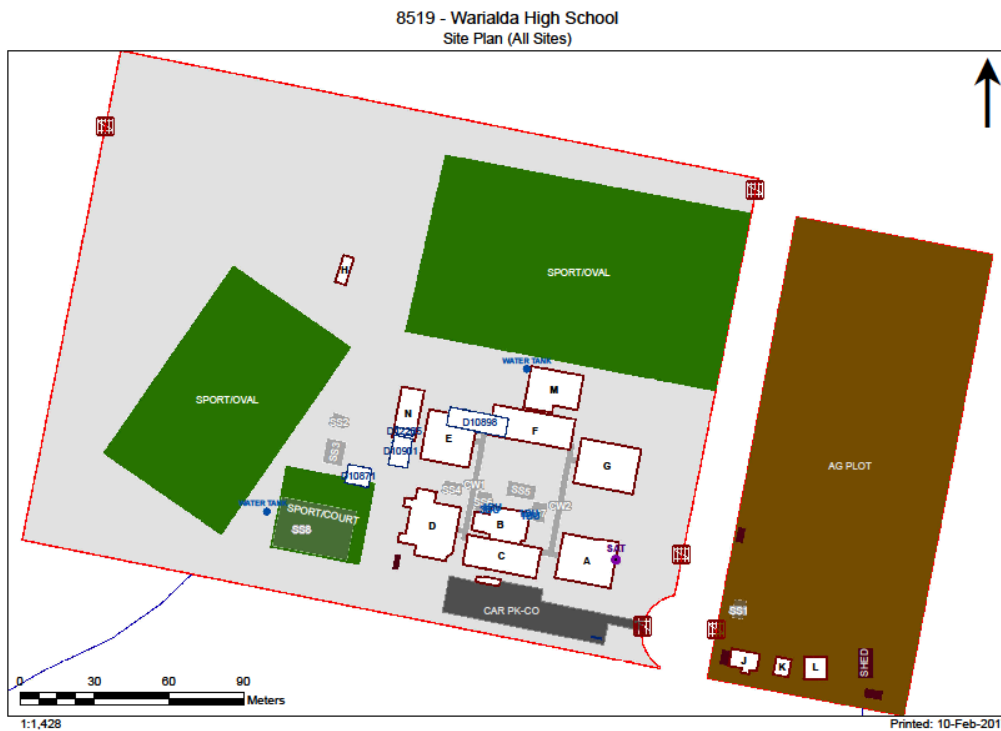

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Various - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	2m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Gable Verge Lining/S13				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00A - R0001 - Administration - Clerical**

No Asbestos

B00A - R0002 - Administration - Clerical

No Asbestos

B00A - R0003 - Staff - Toilet

In-fill-panel	Flat AC Sheeting	1m	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	

B00A - R0004 - Staff - Toilet

In-fill-panel	Flat AC Sheeting	1m	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	

Rope Lining to Incinerette	Rope Lining	1m	South	Friable Asbestos (5)	Medium (2)	Low Priority (2-3)
	8519/B00A/R0004/Rope Lining to Incinerette/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0005 - Duplicating Workroom

No Asbestos

B00A - R0006 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Electrical Backing Board/S6				Chrysotile (white asbestos)	

B00A - R0007 - General Storeroom

No Asbestos

B00A - R0008 - Deputy Principal Office

No Asbestos

B00A - R0009 - Movement

No Asbestos

B00A - R0012 - Resources Store

No Asbestos

B00A - R0013 - Senior Study

No Asbestos

B00A - R0014 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0015 - Clinic - Boys						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R0016 - Resources Store						
Non Accessible						
B00A - R0017 - Staff - Toilet						
No Asbestos						
B00A - R0018 - Principal Office						
No Asbestos						
B00A - R0019 - Resources Store						
No Asbestos						
B00A - R0020 - Cleaning Store - Distributed						
No Asbestos						
B00A - R0022 - General Learning Space - Type 1						
No Asbestos						
B00A - R0023 - Movement						
No Asbestos						
B00A - R0024 - External Movement						
No Asbestos						
B00A - R0025 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Multi Purpose Facilities - 1971 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00B/Gable Verge Lining/S17				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00B - R0001 - Multi-Purpose Space

No Asbestos

B00B - R0002 - Sport Equipment Store

Wall Linings Internal	Flat AC Sheeting	6m2	North	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8519/B00C/R0011/Wall Linings Internal/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1971 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/Gable Verge Lining/S14				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00C - R0002 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00C - R0003 - Student Canteen

Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00C - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00C - R0005 - Staff - Toilet

Rope Lining to Incinerette	Rope Lining	1m	South	Friable Asbestos (5)	Medium (2)	Low Priority (2-3)
	8519/B00A/R0004/Rope Lining to Incinerette/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0007 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00C - R0008 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Electrical Backing Board/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	

B00C - R0010 - Maintenance Bulk Store

No Asbestos

B00C - R0011 - Chair Store

Wall Linings Internal	Flat AC Sheeting	4m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0011/Wall Linings Internal/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0012 - Plant

No Asbestos

B00C - R0014 - Toilets-Disabled

No Asbestos

B00C - R0015 - Movement

No Asbestos

B00C - R0016 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00C - R0017 - External Movement						
No Asbestos						
B00C - R0018 - General Learning Space						
No Asbestos						
B00C - R0019 - Toilets-Girls						
Partition Walls (Cubicles)	Corrugated AC Sheeting					
	8519/B00C/R0013/Partition Walls (Cubicles)/S15					No Asbestos Detected
B00C - R0020 - Cleaning Store - Distributed						
No Asbestos						
B00C - R0021 - Chair Storeroom						
No Asbestos						
B00C - R0022 - Toilets-Boys						
Partition Walls (Cubicles)	Corrugated AC Sheeting					
	8519/B00C/R0013/Partition Walls (Cubicles)/S15					No Asbestos Detected
B00C - Room+1 - R 00 13						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0001/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
B00C - Room+2 - R 0014						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Technological & Applied Studies - 1971 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00D/Gable Verge Lining/S16					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	2m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Commonroom**

No Asbestos

B00D - R0002 - Staff - Toilet

No Asbestos

B00D - R0003 - Staff - Toilet

No Asbestos

B00D - R0004 - Welding Area

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00D - R0005 - Materials Store

No Asbestos

B00D - R0008 - Staff Study

No Asbestos

B00D - R0009 - Art Learning Space

Floor Coverings Res/Textile	Vinyl Tiles	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00D - R0010 - Resources Store

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00D - R0011 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Electrical Backing Board/S6					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00D - R0012 - Cleaning Store - Distributed

Non Accessible

B00D - R0014 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00D - R0015 - Dust Extraction Space

No Asbestos

B00D - R0016 - Welding Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0017 - Materials Technology L.S.						
No Asbestos						
B00D - R0018 - Movement						
No Asbestos						
B00D - R0019 - External Movement						
No Asbestos						
B00D - R0020 - Covered Area						
No Asbestos						
B00D - R0021 - T.A.S. Outdoor Area						
No Asbestos						
B00D - R0022 - Kiln Space						
No Asbestos						
B00D - Room+1 - D 0019						
No Asbestos						
B00D - Room+2 - D 0018						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00D - Room+3 - D 0017						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00D - Room+4 - D 00 16						
No Asbestos						
B00D - Room+5 - D 0015						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies - 1971 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00E/Gable Verge Lining/S18					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	1m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - General Learning Space

Floor Coverings Res/Textile	Vinyl Tiles	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0002 - Cleaning Store - Distributed

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0003 - Resource/Project Store

Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0004 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Electrical Backing Board/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00E - R0005 - Resources Store

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0006 - Food Technology L.S.

Floor Coverings Res/Textile	Vinyl Tiles	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0007 - Staff Study

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0008 - Apparatus Store

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00E - R0009 - Resources Store

No Asbestos

B00E - R0011 - General Learning Space

Floor Coverings Res/Textile	Vinyl Tiles	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0012 - Staff Study						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - R0015 - External Movement						
No Asbestos						
B00E - R0016 - General Storeroom						
No Asbestos						
B00E - R0017 - Movement						
No Asbestos						
B00E - R0018 - Toilets-Disabled						
No Asbestos						
B00E - Room+1 - E 00 15						
No Asbestos						
B00E - Room+2 - E 0014						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - Room+3 - E 00 15						
Electrical Backing Board	Resinous Board	1m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Electrical Backing Board/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Science - 1971 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00F/Gable Verge Lining/S19				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m2	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00F - R0001 - General Learning Space

No Asbestos

B00F - R0002 - Interview/Office - Type 1

In-fill-panel	Flat AC Sheeting	1m	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	

B00F - R0003 - Laboratory L.S.

No Asbestos

B00F - R0004 - Preparation

Floor Coverings Res/Textile	Vinyl Tiles	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00F - R0005 - Chemical Store

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00F - R0006 - Computer Learning Space

Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00F - R0007 - External Movement

No Asbestos

B00F - R0008 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Electrical Backing Board/S6				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1971 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00G/Gable Verge Lining/S20				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m2	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00G - R0001 - General Learning Space

No Asbestos

B00G - R0002 - Interview/Office - Type 1

In-fill-panel	Flat AC Sheeting	1m	East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/Panels Below Windows/S2				Chrysotile (white asbestos)	

B00G - R0003 - General Learning Space

No Asbestos

B00G - R0004 - General Learning Space

No Asbestos

B00G - R0005 - Stage

No Asbestos

B00G - R0006 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00C/R0008/Electrical Backing Board/S6				Chrysotile (white asbestos)	

B00G - R0007 - Resources Store

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00G - R0008 - Staff Study

No Asbestos

B00G - R0009 - General Learning Space

No Asbestos

B00G - R0010 - General Learning Space

No Asbestos

B00G - R0011 - Cleaning Store - Distributed

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00G - R0012 - Resources Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00A/R0015/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00G - R0013 - Resources Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00G - R0015 - Movement						
No Asbestos						
B00G - R0016 - External Movement						
No Asbestos						
B00G - R9001 - Cleaning Supplies Store						
No Asbestos						
B00G - Room+1 - G 00 15						
Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00A/R0015/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - Storage - 1971 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0001/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00H - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0001/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	2m2	West, Upper portion	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8519/B00H/R0005/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0001/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	6m2	Variable positions	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8519/B00H/R0005/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0001/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, Upper portion	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8519/B00H/R0005/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0001/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	1m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0005/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8519/B00H/R0001/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	1m2	South, Upper portion	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8519/B00H/R0005/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Agricultural Science - 1971 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00J - R0001 - Staff - Toilet

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0002 - Class Tools Storage

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0003 - Machine Storage

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0004 - Staff - Toilet

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

Boxing	Flat AC Sheeting 8519/B00J/R0004/Boxing/S12					No Asbestos Detected
--------	--	--	--	--	--	-----------------------------

B00J - R0005 - Agriculture Covered Area

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8519/B00C/R0008/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

B00J - R0006 - Materials Store

No Asbestos

B00J - Room+1 - J 006

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Agricultural Science - 2006 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Machine Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Agricultural Science - 2006 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Agriculture Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - General Learning Space

No Asbestos

B00M - R0002 - Science Laboratory

No Asbestos

B00M - R0003 - Preparation - Science

No Asbestos

B00M - R0004 - Staff Study

No Asbestos

B00M - R0005 - Seminar - Type 1

No Asbestos

B00M - R0006 - Chemical Store

No Asbestos

B00M - R0007 - Senior Seminar

No Asbestos

B00M - R0008 - Movement

No Asbestos

B00M - R0009 - External Movement

No Asbestos

B00M - R0010 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Multi Purpose Facilities - 2010 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - General Learning Space

No Asbestos

B00N - R0002 - Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10871 - Learning Unit - Standard/Withdrawal : Placement Date - 27/04/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 535 - D10898 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	28.8 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2
---------	---------------	------------------	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos	90 m2
---------	---------------	------------------	-------

R8 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	14 m2

OS 730 - D10901 - Needlework Textile Learning/Str/Fitting : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Classroom						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				73 m2
R2 - Fitting room						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R3 - Materials Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 759 - D12205 - Darkroom : Placement Date - 10/10/1997						
Exterior						
No Asbestos Found.						
Interior						
R1 - Darkroom Space						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017