


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wiley Park Girls High School (8888)  
**Region :** South Western Sydney  
**State Electorate :** Lakemba  
**Local Government Area :** Canterbury

**Initial Survey :** Noel Arnold & Associates : 04 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 11 - Sep - 2015

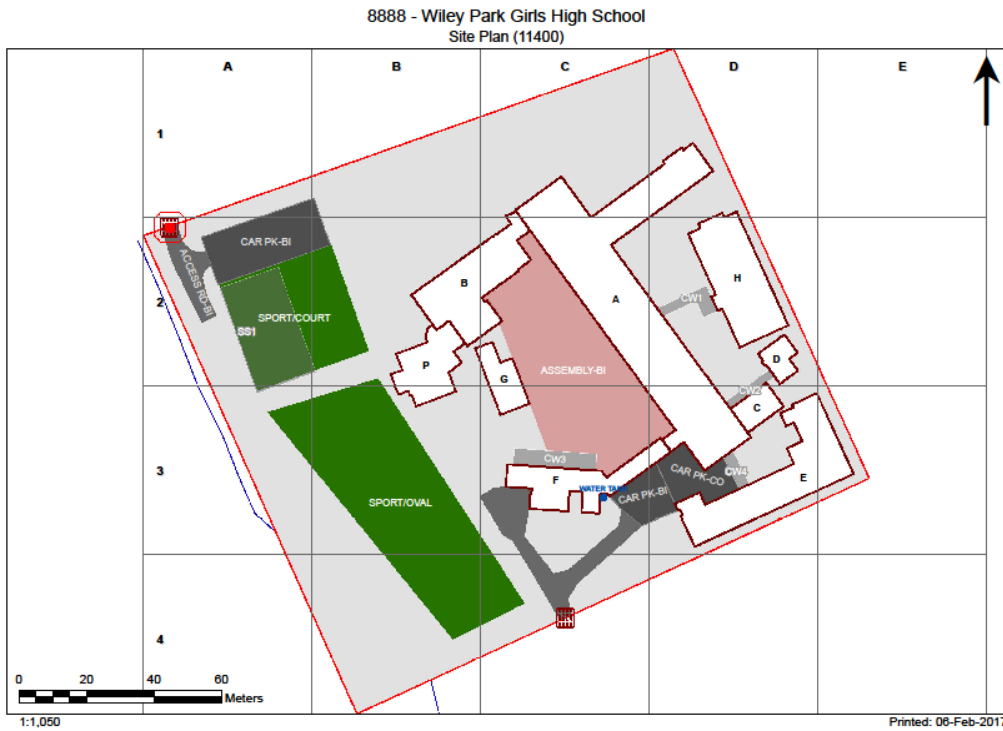

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - Administration/Various - 1957 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	300m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00A/Eaves Linings/S21			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Voids	Flat AC Sheeting Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	8888/B00A/Ceiling Voids/S22			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Voids	Flat AC Sheeting Pipe	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	8888/B00A/Ceiling Voids/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	Flat AC Sheeting Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	8888/B00A/Underfloor Voids/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Underfloor Voids	Flat AC Sheeting Pipe	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00A/Underfloor Voids/S25			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Underfloor Voids	Packing	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00A/Underfloor Voids/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**Interior****B00A - R0001 - Staff Study (45.17 m2)**

No Asbestos

**B00A - R0002 - Staff Study (29.35 m2)**

No Asbestos

**B00A - R0003 - Movement (17.38 m2)**

No Asbestos

**B00A - R0004 - General Storeroom (4.14 m2)**

No Asbestos

**B00A - R0005 - General Storeroom (24.71 m2)**

No Asbestos

**B00A - R0006 - Staff - Toilet (5.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00A/R0006/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Structures/Linings	Packing around pipework - Flat AC Sheet	1m2	Within ceiling void	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	8888/B00A/R0021/Ceiling Structures/Linings/S28			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**B00A - R0007 - General Storeroom (15.04 m2)**

No Asbestos

**B00A - R0013 - General Learning Space (65.07 m2)**

No Asbestos

**B00A - R0014 - General Storeroom (2.05 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00A/R0015/Ceiling Structures/Linings/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0015 - General Storeroom (11.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00A/R0015/Ceiling Structures/Linings/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0016 - General Storeroom (2.03 m2)</b>						
No Asbestos						
<b>B00A - R0017 - General Learning Space (49.56 m2)</b>						
No Asbestos						
<b>B00A - R0018 - General Storeroom (9.86 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Staff Study (31.2 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Cleaning Store - Distributed (4.12 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Staff - Toilet (5.29 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00A/R0006/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Structures/Linings	Packing Around Pipework- Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
8888/B00A/R0021/Ceiling Structures/Linings/S28				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
<b>B00A - R0022 - General Storeroom (7.27 m2)</b>						
No Asbestos						
<b>B00A - R0023 - General Storeroom (5.14 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Staff - Toilet (4.26 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Staff - Toilet (5.17 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Administration - Clerical (14.67 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Principal Office (19.29 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Administration - Clerical (15.44 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Administration - Clerical (15.27 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Staff - Toilet (4.31 m2)</b>						
No Asbestos						
<b>B00A - R0031 - Clinic - Girls (22.67 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Clinic-Toilets (4.15 m2)</b>						
No Asbestos						
<b>B00A - R0033 - Maintenance Bulk Store (4.48 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	<b>B00A - R0034 - Distribution Board Cupboard (0.76 m2)</b>				Note: No inspection of live electrical installation.	
	No Asbestos					
	<b>B00A - R0035 - Deputy Principal Office (13.92 m2)</b>					
	No Asbestos					
	<b>B00A - R0036 - Staff Study (14.16 m2)</b>					
	No Asbestos					
	<b>B00A - R0037 - General Storeroom (24.74 m2)</b>					
	No Asbestos					
	<b>B00A - R0038 - Commonroom (65.5 m2)</b>					
	No Asbestos					
	<b>B00A - R0039 - Staff Kitchen (9.03 m2)</b>					
	No Asbestos					
	<b>B00A - R0040 - Secure Storeroom (7.59 m2)</b>					
	No Asbestos					
	<b>B00A - R0041 - Distribution Board Cupboard (0.6 m2)</b>				Note: No inspection of live electrical installation.	
	No Asbestos					
	<b>B00A - R0042 - General Learning Space (65.7 m2)</b>					
	No Asbestos					
	<b>B00A - R0043 - Design L.S. (65.04 m2)</b>					
	No Asbestos					
	<b>B00A - R0044 - General Storeroom (8.92 m2)</b>					
	No Asbestos					
	<b>B00A - R0045 - General Storeroom (8.4 m2)</b>					
	No Asbestos					
	<b>B00A - R0046 - Design L.S. (65.29 m2)</b>					
	No Asbestos					
	<b>B00A - R0047 - General Learning Space (51.45 m2)</b>					
	No Asbestos					
	<b>B00A - R0048 - Distribution Board Cupboard (0.6 m2)</b>				Note: No inspection of live electrical installation.	
	No Asbestos					
	<b>B00A - R0054 - Duplicating Workroom (49.19 m2)</b>					
	No Asbestos					
	<b>B00A - R0055 - General Learning Space (49.07 m2)</b>					
	No Asbestos					
	<b>B00A - R0056 - General Learning Space (49.84 m2)</b>					
	No Asbestos					
	<b>B00A - R0057 - General Learning Space (49.56 m2)</b>					
	No Asbestos					
	<b>B00A - R0058 - Staff Study (7.75 m2)</b>					
	No Asbestos					
	<b>B00A - R0059 - Staff Study (16.89 m2)</b>					
	No Asbestos					
	<b>B00A - R0060 - Stairs (12.25 m2)</b>					
	No Asbestos					
	<b>B00A - R0061 - General Storeroom (3.3 m2)</b>					
	No Asbestos					
	<b>B00A - R0062 - General Storeroom (2.1 m2)</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	<b>B00A - R0063 - External Movement (1.57 m2)</b>					
	No Asbestos					
	<b>B00A - R0064 - External Movement (1.55 m2)</b>					
	No Asbestos					
	<b>B00A - R0065 - Movement (389.89 m2)</b>					
	No Asbestos					
	<b>B00A - R0066 - Interview/Meeting (8.34 m2)</b>					
	No Asbestos					
	<b>B00A - R0067 - Movement (28.3 m2)</b>					
	No Asbestos					
	<b>B00A - R0068 - External Movement (1.78 m2)</b>					
	No Asbestos					
	<b>B00A - R0069 - External Movement (1.81 m2)</b>					
	No Asbestos					
	<b>B00A - R0070 - Cleaning Store - Distributed (2.81 m2)</b>					
	No Asbestos					
	<b>B00A - R0071 - Stairs (8.34 m2)</b>					
	No Asbestos					
	<b>B00A - R0072 - External Movement (2.26 m2)</b>					
	No Asbestos					
	<b>B00A - R0073 - External Movement (1.84 m2)</b>					
	No Asbestos					
	<b>B00A - R0074 - External Movement (1.82 m2)</b>					
	No Asbestos					
	<b>B00A - R0075 - Stairs (8.58 m2)</b>					
	No Asbestos					
	<b>B00A - R0076 - Cleaning Store - Distributed (3.46 m2)</b>					
	No Asbestos					
	<b>B00A - R0077 - Stairs (8.78 m2)</b>					
	No Asbestos					
	<b>B00A - R0078 - Cleaning Store - Distributed (5.65 m2)</b>					
	No Asbestos					
	<b>B00A - R0079 - Movement (23.36 m2)</b>					
	No Asbestos					
	<b>B00A - R0080 - Food Technology L.S. (105.04 m2)</b>					
	No Asbestos					
	<b>B00A - R0081 - Pantry (10.56 m2)</b>					
	No Asbestos					
	<b>B00A - R0082 - Store (16.62 m2)</b>					
	No Asbestos					
	<b>B00A - R0083 - Other (27.09 m2)</b>					
	No Asbestos					
	<b>B00A - R1001 - Interview/Office - Type 1 (18.07 m2)</b>					
	No Asbestos					
	<b>B00A - R1002 - Special Learning Space (19.9 m2)</b>					
	No Asbestos					
	<b>B00A - R1003 - General Learning Space (29.94 m2)</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R1004 - Toilets-Girls (5.79 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Duplicating Workroom (11.96 m2)</b>						
No Asbestos						
<b>B00A - R1006 - General Learning Space (57.66 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Preparation (14.43 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Laboratory L.S. (50.07 m2)</b>						
No Asbestos						
<b>B00A - R1010 - Preparation (16.65 m2)</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Presumed Behind Tiles Cannot</b>						
Electrical Backing Board	Resinous Board	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00A/R1010/Electrical Backing Board/S29					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1011 - Laboratory L.S. (89.92 m2)</b>						
No Asbestos						
<b>B00A - R1012 - General Storeroom (11.35 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Toilets-Girls (11.12 m2)</b>						
No Asbestos						
<b>B00A - R1016 - Staff Study (11.82 m2)</b>						
No Asbestos						
<b>B00A - R1017 - Computer Learning Space (46.62 m2)</b>						
No Asbestos						
<b>B00A - R1018 - General Storeroom (5.2 m2)</b>						
No Asbestos						
<b>B00A - R1019 - Study Space (32.63 m2)</b>						
No Asbestos						
<b>B00A - R1020 - Staff Study (86.04 m2)</b>						
No Asbestos						
<b>B00A - R1021 - Movement (12.6 m2)</b>						
No Asbestos						
<b>B00A - R1022 - Staff Study (7.54 m2)</b>						
No Asbestos						
<b>B00A - R1023 - Staff Study (11.53 m2)</b>						
No Asbestos						
<b>B00A - R1024 - Senior Seminar (15.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00A/R1024/Floor Coverings Res/Textile/S19					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1025 - Distribution Board Cupboard (0.85 m2)</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00A - R1026 - General Storeroom (26.34 m2)</b>						
No Asbestos						
<b>B00A - R1027 - General Learning Space (49.11 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1028 - General Learning Space (51.05 m2)</b>						
No Asbestos						
<b>B00A - R1029 - General Learning Space (49.83 m2)</b>						
No Asbestos						
<b>B00A - R1030 - Senior Seminar (16.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00A/R1024/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
<b>B00A - R1031 - General Learning Space (49.98 m2)</b>						
No Asbestos						
<b>B00A - R1032 - General Learning Space (50.12 m2)</b>						
No Asbestos						
<b>B00A - R1033 - General Learning Space (50.19 m2)</b>						
No Asbestos						
<b>B00A - R1034 - General Learning Space (52.02 m2)</b>						
No Asbestos						
<b>B00A - R1035 - Darkroom Space (22.35 m2)</b>						
No Asbestos						
<b>B00A - R1036 - Darkroom Space (6.64 m2)</b>						
No Asbestos						
<b>B00A - R1037 - General Storeroom (29.78 m2)</b>						
No Asbestos						
<b>B00A - R1038 - General Learning Space (50.42 m2)</b>						
No Asbestos						
<b>B00A - R1039 - General Learning Space (50.12 m2)</b>						
No Asbestos						
<b>B00A - R1040 - General Learning Space (49.26 m2)</b>						
No Asbestos						
<b>B00A - R1041 - General Learning Space (50.92 m2)</b>						
No Asbestos						
<b>B00A - R1042 - Staff Study (26.41 m2)</b>						
No Asbestos						
<b>B00A - R1045 - General Learning Space (21.58 m2)</b>						
No Asbestos						
<b>B00A - R1046 - General Learning Space (66.69 m2)</b>						
No Asbestos						
<b>B00A - R1047 - Stairs (14.1 m2)</b>						
No Asbestos						
<b>B00A - R1048 - Stairs (13.85 m2)</b>						
No Asbestos						
<b>B00A - R1049 - Staff Study (32.17 m2)</b>						
No Asbestos						
<b>B00A - R1050 - Movement (355.59 m2)</b>						
No Asbestos						
<b>B00A - R1051 - Stairs (13.62 m2)</b>						
No Asbestos						
<b>B00A - R1052 - Stairs (12.05 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - Other - 1957 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	150m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00B/Eaves Linings/S30				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	Flat AC Sheeting Packing	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00B/Underfloor Voids/S31				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	Flat AC Sheeting Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00B/Underfloor Voids/S32				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	Flat AC Sheeting Infill Panels				<b>No Asbestos Detected</b>	
	8888/B00B/Underfloor Voids/S33					
Ceiling Voids	No Asbestos Found					

**Interior****B00B - R0001 - Public Entry (44.9 m2)**

No Asbestos

**B00B - R0002 - Interview/Office - Type 1 (11.2 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00B/R9001/Ceiling Structures/Linings/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0003 - Control Room (6.63 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00B/R9001/Ceiling Structures/Linings/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0004 - Sport Equipment Store (13.08 m2)**

No Asbestos

**B00B - R0005 - Multi-Purpose Space (276.19 m2)**

No Asbestos

**B00B - R0006 - Stage (71.63 m2)**

No Asbestos

**B00B - R0007 - Movement (21.01 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00B/R9001/Ceiling Structures/Linings/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0008 - Shower/Change (40.83 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00B/R9001/Ceiling Structures/Linings/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0009 - Shower/Change (40.03 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00B/R9001/Ceiling Structures/Linings/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0010 - External Movement (7.94 m2)**

No Asbestos

**B00B - R9001 - Cleaning Supplies Store (60.43 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00B/R9001/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00B - R9002 - Plant (15.32 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Technological & Applied Studies - 1972 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00C/Eaves Linings/S34				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Access Panel	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	8888/B00C/Ceiling Access Panel/S35					
Ceiling Voids - Flat Roof	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	8888/B00C/Ceiling Voids - Flat Roof/S36					
Underfloor Voids	Debris				<b>No Asbestos Detected</b>	
	8888/B00C/Underfloor Voids/S38					
Ceiling Voids	Moulded AC sheet debris	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	8888/B00C/Moulded AC/S37				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**Interior****B00C - R0001 - Food Technology L.S. (91.86 m2)**

Ceiling Structures/Linings	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	8888/B00C/R0001/Ceiling Structures/Linings/S12					

**B00C - R0002 - Laundry (8.74 m2)**

Ceiling Structures/Linings	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	8888/B00C/R0001/Ceiling Structures/Linings/S12					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00D/Eaves Linings/S39				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00D/Underfloor Voids/S40				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**Interior**

**B00D - R0001 - Staff Study (12.81 m2)**

No Asbestos

**B00D - R0002 - Staff Study (5.8 m2)**

No Asbestos

**B00D - R0004 - General Learning Space (61.71 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - Science/Various - 1972 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00E/Eaves Linings/S41					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - No Access To Void					
Underfloor Voids	Corragated AC Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00E/Underfloor Voids/S42					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	Redundant Moulded AC Vents	2m	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	8888/B00E/Redundant Vents/S44					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	Redundant Electrical Backing Boards	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00E/Redundant/S43					<b>Chrysotile (white asbestos)</b>

**Interior****B00E - R0001 - Chemical Store (9.09 m2)**

Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00E - R0002 - Preparation (29.38 m2)**

Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00E - R0004 - Apparatus Store (63.92 m2)**

Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00E/R0006/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

**B00E - R0009 - General Storeroom (10.86 m2)**

Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

<b>B00E - R0014 - Distribution Board Cupboard (0.62 m2)</b>	Note: No inspection of live electrical installation.					
---	--	--	--	--	--	--

No Asbestos

**B00E - R0015 - Staff - Toilet (4.15 m2)**

No Asbestos

**B00E - R0017 - Cleaning Store - Distributed (6.13 m2)**

No Asbestos

<b>B00E - R0018 - Distribution Board Cupboard (0.6 m2)</b>	Note: No inspection of live electrical installation.					
--	--	--	--	--	--	--

No Asbestos

<b>B00E - R0019 - Distribution Board Cupboard (0.45 m2)</b>	Note: No inspection of live electrical installation.					
---	--	--	--	--	--	--

No Asbestos

**B00E - R0020 - External Movement (18.81 m2)**

No Asbestos

**B00E - R0021 - Main Switchroom (7.47 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8888/B00E/R0021/Electrical Backing Board/S45					<b>Chrysotile (white asbestos)</b>	

**B00E - R0022 - Science Laboratory (46.15 m2)**

No Asbestos

**B00E - R0023 - General Learning Space - Type 3 (44.64 m2)**

No Asbestos

**B00E - R0024 - Stairs (15.91 m2)**

No Asbestos

**B00E - R0025 - General Learning Space - Type 3 (40.32 m2)**

No Asbestos

**B00E - R0026 - Science Laboratory (44.57 m2)**

No Asbestos

**B00E - R0027 - Movement (22.57 m2)**

No Asbestos

**B00E - R0028 - External Movement (53.15 m2)**

No Asbestos

**B00E - R0029 - Preparation (38.81 m2)**

No Asbestos

**B00E - R0030 - Science Laboratory (45.58 m2)**

No Asbestos

**B00E - R0031 - General Learning Space - Type 3 (40.1 m2)**

No Asbestos

**B00E - R0032 - Laboratory L.S. (77.98 m2)**

No Asbestos

**B00E - R0033 - Movement (20.71 m2)**

No Asbestos

**B00E - R0034 - Movement (8.85 m2)**

No Asbestos

**B00E - R0035 - Stairs (5.12 m2)**

No Asbestos

**B00E - R1001 - General Storeroom (9.61 m2)**

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>	

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00E - R1002 - Staff - Toilet (3.24 m2)**

No Asbestos

**B00E - R1003 - General Learning Space (50.84 m2)**

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East, West, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>	

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00E - R1004 - General Learning Space (51.56 m2)**

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>	

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	East, West, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R1005 - General Learning Space (53.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East, West, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Remains</i>
<b>B00E - R1006 - General Storeroom (5.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R1007 - Computer Store (5.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R1008 - Computer Learning Space (50.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North, South, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Remains</i>
<b>B00E - R1009 - Staff Study (39.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R1010 - Music Learning Space (63.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R1011 - Music Store (27.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R1012 - Music Learning Space (77.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R1013 - Computer Learning Space (51.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North, South, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Remains</i>
<b>B00E - R1014 - Distribution Board Cupboard (1.28 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00E - R1015 - Movement (112.76 m2)</b>						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	West, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Remains</i>
<b>B00E - R1016 - Cleaning Store - Distributed (6.15 m2)</b>						
No Asbestos						
<b>B00E - R1017 - Distribution Board Cupboard (0.62 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00E - R1018 - Distribution Board Cupboard (0.61 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00E - R1019 - Staff Study (10.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1020 - Stairs (15.92 m2)</b>						
No Asbestos						
<b>B00E - R1021 - Stairs (16.84 m2)</b>						
No Asbestos						
<b>B00E - R2001 - Cleaning Store - Distributed (5.68 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00E/R2001/Ceiling Structures/Linings/S46					Chrysotile (white asbestos)
<b>B00E - R2002 - Distribution Board Cupboard (0.59 m2)</b>				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8888/B00E/R2002/Ceiling Structures/Linings/S47					Chrysotile (white asbestos)
<b>B00E - R2003 - Computer Learning Space (70.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2004 - General Storeroom (5.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2005 - General Storeroom (5.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2006 - General Learning Space (55.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North, South, Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						
<b>B00E - R2007 - Resources Store (11.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2008 - Art Learning Space (53.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North, South, Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						
<b>B00E - R2009 - Art Learning Space (72.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8888/B00E/R0013/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	South, East, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						

**B00E - R2010 - Resources Store (7.39 m2)**

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R2011 - Resources Store (7.45 m2)**

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R2012 - Art Learning Space (71.9 m2)**

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South, East, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						

**B00E - R2013 - Staff Study (27.08 m2)**

Ceiling Structures/Linings	Vermiculite					
8888/B00E/R0013/Ceiling Structures/Linings/S7						<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R2014 - Distribution Board Cupboard (1.28 m2)** Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8888/B00E/R2014/Ceiling Structures/Linings/S11						<b>Chrysotile (white asbestos)</b>

**B00E - R2015 - Movement (86.37 m2)**

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	West, Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Remains</b>						

**B00E - R2016 - Stairs (16.89 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B00E - R2017 - Stairs (15.94 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1957 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	80m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/Eaves Linings/S48				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00F/Ceiling Voids/S49				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	Non Accessible Area - No Void					

**Interior****B00F - R0002 - No Access (3.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0002/Ceiling Structures/Linings/S50				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00F - R0003 - External Movement (131.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	132m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0003/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00F - R0004 - Student Canteen (57.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0003/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00F - R0005 - Movement (1.48 m2)**

No Asbestos

**B00F - R0006 - Staff - Toilet (5.29 m2)**

No Asbestos

**B00F - R0007 - General Storeroom (5.42 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0003/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00F - R0008 - Sport Equipment Store (23.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0003/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00F - R0009 - Sport Equipment Store (13.96 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0003/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

In-fill-panel	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8888/B00F/R0009/In-fill-panel/S6					

**B00F - R0010 - General Assistants (7.15 m2)**

No Asbestos

**B00F - R0011 - Staff - Toilet (4.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00F/R0003/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0012 - Handwashing Facilities (26.24 m2)</b>						
No Asbestos						
<b>B00F - R0013 - Toilets - Girls (44.31 m2)</b>						
No Asbestos						
<b>B00F - R0014 - General Storeroom (26.67 m2)</b>						
No Asbestos						
<b>B00F - R0015 - Movement (1.81 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities/Art - 1972 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	80m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00G/Eaves Linings/S51				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Access Panel	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	8888/B00G/Ceiling Access Panel/S52					
Ceiling Voids	Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8888/B00G/Ceiling Voids/S53				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**Interior****B00G - R0001 - Movement (54.91 m2)**

No Asbestos

**B00G - R0002 - Art Learning Space (55.35 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00G/R0003/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>	

**B00G - R0003 - Toilets-Girls (41.99 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet				<b>No Asbestos Detected</b>	
	8888/B00G/R0003/Partition Walls (Cubicles)/S2					
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00G/R0003/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>	

**B00G - R0004 - Cleaning Store - Distributed (1 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8888/B00G/R0003/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00H - Library - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

**Interior****B00H - R0001 - Workroom (36.82 m2)**

No Asbestos

**B00H - R0002 - Audio Visual Workroom (26.93 m2)**

No Asbestos

**B00H - R0003 - Seminar (14.63 m2)**

No Asbestos

**B00H - R0004 - Seminar (11.61 m2)**

No Asbestos

**B00H - R0005 - Seminar (12.35 m2)**

No Asbestos

**B00H - R0006 - Distribution Board Cupboard (0.73 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0007 - Staff - Toilet (3.9 m2)**

No Asbestos

**B00H - R0008 - Pupil Entry (9.84 m2)**

No Asbestos

**B00H - R0009 - Librarian (10.74 m2)**

No Asbestos

**B00H - R0010 - Main Area (436.18 m2)**

No Asbestos

**B00H - R0011 - External Movement (2.63 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Performing Arts - 1993 - Brick/Steel Frame (Brick/Steel Frame)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00P - R0001 - Movement (39.5 m2)**

No Asbestos

**B00P - R0002 - Staff Study (15.94 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00P - R0003 - Performance Workspace (162.19 m2)**

No Asbestos

**B00P - R0004 - Performing Arts Store (8.98 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00P - R0005 - Performing Arts Store (11.84 m2)**

No Asbestos

**B00P - R0006 - Performing Arts Store (31.96 m2)**

No Asbestos

**B00P - R0007 - Stairs (1.29 m2)**

No Asbestos

**B00P - R0008 - Cleaning Store - Distributed (5.94 m2)**

No Asbestos

**B00P - R0009 - External Movement (11.35 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017