

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ashford Central School (1066)


Region : New England

State Electorate : Northern Tablelands

Local Government Area : Inverell

Initial Survey : Noel Arnold & Associates : 20 - May - 2008

Reviewed By : Greencap-NAA : 09 - Feb - 2017

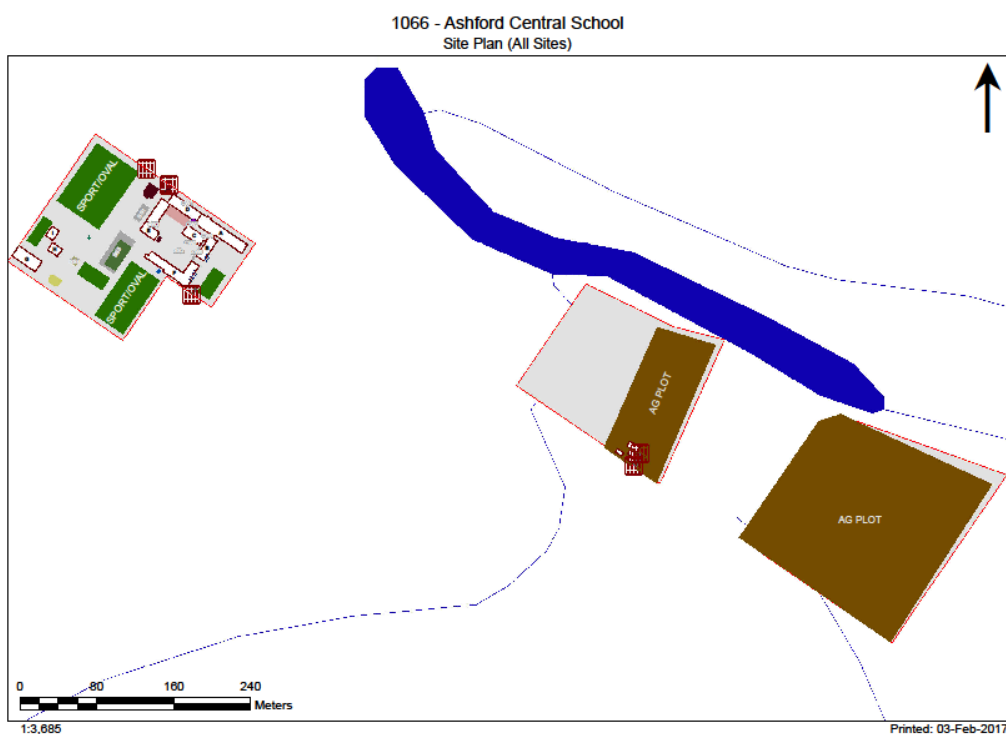

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00A - Administration/Science - 1972 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00A/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Interior						
B00A - R0005 - Chemical Store						
No Asbestos						
B00A - R0006 - Botany/Zoology						
No Asbestos						
B00A - R0007 - Staff Room Annexe						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1066/B00A/R0007/Floor Coverings Res/Textile/S14					
	No Asbestos Detected					
B00A - R0008 - General Learning Space						
No Asbestos						
B00A - R0012 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2					
	Chrysotile (white asbestos)					
B00A - R0013 - Main Switch Board						
Wall Linings Internal	Flat AC Sheeting					
	1066/B00A/R0013/Wall Linings Internal/S3					
	No Asbestos Detected					
B00A - R0015 - Clerical Office						
No Asbestos						
B00A - R0016 - Staff Kitchen						
No Asbestos						
B00A - R0017 - Toilets-Disabled						
Wall Linings Internal	Flat AC Sheeting					
	1066/B00A/R0017/Wall Linings Internal/S13					
	No Asbestos Detected					
B00A - R0018 - Clinic						
No Asbestos						
B00A - R0019 - Principal Office						
No Asbestos						
B00A - R0020 - Deputy Principal						
No Asbestos						
B00A - R0021 - Movement						
No Asbestos						
B00A - R0022 - Administration - Clerical						
No Asbestos						
B00A - R0023 - Movement						
No Asbestos						
B00A - R0024 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
	1066/B00A/R0024/Ceiling Structures/Linings/S11					
	No Asbestos Detected					
Ceiling Structures/Linings	Flat AC Sheeting	110m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00A/Eaves Linings/S12					
	Chrysotile (white asbestos) , Amosite (brown asbestos)					
Wall Linings Internal	Infill panel					
	1066/B00A/R0024/Ceiling Structures/Linings/S11					
	No Asbestos Detected					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Wall Linings Internal	Flat AC Sheeting					
	1066/B00A/R0029/Wall Linings Internal/S15					No Asbestos Detected
B00A - R0025 - Main Switch Board						
No Asbestos						
B00A - R0026 - Staff - Toilet						
No Asbestos						
B00A - R0027 - Deputy Principal						
Floor Coverings	Vinyl Tiles (Under Floor					
Res/Textile	Covering/Carpet)					
	1066/B00A/R0007/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00A - R0028 - Preparation - Science						
No Asbestos						
B00A - R0029 - Laboratory L.S.						
Wall Linings Internal	Flat AC Sheeting					
	1066/B00A/R0029/Wall Linings Internal/S15					No Asbestos Detected

2017

B00B - Technological & Applied Studies/Staff Facilities - 1972 - Timber (Timber)

Exterior

No Asbestos

Interior

B00B - R0001 - General Storeroom

No Asbestos

B00B - R0002 - Staff Room Annexe

No Asbestos

B00B - R0003 - Staff Room Annexe

In-fill-panel	Flat AC Sheeting
---------------	------------------

1066/B00B/R0012/In-fill-panel/S5		No Asbestos Detected
B00B	B0004	Design L 6

Floor Coverings	Vinyl Sheet
Res/Textile	

Res/Textile	1066/B00B/R0004/Floor Coverings Res/Textile/S25	No Asbestos Detected
-------------	---	----------------------

No Asbestos Detected

No Asbestos

B00B - R0011 - Laundry

Ceiling Structures/Linings	Flat AC Sheeting	10.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	--------	------------	--------------------	---------	--------------------

1066/B00B/R0011/Ceiling Structures/Linings/S26 **Chrysotile (white asbestos)**

Chrysotile (white asbestos)

Upper infill panel above Flat AC Sheeting

door	1066/B00B/R0012/In-fill-panel/S5	No Asbestos Detected
------	----------------------------------	----------------------

No Asbestos Detected

In-fill-panel	Flat AC Sheeting
---------------	------------------

1066/B00B/R0012/In-fill-panel/S5	No Asbestos Detected
B00B - B0016 - Food Technology Lab C	

No Asbestos Detected

No Asbestos

B00B - R0014 - Preparation - Materials

No Asbestos

B00B - R0015 - Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Library/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1066/B00C/Eaves Linings/S22	40m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 1066/B00C/R0001/Ceiling Structures/Linings/S23	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 1066/B00B/R0012/In-fill-panel/S5					No Asbestos Detected
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Sealed unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

B00C - R0002 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting 1066/B00E/R0002/In-fill-panel/S6	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00C/R0002/Floor Coverings Res/Textile/S24	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0003 - Interview

No Asbestos

B00C - R0005 - Reading Area

Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Sealed unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
------------------	---	-------	--------------------	--------------------	---------	--------------------

B00C - R0006 - Seminar

No Asbestos

B00C - R0007 - Communications Room

No Asbestos

B00C - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0009 - Study Space

No Asbestos

B00C - R0010 - Computer Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - Staff Facilities/General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheetting	100m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/Eaves Linings/S18				Chrysotile (white asbestos)		

Interior**B00D - M0001 - General Storeroom**

No Asbestos

B00D - M0002 - Movement

No Asbestos

B00D - M0003 - General Storeroom

No Asbestos

B00D - M0004 - Movement

No Asbestos

B00D - M0005 - Stairs

No Asbestos

B00D - M0006 - Stairs

No Asbestos

B00D - R0001 - Sports Store

No Asbestos

B00D - R0002 - Movement

No Asbestos

B00D - R0005 - Staff Toilet

Ceiling Structures/Linings	Vermiculite					
1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected		

B00D - R0006 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0007 - Staff Toilet

Ceiling Structures/Linings	Vermiculite					
1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected		

B00D - R0010 - Staff Room

Ceiling Structures/Linings	Vermiculite					
1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected		

Thermacon Heater	Encapsulated Insulation material within unit	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00D - R0011 - Home Base

Ceiling Structures/Linings	Vermiculite					
1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1066/B00D/R0008/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

Thermacon Heater	Encapsulated Insulation material within unit	4Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00D - R0012 - Toilets - Boys/Girls

Ceiling Structures/Linings	Vermiculite					
1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected		

B00D - R0013 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Ceiling Structures/Linings	Vermiculite 1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00D - R0014 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Ceiling Structures/Linings	Vermiculite 1066/B00D/R0009/Ceiling Structures/Linings/S1				No Asbestos Detected	
B00D - R0015 - Cleaning Supplies						
No Asbestos						
B00D - R0016 - Movement						
No Asbestos						
B00D - R0017 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00D - R0018 - Distribution Board				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00D - R0019 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00D - R0020 - General Learning Space						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0021 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00D - R0022 - Music Store						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00D - R0023 - Music Learning Space						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0024 - Personal Effects Storage						
No Asbestos						
B00D - R0025 - Home Base Store						
No Asbestos						
B00D - R0026 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0027 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting 1066/B00D/R0027/Ceiling Structures/Linings/S17	60m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0028 - Staff Room						
Ceiling Structures/Linings	Vermiculite 1066/B00D/R0009/Ceiling Structures/Linings/S1					No Asbestos Detected
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0029 - Movement						
No Asbestos						
B00D - R0030 - Stairs						
No Asbestos						
B00D - R0031 - Stairs						
No Asbestos						
B00D - R1003 - Home Base						
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard Area inaccessible	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1004 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1005 - Distribution Board						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	0.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1006 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1007 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles 1066/B00D/R0008/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1008 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard Area inaccessible	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1009 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1066/B00D/R0008/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1010 - Home Base Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00D - R1011 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R0008/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00D - R1014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R1016/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	
B00D - R1015 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R1016/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	
B00D - R1016 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00D/R1016/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning - 1972 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction 3.2m					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00E - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/R0001/Ceiling Structures/Linings/S20			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Verandah lower infill	Flat AC Sheeting					
	1066/B00E/R0001/Verandah lower infill/S21			No Asbestos Detected		

B00E - R0002 - General Learning Space

In-fill-panel	Flat AC Sheeting	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/R0002/In-fill-panel/S6			Chrysotile (white asbestos)		

B00E - R0003 - General Learning Space

In-fill-panel	Flat AC Sheeting	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1066/B00E/R0003/In-fill-panel/S6			Chrysotile (white asbestos)		

B00E - R0007 - Handwashing Facilities

No Asbestos

B00E - R0008 - Store

No Asbestos

B00E - R0009 - Kiln Room

Kiln	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Technological & Applied Studies - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1066/B00F/R0020/Ceiling Structures/Linings/S9					No Asbestos Detected

Interior

B00F - R0005 - Distribution Board	Note: No inspection of live electrical installation.
--	--

No Asbestos

B00F - R0006 - Canteen

No Asbestos

B00F - R0007 - Canteen Office/Store

No Asbestos

B00F - R0008 - Canteen Office/Store

No Asbestos

B00F - R0009 - Staff Toilet

No Asbestos

B00F - R0014 - Toilets - Boys

No Asbestos

B00F - R0015 - Plant

No Asbestos

B00F - R0016 - Toilets - Girls

No Asbestos

B00F - R0017 - Toilets - Girls

No Asbestos

B00F - R0018 - Toilets - Boys

No Asbestos

B00F - R0019 - Cleaning Distributed Store

No Asbestos

B00F - R0020 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1066/B00F/R0020/Ceiling Structures/Linings/S9					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00F - R0021 - Staff Toilet

No Asbestos

B00F - R0022 - Access Staff Shower/Toilet

No Asbestos

B00F - R0023 - Staff Toilet

No Asbestos

B00F - R0024 - Shower/Change

No Asbestos

B00F - R0025 - Shower/Change

No Asbestos

B00F - R0026 - Workshop Area

Electrical risers	Flat AC Sheeting 1066/B00F/R0026/Electrical risers/S10					No Asbestos Detected
-------------------	---	--	--	--	--	----------------------

B00F - R0027 - Welding Area

No Asbestos

B00F - R0028 - Welding Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R0029 - Project Store - Type 1

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Multi Purpose Facilities/Other-Community Use - 1938 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height restricted 3.5 metre					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Infill panel	Flat AC Sheeting 1066/B00G/Infill panel/S30					No Asbestos Detected
Window frames	Putty 1066/B00G/Window frames/S31					No Asbestos Detected
Electrical Backing Board	Resinous Board 1066/B00G/Electrical Backing Board/S32					No Asbestos Detected

Interior

B00G - R0001 - Communal Space

Ceiling Structures/Linings	Non Accessible Area - Height Restriction - 3.5m
----------------------------	--

B00G - R0002 - Raised Platform

No Asbestos

B00G - R0003 - Movement

No Asbestos

B00G - R0004 - Communal/Performance Store

No Asbestos

B00G - R0005 - External Movement

No Asbestos

B00G - R0006 - Toilet - Lobby

Upper infill panel	Flat AC Sheeting 1066/B00G/R0009/Upper infill panel South/S28					No Asbestos Detected
--------------------	--	--	--	--	--	----------------------

B00G - R0007 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 1066/B00G/R0008/Wall Linings Internal/S29					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00G - R0008 - Disabled Toilet

Wall Linings Internal	Flat AC Sheeting 1066/B00G/R0008/Wall Linings Internal/S29					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00G - R0009 - Toilet - Lobby

Upper infill panel South	Flat AC Sheeting 1066/B00G/R0009/Upper infill panel South/S28					No Asbestos Detected
--------------------------	--	--	--	--	--	----------------------

B00G - R0010 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 1066/B00G/R0010/Wall Linings Internal/S27					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00G - R0011 - No Access

No Asbestos

B00G - R0012 - Stairs

No Asbestos

B00G - R0013 - Stairs

No Asbestos

B00G - R1001 - Communal/Performance Store

No Asbestos

B00G - R1002 - Stairs

No Asbestos

B00G - R9001 - Servery Covered Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - R9002 - Canteen

No Asbestos

B00G - R9003 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00H - Physical Education - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00H - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00I - Mechanical Services - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00I - R0001 - Garage/Carport**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Storage - 2005 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00J - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Storage - 2002 - Metal Shed (Metal Shed)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Electrical Backing Board	Resinous Board					
	1066/B00K/Electrical Backing Board/S33					No Asbestos Detected

Interior**B00K - R0001 - No Access**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00L - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00M - Storage - 2005 - Metal Shed (Metal Shed)**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior**B00M - R0001 - No Access**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables
There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017