


(Hazardous Materials and Risk Assessment)

School :	Dubbo South Public School (1811)
Region :	Western NSW
State Electorate :	Dubbo
Local Government Area :	Dubbo

Initial Survey :	Noel Arnold & Associates : 03 - Apr - 2008
Reviewed By :	Parsons Brinckerhoff : 09 - Nov - 2016

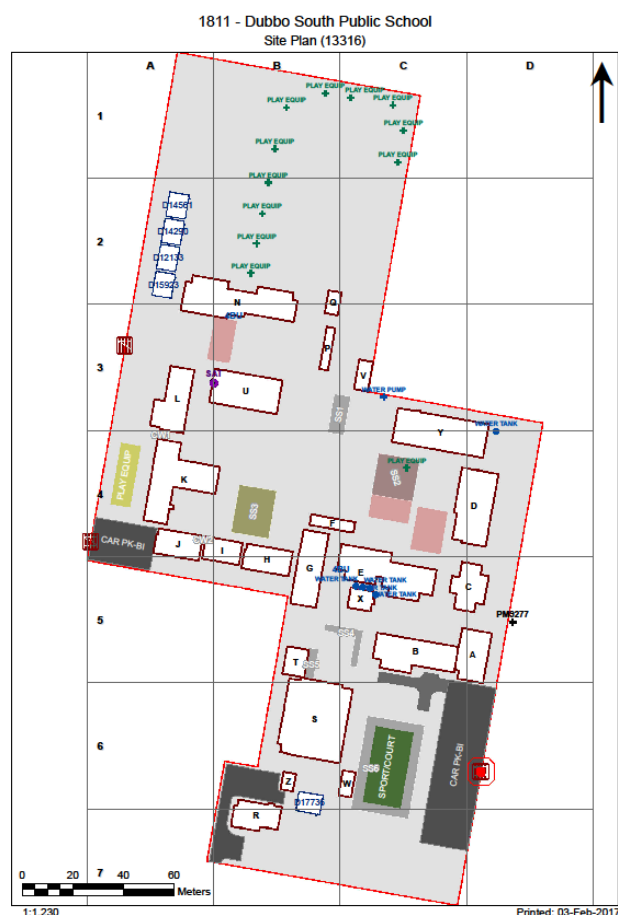

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration - 1941 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00A/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
In-fill-panel	Compressed AC Sheet	9m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00A/R0001/In-fill-panel/S2					Chrysotile (white asbestos)	

B00A - R0002 - Interview

No Asbestos

B00A - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Door backing	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00A/R0005/Door backing/S3					Chrysotile (white asbestos)	

B00A - R0011 - Sick Bay

No Asbestos

B00A - R0018 - Principal

No Asbestos

B00A - R0019 - Movement

No Asbestos

B00A - R0020 - Clerical Office

No Asbestos

B00A - R0021 - Duplicating Workroom

No Asbestos

B00A - R0022 - Disabled Toilet

No Asbestos

B00A - R0023 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00A/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
In-fill-panel	Compressed AC Sheet	4m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00A/R0001/In-fill-panel/S2					Chrysotile (white asbestos)	

B00A - R0024 - Toilet - Lobby

No Asbestos

B00A - R0025 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00B - General Learning - 1966 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 1811/B00B/Eaves Linings/S27	No Asbestos Detected				
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00B/R0001/Ceiling Structures/Linings/S4	Chrysotile (white asbestos)				
In-fill-panel	Compressed AC Sheet	18m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00A/R0001/In-fill-panel/S2	Chrysotile (white asbestos)				

B00B - R0004 - Home Base

No Asbestos

B00B - R0009 - Home Base Store

No Asbestos

B00B - R0010 - Home Base

No Asbestos

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Security Store

No Asbestos

B00B - R0013 - Deputy Principal

No Asbestos

B00B - R0014 - Deputy Principal

No Asbestos

B00B - R0015 - Special Programs Room - Type 1

No Asbestos

B00B - R0016 - Practical Activities - 1hb

No Asbestos

B00B - R0017 - Home Base Store

No Asbestos

B00B - R0018 - Withdrawal Space - 1hb

No Asbestos

B00B - R0019 - Practical Activities - 1hb

No Asbestos

B00B - R0020 - Distribution Board

Note: No inspection of live electrical installation.

Door backing	Flat AC Sheeting 1811/B00B/R0020/Door backing/S5	No Asbestos Detected				
--------------	---	----------------------	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00C - General Learning - 1974 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00C/Eaves Linings/S28				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00C - R0001 - Home Base**

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0005 - Home Base Store

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0009 - Practical Activities - 1hb

No Asbestos

B00C - R0010 - Practical Activities - 1hb

No Asbestos

B00C - R0011 - Withdrawal Space - 1hb

No Asbestos

B00C - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1811/B00C/R0012/Ceiling Structures/Linings/S7					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	1811/B00C/R0012/Wall Linings Internal/S8					No Asbestos Detected

B00C - R0013 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00D - General Learning - 1946 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	Non Accessible Area - No Access - No manhole in building

Interior**B00D - R0001 - Staff Room Annexe**

No Asbestos

B00D - R0002 - Security Store

No Asbestos

B00D - R0003 - Home Base

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Handwashing Facilities

No Asbestos

B00D - R0007 - Personal Effects Storage

No Asbestos

B00D - R0008 - Movement

No Asbestos

B00D - R0009 - External Movement

No Asbestos

B00D - R0013 - Movement

Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00D/R0015/Wall Linings Internal/S26					Chrysotile (white asbestos)	

B00D - R0014 - Movement

No Asbestos

B00D - R0015 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00D/R0015/Wall Linings Internal/S26					Chrysotile (white asbestos)	

B00D - R0016 - General Storeroom

No Asbestos

B00D - R0017 - Practical Activities - 1hb

No Asbestos

B00D - R0018 - Withdrawal Space - 1hb

No Asbestos

B00D - R0019 - Home Base Store

No Asbestos

B00D - R0020 - Main Switch Board

No Asbestos

B00D - R0021 - Covered Outdoor Learning Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00E/Eaves Linings/S29					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00E/Gable Verge Lining/S36					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00E - R0001 - Staff Toilet**

No Asbestos

B00E - R0002 - Cleaning Distributed Store

No Asbestos

B00E - R0003 - Staff Toilet

No Asbestos

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Home Base Store

No Asbestos

B00E - R0008 - Home Base Store

No Asbestos

B00E - R0009 - Home Base

No Asbestos

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0014 - Home Base Store

No Asbestos

B00E - R0015 - Home Base

No Asbestos

B00E - R0016 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00E/R0016/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00E - R0017 - Practical Activities - 1hb

No Asbestos

B00E - R0018 - Withdrawal Space - 1hb

No Asbestos

B00E - R0019 - Practical Activities - 1hb

No Asbestos

B00E - R0020 - Distribution Board

Note: No inspection of live electrical installation.

Door backing	Flat AC Sheeting					
	1811/B00E/R0020/Door backing/S10					No Asbestos Detected

B00E - R0021 - Practical Activities - 1hb

No Asbestos

B00E - R0022 - Practical Activities - 1hb

No Asbestos

B00E - R0023 - Withdrawal Space - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00F - General Learning - 1951 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00F/Wall Cladding/S13					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior**B00F - R0001 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00F/R0001/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00F - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00F/R0001/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00F - R0004 - Isolation Space

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00F/R0005/Ceiling Structures/Linings/S39					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	1811/B00F/R0005/Wall Linings Internal/S42	No Asbestos Detected

B00F - R0005 - Aboriginal Resource Centre

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00F/R0005/Ceiling Structures/Linings/S39					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	1811/B00F/R0005/Wall Linings Internal/S42	No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - Pupil Facilities - 1948 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00G/Eaves Linings/S30				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00G/Gable Verge Lining/S37				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00G - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00G/R0002/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		

B00G - R0004 - Covered Area

Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00G/R0002/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		

B00G - R0005 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting	125m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00G/R0005/Ceiling Structures/Linings/S40				Chrysotile (white asbestos)		

B00G - R0006 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00G/R0005/Ceiling Structures/Linings/S40				Chrysotile (white asbestos)		

B00G - R0007 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00G/R0005/Ceiling Structures/Linings/S40				Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00H - Staff Facilities/General Learning - 1970 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1811/B00H/Eaves Linings/S31	No Asbestos Detected				
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00H - R0003 - Staff Room Annexe**

No Asbestos

B00H - R0005 - Movement

No Asbestos

B00H - R0006 - Home Base

No Asbestos

B00H - R0008 - Movement

No Asbestos

B00H - R0009 - Toilet - Lobby

No Asbestos

B00H - R0010 - Staff Toilet

No Asbestos

B00H - R0011 - Toilet - Lobby

No Asbestos

B00H - R0012 - Staff Toilet

No Asbestos

B00H - R0013 - Staff Room

No Asbestos

B00H - R0014 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00I - General Learning - 1930 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1811/B00H/Eaves Linings/S31	No Asbestos Detected				
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00I - R0001 - General Storeroom**

No Asbestos

B00I - R0002 - Withdrawal Space - 1hb

No Asbestos

B00I - R0003 - Home Base

No Asbestos

B00I - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1970 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1811/B00H/Eaves Linings/S31	No Asbestos Detected				
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00J - R0001 - Home Base**

No Asbestos

B00J - R0002 - Home Base

No Asbestos

B00J - R0003 - General Storeroom

No Asbestos

B00J - R0004 - General Storeroom

No Asbestos

B00J - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00J/R0006/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00K - General Learning - 1970 - Concrete (Concrete)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00K - R0001 - Staff Room Annexe**

No Asbestos

B00K - R0002 - General Storeroom

No Asbestos

B00K - R0003 - General Storeroom

No Asbestos

B00K - R0004 - Toilets - Boys/Girls

No Asbestos

B00K - R0005 - Sick Bay

No Asbestos

B00K - R0006 - Movement

No Asbestos

B00K - R0007 - Home Base

No Asbestos

B00K - R0008 - Home Base

No Asbestos

B00K - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00K/R0009/Floor Coverings Res/Textile/S19						Chrysotile (white asbestos)

B00K - R0010 - Home Base Store

No Asbestos

B00K - R0011 - Movement

No Asbestos

B00K - R0012 - Personal Effects Storage

No Asbestos

B00K - R0013 - Toilet - P

No Asbestos

B00K - R0014 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																				
----------------------------	---------------------	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--

B00K - R0015 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet		No Asbestos Detected
1811/B00K/R0014/Partition Walls (Cubicles)/S18			

B00K - R0017 - Movement

No Asbestos

B00K - R0018 - Covered Outdoor Learning Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00L - General Learning - 1942 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	120m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00L/Eaves Linings/S32					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00L - R0001 - Special Programs Room**

No Asbestos

B00L - R0002 - Movement

No Asbestos

B00L - R0004 - Movement

No Asbestos

B00L - R0005 - Handwashing Facilities

No Asbestos

B00L - R0006 - Special Programs Room

No Asbestos

B00L - R0007 - Home Base

No Asbestos

B00L - R0008 - Staff Room Annexe

No Asbestos

B00L - R0009 - Movement

No Asbestos

B00L - R0010 - Movement

No Asbestos

B00L - R0011 - Staff Toilet

No Asbestos

B00L - R0013 - Main Switch Board

No Asbestos

B00L - R0014 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1811/B00N/Eaves Linings/S33	No Asbestos Detected				
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00N - R0001 - Withdrawal Space - 1hb**

No Asbestos

B00N - R0002 - Home Base

No Asbestos

B00N - R0003 - Home Base Store

No Asbestos

B00N - R0004 - Movement

No Asbestos

B00N - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00N/R0010/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0006 - Home Base

No Asbestos

B00N - R0007 - Withdrawal Space - 1hb

No Asbestos

B00N - R0008 - Home Base Store

No Asbestos

B00N - R0009 - Movement

No Asbestos

B00N - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1811/B00N/R0010/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00N - R0011 - Staff Toilet

No Asbestos

B00N - R0012 - Movement

Wall Linings Internal	Flat AC Sheeting 1811/B00N/R0014/Wall Linings Internal/S23	No Asbestos Detected				
-----------------------	---	----------------------	--	--	--	--

B00N - R0013 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 1811/B00N/R0014/Partition Walls (Cubicles)/S22	No Asbestos Detected				
----------------------------	---	----------------------	--	--	--	--

Wall Linings Internal	Flat AC Sheeting 1811/B00N/R0014/Wall Linings Internal/S23	No Asbestos Detected				
-----------------------	---	----------------------	--	--	--	--

B00N - R0014 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 1811/B00N/R0014/Partition Walls (Cubicles)/S22	No Asbestos Detected				
----------------------------	---	----------------------	--	--	--	--

Wall Linings Internal	Flat AC Sheeting 1811/B00N/R0014/Wall Linings Internal/S23	No Asbestos Detected				
-----------------------	---	----------------------	--	--	--	--

B00N - R0015 - Withdrawal Space - 1hb

No Asbestos

B00N - R0016 - Home Base

No Asbestos

B00N - R0017 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

No Asbestos

B00N - R0018 - Movement

No Asbestos

B00N - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

1811/B00N/R0010/Ceiling Structures/Linings/S21

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00N - R0020 - Home Base**

No Asbestos

B00N - R0021 - Withdrawal Space - 1hb

No Asbestos

B00N - R0022 - Home Base Store

No Asbestos

B00N - R0023 - Movement

No Asbestos

B00N - R0024 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

1811/B00N/R0010/Ceiling Structures/Linings/S21

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00N - R0025 - Practical Activities - 1hb**

No Asbestos

B00N - R0026 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0027 - Practical Activities - 1hb

No Asbestos

B00N - R0028 - Practical Activities - 1hb

No Asbestos

B00N - R0029 - Practical Activities - 1hb

No Asbestos

B00N - R0030 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0031 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00P - Shed - 1950 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00P - R0001 - Cleaning Distributed Store**

Ceiling Structures/Linings Flat AC Sheeting 22m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

1811/B00P/R0001/Ceiling Structures/Linings/S25

Chrysotile (white asbestos)

B00P - R0002 - General Storeroom

Ceiling Structures/Linings Flat AC Sheeting 22m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

1811/B00P/R0001/Ceiling Structures/Linings/S25

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00Q - Shed - 1950 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00Q/Eaves Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	Non Accessible Area - No access - No manhole in building					

Interior**B00Q - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00Q/R0001/Ceiling Structures/Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00R - Other-Commercial - 1979 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1811/B00R/Eaves Linings/S34				No Asbestos Detected	
Gable Verge Lining	Flat AC Sheeting 1811/B00R/Gable Verge Lining/S38				No Asbestos Detected	
Ceiling Void	Non Accessible Area - No access - No manhole in building					
Electrical Backing Board	Resinous Board 1811/B00R/Electrical Backing Board/S43				No Asbestos Detected	

Interior**B00R - R0001 - Other-Commercial**

No Asbestos

B00R - R0002 - Other-Commercial

No Asbestos

B00R - R0003 - Other-Commercial

No Asbestos

B00R - R0004 - Other-Commercial

No Asbestos

B00R - R0005 - Other-Commercial

No Asbestos

B00R - R0006 - Other-Commercial

No Asbestos

B00R - R0007 - Other-Commercial

No Asbestos

B00R - R0008 - Other-Commercial

No Asbestos

B00R - R0009 - Other-Commercial

No Asbestos

B00R - R0010 - Other-Commercial

No Asbestos

B00R - R0015 - Other-Commercial

No Asbestos

B00R - R0016 - Other-Commercial

No Asbestos

B00R - R0017 - Plant

No Asbestos

B00R - R0018 - Cleaning Distributed Store

No Asbestos

B00R - R0019 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1811/B00R/R0019/Ceiling Structures/Linings/S41				Chrysotile (white asbestos)	

B00R - R0020 - Special Education Support Centre

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00S - Communal Facilities - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00S - R0001 - Movement**

No Asbestos

B00S - R0002 - Communal Space

No Asbestos

B00S - R0003 - Plant

No Asbestos

B00S - R0004 - Cleaning Distributed Store

No Asbestos

B00S - R0005 - Toilets - Girls

No Asbestos

B00S - R0006 - Security Store

No Asbestos

B00S - R0007 - P.E. Store

No Asbestos

B00S - R0008 - Sports Store

No Asbestos

B00S - R0009 - Movement

No Asbestos

B00S - R0010 - Movement

No Asbestos

B00S - R0011 - Lift

No Asbestos

B00S - R0012 - Raised Platform

No Asbestos

B00S - R0013 - Movement

No Asbestos

B00S - R0014 - Movement

No Asbestos

B00S - R0015 - General Assistant/Bulk Store

No Asbestos

B00S - R0016 - Hall Chair Store

No Asbestos

B00S - R0017 - General Storeroom

No Asbestos

B00S - R0018 - Toilets - Boys

No Asbestos

B00S - R0019 - Disabled Toilet

No Asbestos

B00S - R0020 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00T - Pupil Facilities - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00T - R0001 - Canteen**

No Asbestos

B00T - R0002 - Canteen Office/Store

No Asbestos

B00T - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Library - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00U - R0001 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00U - R0002 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00U - R0003 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00U - R0004 - Communications Cupboard

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00U - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00U - R0006 - Movement

No Asbestos

B00U - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00V - Mechanical Services - 2007 - Metal Shed (Metal Shed)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00V - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00W - Other - 2007 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00W - R0001 - Uniform Shop

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00X - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00X - R0001 - Toilets - Boys**

No Asbestos

B00X - R0002 - Access Shower/Toilet/Change

No Asbestos

B00X - R0003 - Toilets - Girls

No Asbestos

B00X - R0004 - Other

No Asbestos

B00X - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00Y - R0001 - External Movement**

No Asbestos

B00Y - R0002 - Practical Activities - 1hb

No Asbestos

B00Y - R0003 - Home Base Store

No Asbestos

B00Y - R0004 - Home Base

No Asbestos

B00Y - R0005 - Withdrawal Space - 2hb

No Asbestos

B00Y - R0006 - Home Base

No Asbestos

B00Y - R0007 - Home Base Store

No Asbestos

B00Y - R0008 - Practical Activities - 1hb

No Asbestos

B00Y - R0009 - Practical Activities - 1hb

No Asbestos

B00Y - R0010 - Home Base Store

No Asbestos

B00Y - R0011 - Home Base

No Asbestos

B00Y - R0012 - Withdrawal Space - 2hb

No Asbestos

B00Y - R0013 - Home Base

No Asbestos

B00Y - R0014 - Home Base Store

No Asbestos

B00Y - R0015 - Practical Activities - 1hb

No Asbestos

B00Y - R0016 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00Z - Other/Pupil Facilities - 2008 - Steel (Steel)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00Z - R0001 - Uniform Shop**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables**Demountable details as per the AMS records as of 15 Feb 2017.****OS 603 - D10059 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 23/01/2017**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12133 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D14290 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 6/02/2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14561 - Learning Unit - Standard With P.A.A. : Placement Date - 17/01/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D15923 - Learning Unit - Standard/Withdrawal : Placement Date - 8/01/1997**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
-------------	---------------------	------------------	---------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 620 - D17736 - Single Learning Unit - H/Cap : Placement Date - 26/06/2014						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - Home Base-I.O.						
No Asbestos Found.						
R3 - Disabled Shower/laundry						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017