


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Dundas Public School (4029)
Region : Western Sydney
State Electorate : Parramatta
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 21 - Jan - 2008
Reviewed By : Greencap-NAA : 22 - Jun - 2015

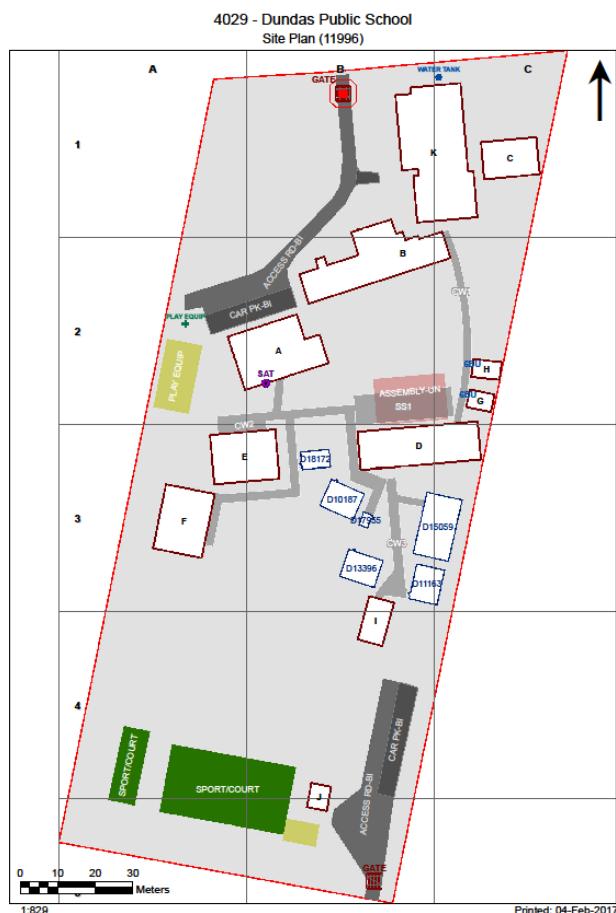

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - Administration/Library - 1974 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting 4029/B00A/Eaves Linings/S5				No Asbestos Detected	
Underfloor Voids	Non Accessible Area - No sub-floor entrance.					
Ceiling Voids	No Asbestos Found					
Interior						
B00A - R0001 - Movement						
No Asbestos						
B00A - R0002 - General Assistant/Bulk Store						
No Asbestos						
B00A - R0003 - Staff Room						
Floor Coverings Res/Textile	Red tile under vinyl sheet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
Floor Coverings Res/Textile	Red tile under carpet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	40m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive under red tile under carpet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0004 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Red tile under vinyl sheet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0005 - Home Base						
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Red tile under carpet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	57.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0006 - Movement						
Floor Coverings Res/Textile	Red tile under vinyl sheet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	35m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0007 - Security Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
		Sample No			Test Result	
Floor Coverings Res/Textile	Red tile under vinyl sheet	29.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
Security door	Encapsulated Insulation material within unit	3m2	North-west	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Abestos encased in metal					
B00A - R0008 - Distribution Board				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive red vinyl tile					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
Electrical Backing Board	Resinous Board	1m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4029/B00A/R0008/Electrical Backing Board/S10				Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Membrane	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot sample - Live.					
B00A - R0009 - Cleaning Distributed Store						
Ceiling Structures/Linings	Vermiculite					
	4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Red tile under vinyl sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0010 - Plant						
Floor Coverings Res/Textile	Red tile under vinyl sheet	0.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0011 - Deputy Principal						
Ceiling Structures/Linings	Vermiculite					
	4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Red tile under carpet	14.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0012 - Staff Toilet						
Ceiling Structures/Linings	Vermiculite					
	4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
B00A - R0013 - Staff Toilet						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
		Sample No			Test Result	
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
B00A - R0014 - Sick Bay						
Floor Coverings Res/Textile	Red tile under vinyl sheet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	6.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under red tile under vinyl sheet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0015 - Clerical Office/Workroom						
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Red tile under carpet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	12.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0016 - Principal						
Ceiling Structures/Linings	Vermiculite 4029/B00A/R0008/Ceiling Structures/Linings/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Red tile under carpet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	18.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R0017 - Stairs						
No Asbestos						
B00A - R0018 - Main Electrical Board						
No Asbestos						
B00A - R1001 - Communications Room						
Floor Coverings Res/Textile	Red tile under carpet 4029/B00A/R0003/Floor Coverings Res/Textile/S6	77.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet 4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R1002 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 4029/B00A/R1002/Ceiling Structures/Linings/S7	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R1003 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles 4029/B00A/R0003/Floor Coverings Res/Textile/S6	25m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive under red tile. 4029/B00A/R0003/Floor Coverings Res/Textile/S6	24.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R1004 - Staff Toilet						
No Asbestos						
B00A - R1005 - Staff Toilet						
No Asbestos						
B00A - R1006 - Library Office/Workroom						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No			Test Result		
Floor Coverings Res/Textile	Red tile under carpet	17.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R1007 - Reading Area						
Floor Coverings Res/Textile	Red tile under carpet	130.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Ahesive under red tile under carpet					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B00A - R1008 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive under red tile.					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	0.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R1002/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
B00A - R1009 - Distribution Board				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R1002/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive under red tile.					
	4029/B00A/R0008/Floor Coverings Res/Textile/S8				No Asbestos Detected	
Electrical Backing Board	Resinous Board	0.5m2	North-west	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R0008/Electrical Backing Board/S10				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R1002/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
B00A - R1010 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00A/R1002/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Administration - 1959 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0012/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	16m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00B/Gable verge lining/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement**

Electrical Mounting Board	Resinous Membrane	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Cannot sample - Live.						

B00B - R0002 - Community Clinic

No Asbestos

B00B - R0006 - General Storeroom

No Asbestos

B00B - R0007 - Personal Effects Storage

No Asbestos

B00B - R0008 - Home Base Store

Non Accessible

B00B - R0009 - Home Base

No Asbestos

B00B - R0010 - Staff Toilet

No Asbestos

B00B - R0011 - Home Base

No Asbestos

B00B - R0012 - Withdrawal Space - 1hb

No Asbestos

B00B - R0013 - Home Base Store

No Asbestos

B00B - R0014 - Personal Effects Storage

No Asbestos

B00B - R0015 - Uniform Shop

No Asbestos

B00B - R0016 - Movement

No Asbestos

B00B - R0017 - Cleaning Distributed Store

No Asbestos

B00B - R0018 - Special Programs Room

No Asbestos

B00B - R0019 - General Storeroom

No Asbestos

B00B - R0020 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0012/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0021 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No			Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)

4029/B00D/R0012/Ceiling Structures/Linings/S4

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0022 - General Storeroom

No Asbestos

B00B - R0023 - Canteen

No Asbestos

B00B - R0024 - Canteen Office/Store

No Asbestos

B00B - R0025 - Staff Toilet

No Asbestos

B00B - R0026 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00C - Other/Multi Purpose Facilities - 1952 - Steel (Steel)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - Movement**

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Communal Space

Floor Coverings Res/Textile	Blue vinyl under carpet	53.29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Cannot sample would cause excessive damage to carpet. Cannot determine if material is						

B00C - R0004 - Communal Space

Floor Coverings Res/Textile	Blue vinyl under carpet	53.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - cannot sample would cause						

Safe	Encapsulated Insulation material within unit	10m2	Southeast corner.	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Item inaccessible - Material encased						

B00C - R0005 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1959 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0012/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - General Storeroom**

No Asbestos

B00D - R0002 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0004/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under white tile under carpet					
	4029/B00D/R0002/Floor Coverings Res/Textile/S12			No Asbestos Detected		

B00D - R0003 - Craft Store

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0004/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under white tile.					
	4029/B00D/R0002/Floor Coverings Res/Textile/S12			No Asbestos Detected		

B00D - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0004/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under white tile.					
	4029/B00D/R0002/Floor Coverings Res/Textile/S12			No Asbestos Detected		

B00D - R0005 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Around heater-sw corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0006/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Around heater-sw corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0006/Wall Linings Internal/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Personal Effects Storage

No Asbestos

B00D - R0010 - Sports Store

Floor Coverings Res/Textile	Vinyl Sheet					
	4029/B00D/R0010/Floor Coverings Res/Textile/S13			No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Sheet					
	4029/B00D/R0010/Floor Coverings Res/Textile/S14			No Asbestos Detected		

B00D - R0011 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0012/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0012 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4029/B00D/R0012/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 2005 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Practical Activities - 1hb

No Asbestos

B00E - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2005 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Movement

No Asbestos

B00F - R0002 - Practical Activities - 1hb

No Asbestos

B00F - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00G - Pupil Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior**B00G - R0001 - Toilets - Boys**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - Pupil Facilities/Building Services - 1991 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Garden Store

No Asbestos

B00H - R0002 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Special Purpose (Craft Art Science Tas Etc) - 2008 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - External Movement

No Asbestos

B00I - R0002 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00J - Pupil Facilities - 2000 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - External Movement**

No Asbestos

B00J - R0002 - Sports Store

No Asbestos

B00J - R0003 - Sports Store

No Asbestos

B00J - R0004 - Disabled Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00K - Tiered Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Communal Space

No Asbestos

B00K - R0002 - Raised Platform

No Asbestos

B00K - R0003 - Chair Storeroom

No Asbestos

B00K - R0004 - Communal/Performance Store

No Asbestos

B00K - R0005 - P.E. Store

No Asbestos

B00K - R0006 - Toilet - Lobby

No Asbestos

B00K - R0007 - Toilets - Girls

No Asbestos

B00K - R0008 - Sound Cupboard

No Asbestos

B00K - R0009 - Toilet - Lobby

No Asbestos

B00K - R0010 - Toilets - Boys

No Asbestos

B00K - R0011 - Cleaning Distributed Store

No Asbestos

B00K - R0012 - Plant

No Asbestos

B00K - R0013 - Main Switch Board

No Asbestos

B00K - R0014 - Access Shower/Toilet/Change

No Asbestos

B00K - R0015 - Covered Outdoor Learning Area

No Asbestos

B00K - R0016 - Movement

No Asbestos

B00K - R0017 - Movement

No Asbestos

B00K - R0018 - Ramp

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10187 - Learning Unit - Standard With P.A.A. : Placement Date - 10/06/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11163 - Learning Unit - Standard With P.A.A. : Placement Date - 7/09/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13362 - Learning Unit - Standard With P.A.A. : Placement Date - 12/05/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13396 - Learning Unit - Standard With P.A.A. : Placement Date - 10/06/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

NS 101 - D15059 - Learning Unit - Double Primary/PAA : Placement Date - 27/09/2007

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Interior						
R1 - Home Base						
No Asbestos Found.						
R2 - Home Base						
No Asbestos Found.						
R3 - Entry						
No Asbestos Found.						
R4 - Practical Activity Area						
No Asbestos Found.						
R5 - Home Base Store						
No Asbestos Found.						
R6 - Practical Activity Area						
No Asbestos Found.						
R7 - Entry						
No Asbestos Found.						
OS 837 - D17955 - Hcap Shower/Change/Toilet : Placement Date - 24/07/2006						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Interior						
R1 - Disabled Shower/Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				12 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
OS 750 - D18172 - Learning Unit - ESL : Placement Date - 6/01/2006						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Esl						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017